# Historic Resources Survey Report Butts County, Georgia

July 2015





The University of Georgia College of Environment and Design Center for Community Design & Preservation Historic Resources Survey Report Butts County, Georgia 2015

### **Credits**

#### Report Submitted to:

Georgia Transmission Corporation 2100 East Exchange Place Tucker, Georgia, 30084-5342

#### Report Prepared by:

Center for Community Design and Preservation at the University of Georgia http:://www.ced.uga.edu/pso 225 W Broad St Athens, Georgia, 30062

Pratt Cassity – Principal Investigator Laura Kviklys – Project Coordinator

Andrew Stern, MHP– Field Survey, Report Creation Lee Bailey, MEPD– Field Survey Eleonora Machado, CCDP Graphics Coordinator, Report design

# **Table of Contents**

Page 4	List of Figures
Page 4	List of Tables
Page 5	Introduction
Page 7	Project Description
Page 8	Methodology
Page 9	Criteria for Evaluation
Page 11	Survey Results
Page 18	Integrity
Page 20	Conclusion
Page 21	Resource Templates
Page 168	Bibliography

# List of Figures






Figure 1.	Project Survey Area of Butts County	Page 6
Figure 2.	Identified Historic Resources in Butts County	Page 10

Resource Type	Count	Percent
Building	118	83.1%
Site	24	16.9%

Building Type	Count	Percent
Bungalow: Cross Gable		1 0.8%
Bungalow: Front Gable		1 0.8%
Bungalow: Side Gable		6 5.1%
Central Hallway	1	7 14.4%
Double Pen		4 3.4%
Front Gable Church		3 2.5%
Gabled Ell Cottage	1.	3 11.0%
Georgian Cottage	1.	2 10.2%
Georgian House		2 1.7%

Date of Construction	Count	Percent	
1820-1829		1	0.7%
1830-1839		3	2.1%
1840-1849		4	2.8%
1850-1859		6	4.2%
1860-1869		2	1.4%
1870-1879		5	3.5%
1880-1889		5	3.5%
1890-1899	2	1	14 8%

Current Use	Count		Percent
Funerary: Cemetery	2	22	15.5%
Campground		1	0.7%
Museum		1	0.7%
Religious Facility		3	2.1%
Residential: Single			
Family Dwelling	9	)5	66.9%
Commercial: Store		3	2.1%
Vacant	1	7	12.0%

## List of Tables

Table 1.	All Identified Resources	Page 12
Table 2.	Resource Type	Page 17
Table 3.	Current Use	Page 17
Table 4.	Date of Construction	Page 17
Table 5.	Residential Building Type	Page 18
Table 6.	Architectural Style	Page 18

### Introduction

#### What is a cultural resource survey?




The Georgia Historic Resources Survey statewide survey of buildis an ongoing, sites, structures, and objects ings, historical, architectural, and cultural significance. The Georgia Survey is one of the programs administered by the Historic Preservation Division of the Department of Natural Resources (HPD).

Completed surveys can be used to identify individual buildings and districts for possible listing in the Georgia Register of Historic Places; assist the preservation efforts of Georgia's Certified Local Governments; support local designations of buildings and districts; expedite environmental review by governmental agencies;

aid preservation and land-use planning; and promote research of the state's history and architecture. Through the public's participation, encouraged by the HPD, surveys can increase awareness of a community's historic resources.

A goal of historic resource survey is to collect a minimum level of information needed statewide for preservation activities. This basic, standard survey does not gather all the kinds of information needed in local preservation planning, environmental review, National Register nominations, or historical research, but serves as a foundation for these preservation activities.

<sup>1&</sup>lt;>>. "Georgia Historic Resources Survey Manual," Atlanta: Georgia Department of Natural Resources, Historic Preservation Division, 2000.

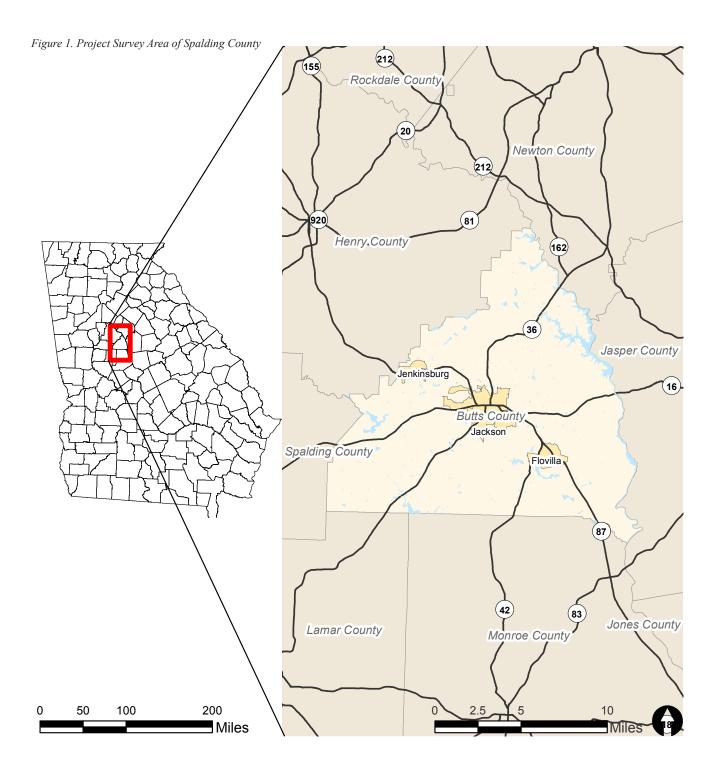

Sources: Atlanta Regional Commision, Esri, State Base Map of Georgia

# **Project Description**

The Findit! Program housed at the Center for Community Design and Preservation (CCDP) within the University of Georgia's College of Environment and Design (CED) conducted a Phase I Historic Resource Survey of Butts County, Georgia in July 2015. Findit! Is a state-wide cultural resource survey program sponsored by the Georgia Transmission Corporation (GTC) in partnership with the Georgia Department of Natural Resources, Historic Preservation Division (GA SHPO). The project area covered the 184 square mile county, identifying resources only in unincorporated portions. Butts County is located in the Three Rivers area of Georgia, and is bordered by Newton and Henry counties to the north, Jasper County to the east, Monroe, Lamar and Spalding counties the south and west.

The resource survey was performed by historic graduate students in the Historic Preservation program (MHP) and the Masters of Environmental Planning and Design (MEPD) at the CED. The survey consisted of historical and developmental research of the project area, identifying previous surveys and listed districts within the county, windshield and pedestrian field work, and data collection and analysis.

The information collected by the field survey was entered into Georgia's Natural, Archaeological, and Historic Resources Geographical Information System, (GNARHGIS), a web-based geographical information system designed to store and display information about Georgia's cultural resources. GNARHGIS is the repository for all of the current statewide historic resources survey data. The survey information was entered under survey ID 2307, "Findit Butts County," and can be accessed at: https://www.gnahrgis.org/gnahrgis/index.do.

Karen Anderson-Cordova and Leigh Burns. Preservation Primer: A Resource Guide for Georgia, Atlanta: Georgia Department of Natural Resources, Historic Preservation Division, 2011, 5.

# Methodology

The survey was conducted according to the procedures outlined in The Georgia Historic Resources Survey Manual. The surveyors used a combination of USGS base maps and GIS data to identify potentially historic parcels and structures.

The survey was conducted according to the procedures outlined in The Georgia Historic Resources Survey Manual. The surveyors used a combination of USGS base maps and GIS data to identify potentially historic parcels and structures. The area was surveyed over the course of several days with systematic coverage of the project area.

Each assigned resource (within the assigned boundaries) was assessed for historic significance, and architectural integrity. A Georgia Historic Resources survey form was completed for buildings having a minimum level of architectural integrity. A structure with architectural integrity is one that generally retains its original location, design, setting, materials, workmanship, feeling and association. Properties with a significant loss of physical integrity, or those lacking historic significance were not surveyed. The physical condition of structures was not a consideration for identification for resources which retained architectural integrity.

All identified resources were approximately 50 years old or older, with the exception of Ranch Houses which were documented with a construction date prior to 1975. All properties surveyed were assigned an identification number then documented with the completion of a Georgia Historic Resource Survey Form, as well as photo documentation and corresponding georeferencing data. The survey form includes information about the use, style, floor plan, materials, context, physical description and an accurate determination of the date of construction and additions. Sources utilized for age determination and architectural style and type description included Lee and Virginia McAlester's A Field Guide to American Houses, the Georgia Historic Resources Survey Manual, Georgia's Living Places and A Visual Guide to Architecture by Francis D. K. Ching. All dates of construction are presented in nine year increments unless explicitly identified by markers or other documentation.

<sup>&</sup>lt;sup>1</sup> Georgia's Living Places: Historic Houses in their Landscaped Settings (1991), http://georgiashpo.org/sites/uploads/hpd/pdf/NR15arch\_20080521100904\_optimized.pdf, (accessed August 01, 2012).

### Criteria for Evaluation

#### National Register for Historic Places

Each resource was evaluated for potential listing in the National Register of Historic Places (NRHP), those resources already listed in the Register have been noted. The criteria for listing are outlined in the National Register Bulletin How to Apply the National Register Criteria for Evaluation published by the U.S Department of Interior, National Park Service. Cultural resources can be defined as eligible for the NRHP if they:

- A. Are associated with events that have had a significant contribution to a broad pattern of history; or
- B. Are associated with the lives of persons significant in the past;
- C. Embody distinctive characteristics of a type, period, or method of construction, or represent the work of a master, possess high artistic values, or represent a significant and distinguished entity whose components may lack distinction; or
- D. Have yielded or may be likely to yield, information important to history or prehistory.1

Ordinarily cemeteries, birthplaces, or graves of historical figures, properties owned by religious institutions or used for religious purposes, structures that have been moved from their original locations, reconstructed historic buildings, properties primarily commemorative in nature, and properties that have achieved significance within the last 50 years are not considered for the National Register. However, properties will qualify if they are integral parts of districts that do meet the criteria or they fall within the following categories:

- from architectural or artistic distinction or historical importance; or
- b. A building or structure removed from its original location but which is significant primarily for architectural value, or which is the surviving structure most importantly associated with a historic person or event; or
- A birthplace or grave of a historical figure of outstanding importance if there is no appropriate site or building directly associated with his or her productive life; or
- d. A cemetery which derives its primary significance from graves or persons of transcendent importance, from age, from distinctive design features, or from association with historic events; or
- e. A reconstructed building when accurately executed in a suitable environment and presented in a dignified manner as part of a restoration master plan, and when no other building or structure with the same association has survived; or
- A property achieving significance within the last 50 years if it is of exceptional importance.

For a property to qualify for the National Register it must meet one of the National Register Criteria for Evaluation by:

- Being associated with an important historical context and
- Retaining historic integrity of those features to convey its significance.


To determine whether a property or site retains integrity, it needs to be evaluated for the aspects of its location, design, setting, workmanship, materials, feeling, and association to convey its historic significance.<sup>2</sup>

a. A religious property deriving primary significance

¹The Criteria for Evaluation are found in the Code of Federal Regulations, Title 36, Part 60, reprinted in U.S. Department of Interior, National Park Service, National Register Bulletin: How to Apply the National Register Criteria for Evaluation, Washington, D.C., 1997, p. 2-3.

<sup>&</sup>lt;sup>2</sup>A complete list of areas of significance can be accessed at http://www.nps.gov/nr/publications/bulletins/nrb15/nrb15\_5.htm

Figure 2. Identified Historic Resources in Butts County

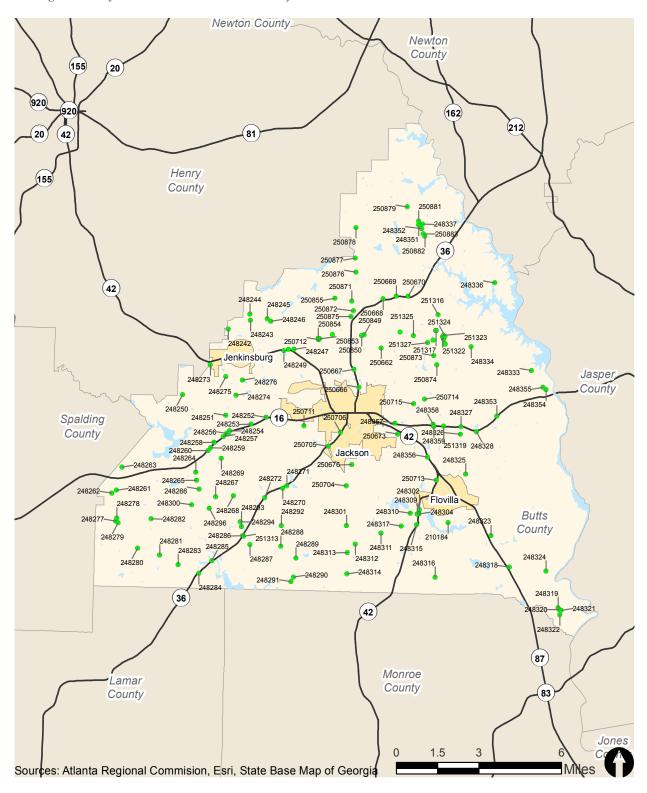

# Survey Results

A total of 142 historic resources that meet and maintain a minimum level of age, architectural integrity, and historic significance were identified in unincorporated Butts County. These resources are primarily buildings, with 118 resources remaining county wide. Of the built resources, the two most represented house types are the New South Cottage (37 resources, 31.4 % of total) and the Central Hallway Cottage (17 resources, 14.4 % of total). The Gable Ell Cottage and the Georgian Cottage both had an adequate representation, with 13 and 12 extant resources respectively.

The survey identified architectural styles that were popular in the late 19th and early 20th centuries. Elements of the Folk Victorian style were noted on 18 extant resources (15.3 %), which is indicative of early 20th century construction. Elements of the Craftsman style are still present on 11 resources (15.3%), which was popular from approximately 1920-1935.

A total of 83 (70.3%) documented structures exhibited no architectural style. A building with no architectural style may be historic, but does not have any characteristics or elements of high style, or classical architecture. Buildings in unincorporated areas usually do not embody high styles, and this figure is representative of vernacular architecture across the state. The variance in building type and architectural styles exhibited in unincorporated Butts County is typical for historically agrarian Georgia communities.

Table 1: All Identified Resources

Name	ResourceID	Latitude I	Longitude	Description	NRHP Eligibility
1	248242	33.33643		Gabled Ell Cottage	Does not meet
				Central Hallway	
2	248243	33.34120523	-84.02826376	Cottage	May Meet
				-	
3	248244	33.34437722	-84.02872087	New South Cottage	Does not meet
				Central Hallway	
4	248245	33.34208071	-84.0178314	Cottage	Does not meet
5	248246	33.34088371	-84.01557569	Saddlebag	Does not meet
6		33.32653901		<b>New South Cottage</b>	
7	248248	33.32651098	-84.00417481	Hall-parlor	Does not meet
8	248249	33.32588314	-84.00710659	New South Cottage	May Meet
				Bungalow: cross	
9	248250	33.30211104	-84.07013239	gable	May Meet
10	248251	33.29183189	-84.04284237	New South Cottage	Does not Meet
	<b>4.102.72</b>	22 2042555	04.04.5004.5	N C 4 C 4	
11		33.29125753		New South Cottage	
12	248253	33.2875006	-84.02677689	Georgian House	Appears to meet
13	248254	33.28392195	94.04026002	<b>New South Cottage</b>	A ====================================
13	240254	33.20392193	-04.04020093	Thew South Cottage	Appears to meet
14	248255	33.28266096	-84 04189346	Front Gable Church	May Meet
15		33.28247964	-84.04111933		Does not Meet
13	210200	33.202 17901		Bungalow: side	Boos not meet
16	248257	33.28091508	-84.04419974	•	May Meet
17		33.27781472		Georgian Cottage	Does not Meet
18		33.27496092	-84.05200711		Does not Meet
19		33.27352086		New South House	May Meet
				Central Hallway	,
20	248261	33.25212757	-84.11061344	<u>-</u>	May Meet
				Central Hallway	
21	248262	33.25065467	-84.11351484	_	May Meet
22	248263	33.26416816	-84.10736802	New South Cottage	May Meet
23	248264	33.26203951	-84.06107746	New South Cottage	May Meet
24	248265	33.25799539	-84.06044965		May Meet
25	248266	33.25358605	-84.05879394	Georgian Cottage	May Meet
26		33.24968414		New South Cottage	
27	248268	33.2503445	-84.03715021	Gabled Ell Cottage	May Meet
•	0.400.60	22.260.7400.5	0404510055	N C 4C "	36 36
28	248269	33.26954986	-84.04510055	New South Cottage	May Meet
20	249270	22.25404150	04.00/2070/	Bungalow: side	M M
29		33.25484179	-84.00629706		May Meet
30	248271	33.25598437	-84.0036/397	Georgian Cottage	Does not meet

31	248272	33.2497086	-84.01747787	New South Cottage	May Meet
				Country Line Baptist Church	
32	248273	33.31787483	-84.05304694	•	Does not Meet
33	248274	33.30242889		Georgian Cottage	Does not Meet
33	240274	33.30242889	-04.03003973	Georgian Cottage	Does not wicet
34	248275	33.31177511	-84 0433242	New South Cottage	May Meet
31	210273	33.31177311	01.0133212	Shiloh Baptist	way week
35	248276	33.31028054	-84.0326444	_	Does not Meet
36	248277	33.23625671		The Foster Estate	Does not Meet
				Central Hallway	
37	248278	33.23780511	-84.10996656	· ·	May Meet
				Central Hallway	<u> </u>
38	248279	33.23534413	-84.1091075	Cottage	May Meet
39	248280	33.22254348	-84.09655133	Shotgun	Does not Meet
40	248281	33.21905498	-84.08265901	New South House	May Meet
41	248282	33.23768666	-84.08853946	Gabled Ell Cottage	May Meet
42	248283	33.21427178	-84.07104633	New South Cottage	May Meet
				Active Use	
43	248284	33.21000169	-84.05795628	Cemetery	Does not Meet
				Department of	
				Corrections	
44	248285	33.21668578	-84.0500934		May Meet
				Single Story	
45	248286	33.22982146	-84.03082163		May Meet
46	251313	33.229578	-84.030209	Gabled Ell Cottage	May Meet
				Central Hallway	
47	248287	33.22531028	-84.02617694		May Meet
40	240200	22 22 4555	04.00606401	Central Hallway	36.36
48	248288	33.22477759	-84.00686481		May Meet
49	248289	33.21874499	-83.99727324	Georgian Cottage	May Meet
50	240200	22 2000202	92 000//427	Now South Cattas	Mov. Most
50	248290 248291	33.2090393 33.20663797		New South Cottage Gabled Ell Cottage	May Meet May Meet
52	248291	33.235476		Gabled Ell Cottage	May Meet
53	248292	33.23451237		Weaver Cemetery	May Meet
54	248293	33.23698815	-84.03170369 -84.03254997		May Meet
34	Z+0Z74	33.43070013	-04.03234337	Towaliga Baptist	iviay ivicci
55	248296	33.24364049	-84 05215317	Church Cemetery	Does not Meet
33	210270	33.27307077	01.05215517	Presbyterian Presbyterian	Doos not Micet
				Fellowship Church	
56	248300	33.24531005	-84.06322758	•	Does not Meet
30	210000	33.2 1031003	5 5 G S Z Z 7 S G	Bungalow: side	_ 555 1101 111001
57	248301	33.23608757	-83.96581694	_	May Meet
		22.2000707		Indian Spring	
58	248302	33.24480112	-83.92027205	Hotel/ Museum	Appears to meet
					F. F

Table 1 Continued: All Identified Resources

	iniaca. 7 iniacht			Indian Springs	
59	248303	33.24292255	-83.92062009	Chapel	Appears to meet
				Indian Springs	
60	248304	33.24271823	-83.92068216	General Store	May Meet
(1	240200	22.24261202	02 02125155	Casusian Cattaga	<b>A</b>
61	248308	33.24261293		Georgian Cottage	Appears to meet
62	248309	33.24266611		Georgian Cottage	May Meet
63	248310	33.24303187	-83.92591393	Gabled Ell Cottage	May Meet
64	248311	33.23246157	-83.94412901	New South Cottage	Does not Meet
				Mt. Vernon Baptist Church and	
65	248312	33.22659387	-83.96015708	Cemetery	Does not Meet
66	248313	33.22208209	-83.96495473	Central Hallway Cottage	May Meet
					·
67	248314	33.21112717	-83.96516201	New South Cottage	May Meet
(0)	240215	22 2251 (150	02 0217414	Bungalow: side	36 36 4
68	248315	33.23716179	-83.9217414		May Meet
69	210184	33.23852		Georgian House	Appears to meet
70	248316	33.21015167		Georgian Cottage	May Meet
71	248317	33.23634432		Central Hallway	May Meet
72	248318	33.21602377		Gabled Ell Cottage	Does not Meet
73	248319	33.19548147	-83.83219288		Does not Meet
74	248320	33.19453154	-83.8316464	Double pen	May Meet
75	248321	33.19414095		New South Cottage	May Meet
76	248322	33.19182431	-83.8311586	Georgian Cottage	May Meet
				Active Use	
77	248323	33.23219182	-83.87516981	Cemetery	Does not Meet
78	248324	33.21425688	-83.84017827	Georgian Cottage	May Meet
					·
79	248325	33.26362964	-83.89152853	<b>New South House</b>	Appears to meet
80	248326	33.28417661	-83.89530834	Plantation Plain	May Meet
					J
81	248327	33.28801563		New South Cottage	May Meet
82	248328	33.28567332	-83.88530926	Plantation Plain	May Meet
83	248333	33.31777223	-83.85129297	Maddox Cemetery	Does not Meet
84	248334	33.32946443	-83.88948803	Plantation Plain	Appears to meet
85	248336	33.36268483	-83.87520019	New South Cottage	May Meet
				Worthville Baptist	•
86	248337	33.39236215	-83.92130961	Church Cemetery	Does not Meet
87	248351	33.39191495		Gabled Ell Cottage	May Meet
			,,,	8-	J
88	248352	33.3900701	-83.92175644	New South Cottage	May Meet
89	251316	33.34575		Family Cemetery	Does not Meet
				,	

				G: 1 TT 1: 1	
				Stark United Methodist Church	
90	251317	33.33752	-83.91166	Cemetery	Does not Meet
91	248353	33.29398091	-83.87272069	Barber Cemetery	May Meet
92	248354	33.30798244	-83.8419233	Plantation Plain	Appears to meet
				Active Use	**
93	248355	33.3092	-83.84393	Cemetery	Does not Meet
0.4	249256	22 27222717	02 01575707	New Couth Cattage	M. M. A
94	248356	33.27223716	-83.915/5/86	New South Cottage	May Meet
95	248357	33.28935425	-83.93656423	No Academic Type	May Meet
96	248358	33.28909954	-83 91243735	New South Cottage	May Meet
70	210330	33.20707731	03.712 13733	Bungalow: side	iviay ivicet
97	248359	33.28791212	-83.91212636	~	May Meet
98	251319	33.288275		Gabled Ell Cottage	May Meet
90	231317	33.200213	-03.303031	Active Use	Iviay ivicci
99	251220	22 22065	92 00502		Dagg mot Most
99	251320	33.33065	-83.90393	Cemetery	Does not Meet
100	251321	33.333157	92 00/0/0	<b>New South Cottage</b>	Annoons to most
100	251321	33.33315/	-83.900808	New South Cottage	Appears to meet
101	251210	22 222752	92 007042	Sida Cabla Cattaga	Mary Mont
101	251318	33.333753		Side Gable Cottage	May Meet
102	251322	33.334572		Cental Hallway	May Meet
103	251323	33.33514		Central Hallway	May Meet
104	251324	33.334755	-83.905907	Georgian Cottage	May Meet
				Bungalow: side	
105	251325	33.334733	-83.925843	gable	May Meet
106	251327	33.33124193	-83.91677247	New South Cottage	May Meet
107	250661	33.33254993	-83.91333058	<b>New South Cottage</b>	Appears to meet
108	250662	33.32814491	_83 94591514	New South House	Appears to meet
109	250666	33.30750048		Gabled Ell Cottage	May Meet
109	230000	33.30730048	-03.93932390	McMichale	Way Wicci
110	250667	22 2169	92 06279	Cemetery	Mary Mont
110	230007	33.3168	-83.902/8	Cemetery	May Meet
112	250668	33.35344845	-83.94530397	New South Cottage	May Meet
112	250669	33.35511764		Central Hallway	May Meet
112		35.55511701	22.72.07.1272		,
113	250670	33.35504762	-83.92951024	No Academic Type	May Meet
114	250672	33.3364793	_82 02/1102	New South Cottage	May Meet
114	230072	JJ.JJU717J	-05.7541102	110W Bould Collage	iviay ivicci
115	250673	33.28382372	-83.93474055	New South Cottage	May Meet
116	250676	33.2675682	-83.96326554	Plantation Plain	Does not Meet
117	250704	33.25648877		New South Cottage	May Meet

Table 1 Continued: All Identified Resources

250705	33.27682938	-83.97809832 New South Cottage	Appears to meet
250706	33 28421809	-83 97063385 New South Cottage	May Meet
			Appears to meet
230711	33,20721343		Appears to meet
250712	33 33188		Does not meet
		Indian Springs Holiness	Appears to meet
230713	33.20023044	-03.70773328 Campground	Appears to meet
250714	33 30209343	-83 91811563 New South Cottage	May Meet
			Does not meet
230713	33.27730	-03.724) Central Hanway	Does not meet
250849	33.33471499	-83.95677169 No Academic Type	May Meet
250850	22 22422602	92 05922050 Naw South Cattaga	Mary Moot
			May Meet
230832	33.33430939	-83.9/6/4301 Gabled Ell Cottage	May Meet
250852	22 22224064	92 09461641 Front Gable Church	Does not meet
230634	33.33240000	-85.98555901 Central Hanway	May Meet
250855	33.35334061	-83.97546822 New South Cottage	Does not Meet
			May Meet
		Cedar Rock	
250872	33.347	-83.96385 Cemetery	Does not Meet
			Does not Meet
			May Meet
			May Meet
250876	33,36700543	-83.96258542 New South Cottage	Does not Meet
	22.237.000.0		
250877	33.37422	-83.9632 Unnamed Cemetery	May Meet
		-	May Meet
250879	33.40117631	<u> </u>	May Meet
250881	33.39403425	-83.92382668 New South Cottage	May Meet
		8	
250882	33.38612421	-83.91968838 New South Cottage	May Meet
			Does not Meet
	250706 250711 250712 250713 250714 250715 250849 250850 250852 250853 250854 250855 250871 250872 250873 250874 250875 250876 250876 250877 250878	250706         33.28421809           250711         33.28721543           250712         33.33188           250713         33.26023044           250714         33.30209343           250715         33.29956           250849         33.33471499           250850         33.3343682           250852         33.33456939           250853         33.33224964           250854         33.33240888           250855         33.3534061           250871         33.35209099           250872         33.347           250873         33.32469348           250874         33.31985436           250875         33.3440251           250876         33.36700543           250877         33.37422           250878         33.39010018           250879         33.40117631           250881         33.39403425           250882         33.38612421	250716 33.28421809 -83.97063385 New South Cottage 250711 33.28721543 -83.99358796 Ranch Old Bethlehem 250712 33.33188 -83.98536 Church Cemetery Indian Springs Holiness 250713 33.26023044 -83.90995528 Campground 250714 33.30209343 -83.91811563 New South Cottage 250715 33.29956 -83.9249 Central Hallway 250849 33.33471499 -83.95677169 No Academic Type 250850 33.3343682 -83.95832959 New South Cottage 250852 33.33456939 -83.97674501 Gabled Ell Cottage 250853 33.3324964 -83.98461641 Front Gable Church 250854 33.33240888 -83.98555901 Central Hallway 250855 33.35334061 -83.97546822 New South Cottage 250871 33.35209099 -83.96490449 Central Hallway 250872 33.347 -83.96385 Cemetery 250873 33.32469348 -83.91082945 Central Hallway 250874 33.31985436 -83.91082945 Central Hallway 250875 33.3440251 -83.96535298 Double Pen 250876 33.36700543 -83.96258542 New South Cottage 250877 33.37422 -83.9632 Unnamed Cemetery 250878 33.39010018 -83.96308913 Georgian Cottage Bungalow: Front 250879 33.40117631 -83.93099065 gable 250881 33.39403425 -83.92382668 New South Cottage

#### Table 2. Resource Type

Resource Type	Count	Percent
Building	118	83.1%
Site	24	16.9%

Table 3. Current Resource Use

Current Use	Count	Percent
Funerary: Cemetery	22	15.5%
Campground	1	0.7%
Museum	1	0.7%
Religious Facility	3	2.1%
Residential: Single		
Family Dwelling	95	66.9%
Commercial: Store	3	2.1%
Vacant	17	12.0%

Table 4. Date of Construction


Date of Construction	Count	Percent
1820-1829	1	0.7%
1830-1839	3	2.1%
1840-1849	4	2.8%
1850-1859	6	4.2%
1860-1869	2	1.4%
1870-1879	5	3.5%
1880-1889	5	3.5%
1890-1899	21	14.8%
1900-1909	38	26.8%
1910-1919	41	28.9%
1920-1929	8	5.6%
1930-1939	5	3.5%
1940-1949	C	0.0%
1950-1959	1	0.7%
1960-1969	1	0.7%
Unknown	1	0.7%

Table 5. Identified Residential Building Types

<b>Building Type</b>	Count	Percent
Bungalow: Cross Gable	1	0.8%
Bungalow: Front Gable	1	0.8%
Bungalow: Side Gable	6	5.1%
Central Hallway	17	14.4%
Double Pen	4	3.4%
Front Gable Church	3	2.5%
Gabled Ell Cottage	13	11.0%
Georgian Cottage	12	10.2%
Georgian House	2	1.7%
Hall-parlor	3	2.5%
Hotel	1	0.8%
New South Cottage	37	31.4%
New South House	4	3.4%
No Academic Type	2	1.7%
Plantation Plain	5	4.2%
Ranch	1	0.8%
Saddlebag	2	1.7%
Shotgun	1	0.8%
Side Gable Cottage	1	0.8%
Single Story Commercial	2	1.7%

Table 6. Identified Architectural Styles

Style	Count	Percentage
Colonial Revival	1	0.8%
Craftsman	11	9.3%
Federal	1	0.8%
Folk Victorian	18	15.3%
Greek Revival	3	2.5%
Moderne	1	0.8%
No Academic Style	83	70.3%

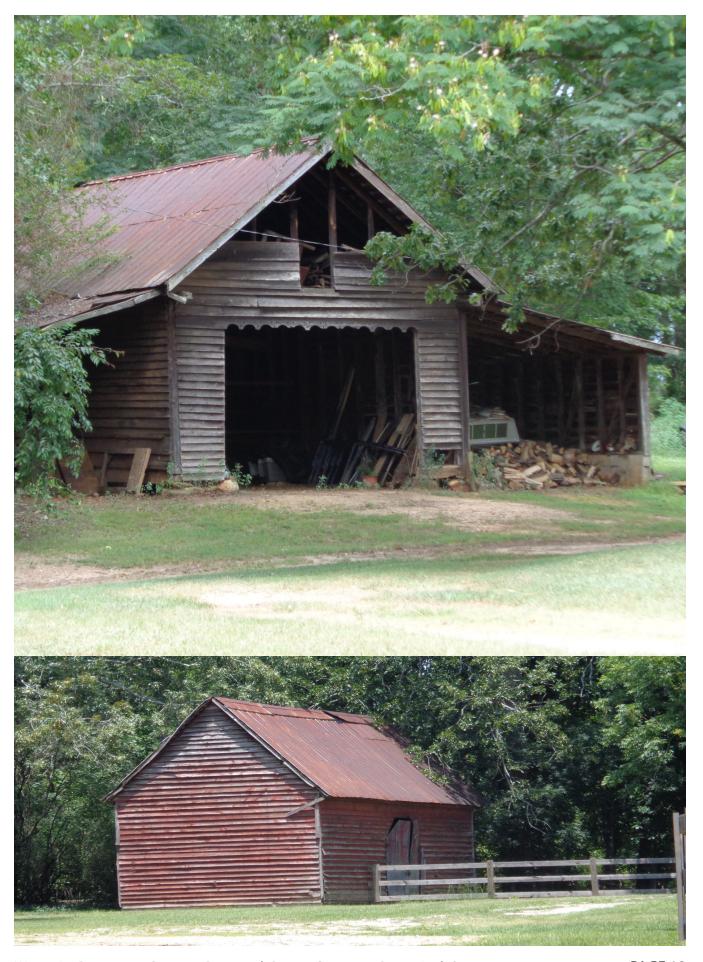

Historic Resource Survey Report | Butts County, Georgia | Summer 2015

# Integrity



A fair majority of the resources in unincorporated Butts County exhibited good to excellent levels of architectural integrity. The integrity of not documented, was often affected by non-historic alterations, which compromise the resource's design, materials, and/or historic workmanship. These changes include additions to the building and material replacement including but not limited to: exterior cladding, porch alterations, window or door replacement, etc.

17 of the 142 (12%) identified resources are currently vacant. Many resources documented as 'vacant' maintain excellent integrity; these resources have few, if any alterations to their historic fabric. Vacant properties are considered highly endangered because they are more susceptible to fire and vandalism. Additionally, repairs and weatherproofing are not carried out in a timely manner, thus leaving the structures to decay. The condition of many of these resources is poor, but with minimal intervention, many of them can be restored.

# Of the resources with minimal alterations, 18 appear to

#### meet the criteria for eligibility for the National Register of Historic Places.

86 resource 'may meet' the National Register criteria; these resources have good to excellent architectural integrity, but warrant further research as to their accurate age and historic significance.

35 documented resources do not appear to meet the National Register standards. These resources may maintain historic significance, but do not meet the age criteria (as is the case with many cemeteries), or have undergone extensive alterations which hinder the resource's architectural integrity. These alterations often affect the design, materials, or workmanship of the particular resource, which invariably destroy the historic feeling and significance.




Historic Resource Survey Report | Butts County, Georgia | Summer 2015

### Conclusion



Butts County has an excellent representation of extant historic resources. The condition and number of intact historic properties, still used for their original intent is comendable in this agrarian county. The disparate location of these resources; however; do not indicate any additional potential historic districts.

A number of mid-century residential and religious structures were documented which may gain historic significance in their own right in the near future. Many mid-century residential resources maintain good integrity with few alterations; religious structures from the same period however, have undergone extensive alterations such as large additions or material replacements. Not documented in this study, but anecdotally noted, were a number of structures dating to the late 1970s and 1980s. If the architecturally integrity of these potential resources remain intact, they may warrant a historic inventory in the coming decades.

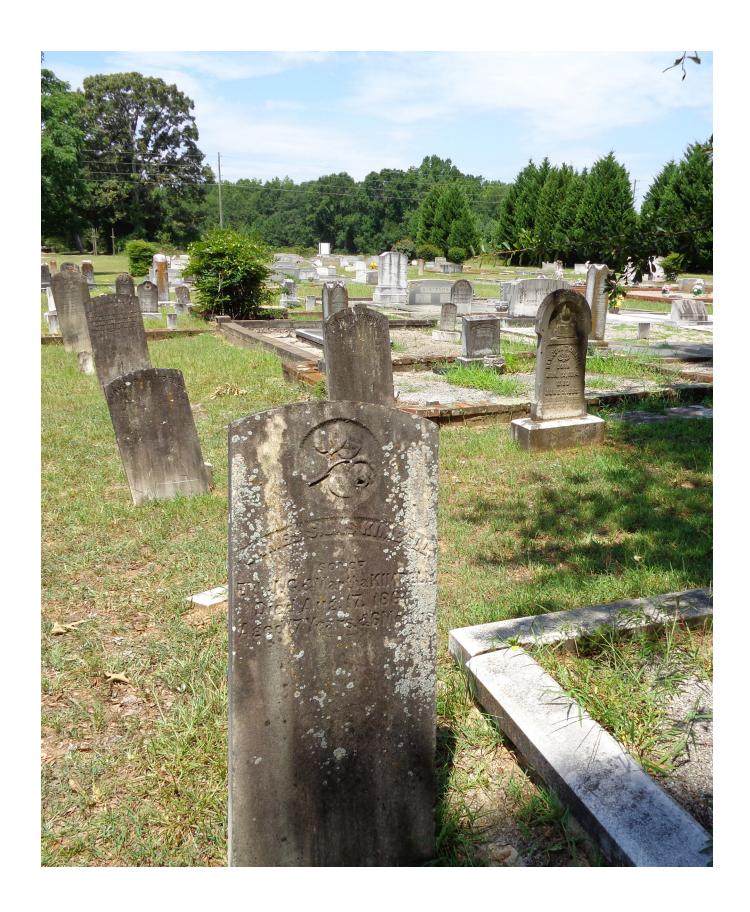

# Butts County CE+DOWN Historic Resource

Field ID: BT-1
GNAHRGIS ID: 248242
County: Butts

County: Preliminary NR

**Assessment:** Does not Meet

**Not Listed** 



309 Burg Rd

**Coordinates:** 33.33643, -84.04222





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1910

**Building Type** Gabled ell cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Cross

**Exterior Cladding** Synthetics: aluminum

siding

Foundation Unknown

**Porch** Portico

Windows Double Hung Sash: 3/1

**Chimney** Center, ridge-line (2):

Brick

**Alterations** Partially enclosed porch

Replacement siding

Rear addition

## **Butts County** CE+D Historic Resource

Field ID: BT-2 **GNAHRGIS ID: 248243** Butts

**County: Preliminary NR** 

Assessment: May Meet Not Listed



380 Oak Wells Rd

**Coordinates:** 33.34092, -84.02879





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1910

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Synthetics: Aluminum

siding

Foundation Pier with Infill:Brick,

concrete block

**Porch** Verandah

Windows Double Hung Sash: 4/4

**Chimney** Off-center Ridge-line:

Brick

**Alterations** Gabled rear addition

Replaced siding

### **Butts County** CE+D Historic Resource

Field ID: BT-3 **GNAHRGIS ID: 248244** 

**County: Preliminary NR Butts** 

**Assessment:** Does not Meet

Not Listed



425 Oak Rd

**Coordinates:** 33.34437, -84.02872





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1900

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Synthetics: Vinyl siding

**Foundation** Unknown

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Replacement siding

Large gabled addition on

Window addition on left

facade

# Butts County CE+DIS Historic Resource

Field ID: BT-4
GNAHRGIS ID: 248245
County: Butts

County: Preliminary NR

**Assessment:** Does not Meet

**Not Listed** 



413 Old Jackson Rd

**Coordinates:** 33.34208, -84.01783





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c. 1890

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill:Stone, CMU

Porch Stoop

**Windows** Double Hung Sash: 4/4,

6/6, Fixed: 6

**Chimney** Both gable ends: Brick

**Alterations** Hipped roof addition

Numerous additions rear L Front sidelights filled Historic rear shed addition

# Butts County CE+DOWN Historic Resource

Field ID: BT-5

GNAHRGIS ID: 248246 County: Butts

**County: Preliminary NR** 

**Assessment:** Does not Meet

Not Listed



382 Old Jackson Rd

Coordinates: 33.34088, -84.01557





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction c. 1890

Building Type 2 Door Saddlebag

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

Windows Double Hung Sash: 6/6,

2/2

**Chimney** None observed

**Alterations** Gabled additions at both

facades

Appears to have removed chimney from center

## **Butts County** EE+DE Historic Resource

Field ID: **BT-6 GNAHRGIS ID: 248247 Butts** 

**County: Preliminary NR** 

**Assessment:** Appears to Meet Not Listed



Corner of Old Bethel Rd and Wolf Creek Rd

**Coordinates:** 33.32653, -84.00066





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1900

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Continuous: Brick

**Porch** Verandah

Windows Double Hung Sash: 2/2,

**Chimney** Off-center Within Roof

Surface (2): Brick

**Alterations** 

# Butts County CE+Dis Historic Resource

Field ID: BT-7

GNAHRGIS ID: 248248 County: Butts

**County: Preliminary NR** 

**Assessment:** Does not Meet


Not Listed



Rivers Auto Sales 2405 Hwy 36 E

**Coordinates:** 33.32651, -84.00417



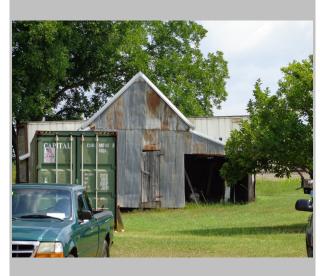

Resource Type Building

**Resource Use** Commercial: Retail Store

**Date of Construction** c. 1910

**Building Type** Hall Parlor

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

Windows Single Hung Sash: 4/4

**Chimney** Both gable ends: brick

**Alterations** Numerous rear additions

## **Butts County** EE+DE Historic Resource

Field ID: BT-8 **GNAHRGIS ID: 248249 Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



Corner of Hwy 36 E and Walter Moore Rd

**Coordinates:** 33.325883, -84.007106





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1900

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill:Brick

**Porch** Verandah

**Windows** Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Large historic additions of

left

Carport on rear

## **Butts County** CE+D Historic Resource

Field ID: BT-9

**GNAHRGIS ID:** 248250 **Butts** 


**County: Preliminary NR** 

Assessment: May Meet Not Listed



Avalon Church South Campus 751 Dean Patrick Rd

**Coordinates:** 33.302111, -84.07013

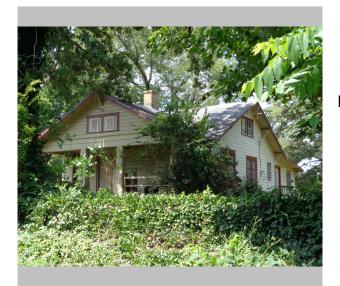



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1920

**Building Type** Bungalow: cross gable

Structural System Balloon Frame

**Style** Craftsman

**Roof** Gable:cross

**Exterior Cladding** Wood: novelty siding/

shiplap

**Foundation** Unknown

**Porch** Verandah

Windows Double Hung Sash: 1/1

**Chimney** Center: Brick

**Alterations** Infilled vents, front gable

Shed addition rear Replaced windows right

gable

# Butts County CE+Dis Historic Resource

Field ID: BT-10
GNAHRGIS ID: 248251
County: Butts

**County: Preliminary NR** 

**Assessment:** Does not Meet

**Not Listed** 



246 England Chapel Rd

**Coordinates:** 33.29183, -84.04284





**Resource Type** Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Synthetics: aluminum

siding

Foundation Unknown

**Porch** Verandah

Windows Double Hung Sash: 1/1

**Chimney** Off-center, ridge-line:

stuccoed masonry

**Alterations** Replacement porch posts,

windows, and siding
Addition on left

## **Butts County** Historic Resource

Field ID: BT-11 **GNAHRGIS ID: 248252 Butts** 

**County: Preliminary NR** 

**Assessment:** Appears to Meet Not Listed



1672 Hwy 16

**Coordinates:** 33.29157, -84.01738





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill:Brick

**Porch** Verandah

Windows Double Hung Sash: 1/1, 4/4

**Chimney** Off-center Within Roof

Surface (2): Brick

**Alterations** Some replaced glass

## **Butts County** CE+DE Historic Resource

Field ID: BT-12 **GNAHRGIS ID: 248253** Butts

**County: Preliminary NR** 

**Assessment:** Appears to Meet Not Listed



1802 Hwy 16

**Coordinates:** 33.28750, -84.02677





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c. 1890

**Building Type** Georgian House

Structural System Balloon Frame

**Style** Folk Victorian

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

Porch Wrap-around

Windows Double Hung Sash: 2/2

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Rear addition

## **Butts County** Historic Resource

Field ID: BT-13 **GNAHRGIS ID:** 248254 **Butts** 

**County: Preliminary NR** 

**Assessment:** Appears to Meet Not Listed



2409 Hwy 16w

**Coordinates:** 33.28391, -84.04026





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction c. 1890

**Building Type** New South House

Structural System Balloon Frame

**Style** Colonial Revival

**Roof** Complex

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

Porch Wrap-around

**Windows** Double Hung Sash: 6/6

**Chimney** Lateral interior: Brick

**Alterations** Rear gable addition

Field ID: BT-14 **GNAHRGIS ID:** 248255 **County:** Butts **Preliminary NR** 

Assessment: May Meet Not Listed



**England Chapel United Methodist** 1998 Hwy 16w

**Coordinates:** 33.28266, -84.04189





Resource Type Building

**Resource Use** Religious: Church

**Date of Construction** c. 1910

**Building Type** Front Gable Church

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown with stucco

**Porch** Stoop

**Windows** Double Hung Sash: 9/9

**Chimney** none observed

**Alterations** 

Field ID: BT-15
GNAHRGIS ID: 248256
County: Butts

County: Preliminary NR

**Assessment:** Does not Meet

**Not Listed** 



Hwy 16w across from England Chapel UMC

**Coordinates:** 33.28252, -84.04135





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling, Vacant

**Date of Construction** c. 1910

**Building Type** Hall Parlor

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

Foundation Unknown

**Porch** None observed

Windows Boearded

**Chimney** Gable-end exterior: Brick

**Alterations** Rear gable addition

Field ID: BT-16 **GNAHRGIS ID: 248257 Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



Hwy 16, W of High Falls Road

**Coordinates:** 33.28091, -84.04419





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling, Vacant

**Date of Construction** C. 1920

**Building Type** Bungalow: Side gable

Structural System Balloon Frame

Style Craftsman

Roof Gable:Front

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier:Brick


Porch Wrap-around


**Windows** Double Hung Sash: 4/1

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Rear gable addition

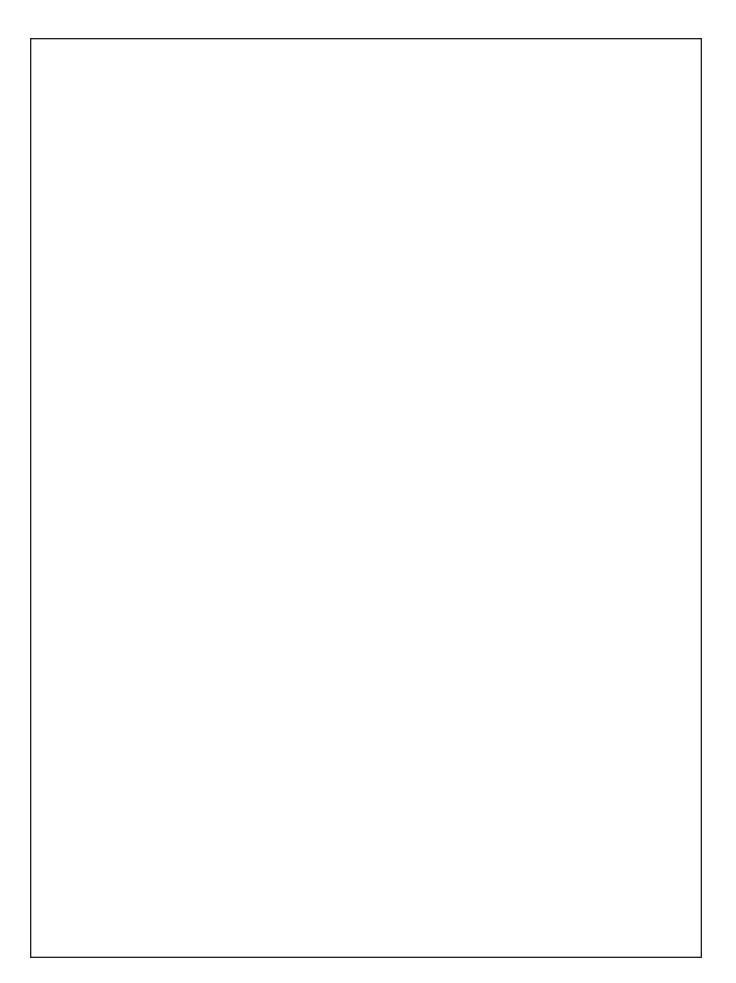

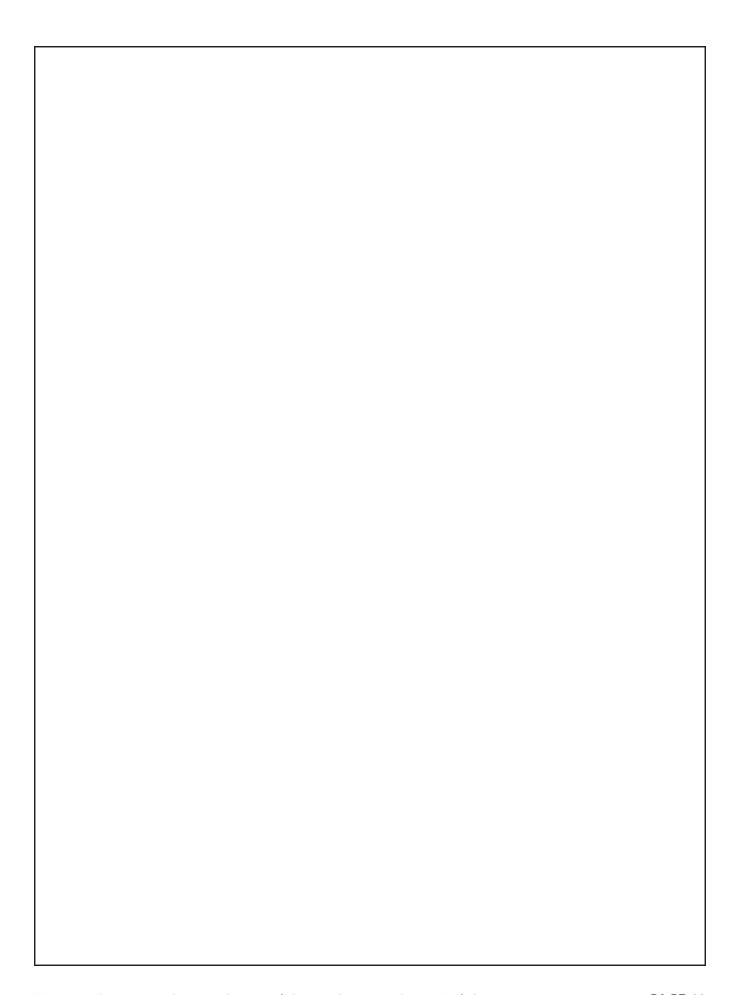

Field ID: BT-17
GNAHRGIS ID: 248258
County: Butts

County: Preliminary NR

**Assessment:** Does not Meet

Not Listed



H.B. Fletcher Home Place 2120 Hwy 16 W

**Coordinates:** 33.27781, -84.04977





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction c. 1890

**Building Type** Georgian cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Complex

**Exterior Cladding** Synthetics: vinyl/

aluminum siding

Foundation Unknown

Porch Wrap-around

**Windows** Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Replacement siding

Many additions/

alterations

Field ID: BT-18
GNAHRGIS ID: 248259
County: Butts

County: Preliminary NR

**Assessment:** Does not Meet

**Not Listed** 



Hwy 16 W across from 2147

**Coordinates:** 33.27496, -84.05200





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling, Vacant

**Date of Construction** c. 1900

**Building Type** Central Door Saddlebag

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

Jalosie

**Chimney** Off-center ridgeline(1),

center(1): Brick

**Alterations** 

Field ID: BT-19 GNAHRGIS ID: 248260 Butts


**County: Preliminary NR** 

Assessment: May meet Not Listed



2495 Hwy 16 W

**Coordinates:** 33.27348, -84.05349

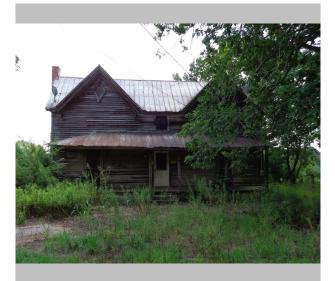



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling, Vacant

**Date of Construction** C. 1920

**Building Type** New South house

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

Foundation Pier:Brick

**Porch** Verandah

**Windows** Double Hung Sash: 9/9

**Chimney** Gable-end exterior: Brick

**Alterations** Rear gabled addition

Field ID: BT-20 **GNAHRGIS ID: 248261** Butts

**County: Preliminary NR** 

Assessment: May Meet Not Listed



2233 Wallace Rd

**Coordinates:** 33.25212, -84.11061





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1900

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** Folk Victorian

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill:Brick

**Porch** Verandah

**Windows** Double Hung Sash: 2/2

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Some replacement

windows

Rear gabled addition

Field ID: BT-21 **GNAHRGIS ID:** 248262 **Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



2281 Wallace Road

**Coordinates:** 33.25065, -84.11351





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1900

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

Windows Double Hung Sash: 1/1

**Chimney** None observed

**Alterations** Addition on left, numerous

House moved from original location

Field ID: BT-22 **GNAHRGIS ID: 248263 Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



195 Jackson Road

**Coordinates:** 33.26416, -84.10736





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1910

**Building Type** New South cottage

Structural System Balloon Frame

**Style** Folk Victorian

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

Porch Wrap-around

Windows Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface(2): Brick

**Alterations** Gabled dormer addition

Rear addition

Field ID: BT-23 **GNAHRGIS ID:** 248264 **Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



173 Joe Lane

**Coordinates:** 33.26203, -84.06107





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1900

**Building Type** New South cottage

Structural System Balloon Frame

**Style** Folk Victorian

**Roof** Gable:cross

**Exterior Cladding** Wood: Weatherboard

Foundation Pier:Brick

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

**Chimney** Off-center Ridge-line(2):

Brick

**Alterations** Rear addition

Field ID: **BT-24 GNAHRGIS ID: 248265 Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



232 Joe Lane Road

**Coordinates:** 33.25799, -84.6044





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1900

**Building Type** Hall-parlor

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill:Stone

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

**Chimney** Gable end exterior: Brick

**Alterations** Numerous rear additions

Chimney on left removed

Field ID: BT-25 **GNAHRGIS ID: 248266 Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



296 Joe Lane Road

**Coordinates:** 33.25358, -84.05879



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1910

**Building Type** Georgian cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

Windows Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Porch addition on right

Rear shed addition

Field ID: BT-26 **GNAHRGIS ID: 248267 Butts** 

**County: Preliminary NR** 

Appears to meet Not Listed **Assessment:** 



214 Kinards Mill Rd

**Coordinates:** 33.24968, -84.04838





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c. 1900

**Building Type** New South cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill:Brick

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Rear shed addition

Field ID: BT-27 **GNAHRGIS ID: 248268 Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



2531 High Falls Rd

**Coordinates:** 33.25024, -84.03718





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1900

**Building Type** Gabled ell cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Cross

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Stoop

Windows Double Hung Sash: 4/4

**Chimney** None observed

**Alterations** Gabled addition on Left

Removed chimney Added awning

Field ID: BT-28 **GNAHRGIS ID: 248269 Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



Dean Patricle Rd, .1 mi w of High Falls Rd

**Coordinates:** 33.26954, -84.04510





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C. 1900

**Building Type** New South cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

**Windows** Double Hung Sash: 2/2

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Rear shed addition

Replacement doors

Field ID: BT-29 **GNAHRGIS ID:** 248270 **Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



White Oak Farm 2098 Hwy 36

**Coordinates:** 33.25484, -84.00629





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1920

**Building Type** Bungalow: side gable

Structural System Balloon Frame

Style Craftsman

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill:Brick

Porch Recessed

Windows Double Hung Sash: 12/1

**Chimney** Gable-end exterior: Brick

**Alterations** Rear gabled additions

Field ID: BT-30
GNAHRGIS ID: 248271
County: Butts

County: Preliminary NR

**Assessment:** Does not Meet

**Not Listed** 



2071 Hwy 36

**Coordinates:** 33.25598, -84.00367





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c. 1900

**Building Type** Georgian Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Stoop

**Windows** Double Hung Sash: 6/6

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Additions on right and left

Field ID: BT-31 GNAHRGIS ID: 248272

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet Not Listed



2271 Hwy 36

**Coordinates:** 33.24970, -84.01747



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling, vacant

**Date of Construction** C 1900

**Building Type** New South cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

Synthetics: aluminum

**Foundation** Unknown

**Porch** Verandah,

Wrap-around

Windows Double Hung Sash: 1/1

**Chimney** None observed

**Alterations** Porch addition on side

facade

Rear addition

Replacement siding



Field ID: BT-32 **GNAHRGIS ID:** 248273 **Butts** 


**County: Preliminary NR** 

**Assessment:** Does Not Meet

Not Listed

Country Line Baptist Church Cemetery Country Line Rd, .1 mi S of S.R. 42

**Coordinates:** 33.31787, -84.05304

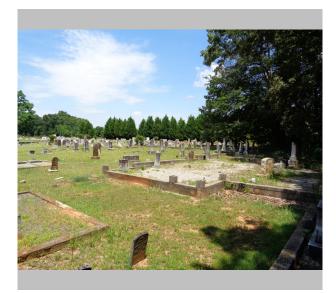

**Resource Type** Site

**Resource Use** Funerary: Cemetery

**Date of Construction** 1862

**Common Names** McGough, Kimball, Edalgo

≈ Number of Burials 150

Oldest Burial 1862

Burial Description War of 1812, CSA

Woodsmen



**Cemetery Description** Noncontributing Church

dating to 1960 Family plots

Edging: granite, concrete

Ledger stones

Field ID: BT-33
GNAHRGIS ID: 248274
County: Butts

County: Preliminary NR

**Assessment:** Does not Meet

Not Listed



145 Walt Banks Rd

**Coordinates:** 33.30242, -84.03663





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1910

**Building Type** Georgian cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Complex

**Exterior Cladding** Wood: Weatherboard

Foundation Pier with Infill:Brick, CMU

Porch Verandah

**Windows** Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface: Brick

Alterations Replacement windows,

door

Rear shed addition

Gabled front add. historic

Field ID: BT-34 **GNAHRGIS ID: 248275** Butts

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



539 England Chapel Rd

**Coordinates:** 33.31177, -84.04332





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1920

**Building Type** New South cottage

Structural System Balloon Frame

**Style** Folk Victorian

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

Windows Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface: Brick (2)

**Alterations** Rear shed addition

Field ID: BT-35 **GNAHRGIS ID:** 248276 **Butts** 

County: Preliminary NR

**Assessment:** Does Not Meet

Not Listed



Shiloh Baptist Church 492 Shiloh Rd

**Coordinates:** 33.31028, -84.03264



**Resource Type** Site

**Resource Use** Funerary: Cemetery

**Date of Construction** 1911

**Common Names** 

≈ Number of Burials 40

**Oldest Burial** 1911

**Burial Description** 



**Cemetery Description** Non contributing church Ledger stones Hand carved markers Concrete edging



Field ID: BT-36
GNAHRGIS ID: 248277
County: Butts

**County: Preliminary NR** 

**Assessment:** Does Not Meet

Not Listed



The Foster Estate Foster Road, .75 mi N of Bucksnort

**Coordinates:** 33.23625, -84.11066



Resource Type Site

**Resource Use** Funerary: Cemetery

**Date of Construction** 1852

**Common Names** Foster, Jester, Jurrell

≈ Number of Burials 45

Oldest Burial 1852

**Burial Description** CSA



Cemetery Description Family cemetery bounded

Family cemetery bounded by stacked stone Small iron gate

Field ID: BT-37 **GNAHRGIS ID: 248278 Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



Foster Rd, 1 mi N of Bucksnort

Coordinates: 33.23780





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1900

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable:Side

Exterior Cladding Wood: Weatherboard,

flush board siding

Foundation Pier:Brick

**Porch** Verandah, Stoop

**Windows** Double Hung Sash: 6/6, 1/1

**Chimney** Center: Brick

**Alterations** Replacement siding,


windows

Rear shed addition Front porch addition

Field ID: BT-38 **GNAHRGIS ID: 248279 Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed

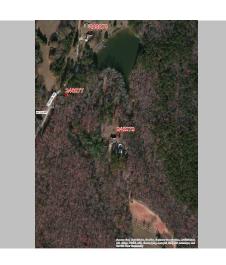

End of Foster Rd: 284 Foster Rd

**Coordinates:** 33.23531, -84.10913





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1900

**Building Type** Central Hallway cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier: Stone

**Porch** Stoop

Windows Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Replacement windows

2nd level rear porch

addition

Field ID: BT-39
GNAHRGIS ID: 248280
County: Butts

County: Preliminary NR

**Assessment:** Does not meet

**Not Listed** 



Bucksnot Rd, .1 mi N of Peppy Lane

**Coordinates:** 33.22254, -84.09655





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1920

**Building Type** Shotgun

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable:Front

**Exterior Cladding** Synthetics: asbestos

siding

**Foundation** Pier: concrete block

**Porch** Stoop

**Windows** Double Hung Sash: 6/6

**Chimney** None observed

**Alterations** Large shed addition off

right side

Field ID: BT-40 **GNAHRGIS ID: 248281 Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



1435 Bucksnort Rd

**Coordinates:** 33.21905, -84.08265





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1900

**Building Type** New South House

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Complex

Exterior Cladding Synthetics: Vinyl,

aluminum

**Foundation** Unknown

Porch Wrap-around

Windows Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface(2): Brick

Alterations Replacement siding,

windows

Field ID: BT-41 **GNAHRGIS ID:** 248282 **Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



410 Harkness Rd

**Coordinates:** 33.23768, -84.08853





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1900

**Building Type** Gabled ell cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Complex

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

Porch Wrap-around

**Windows** Double Hung Sash: 9/9

**Chimney** Off-center Within Roof

Surface(2): Brick

**Alterations** Rear shed addition

Field ID: BT-42 **GNAHRGIS ID:** 248283 **Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



1290 Bucksnort Rd

**Coordinates:** 33.21427, -84.07104





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1910

**Building Type** New South cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier:Brick

**Porch** Stoop

Windows Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Rear addition

Field ID: BT-43
GNAHRGIS ID: 248284
County: Butts

County: Preliminary NR

**Assessment:** Does not meet

Not Listed



Hwy 36, .1 mi N of I-75

Coordinates: 33.21000, -84.05795



**Resource Type** Site

**Resource Use** Funerary: Cemetery

**Date of Construction** 1880

**Common Names** 

≈ Number of Burials 250

Oldest Burial 1880

**Burial Description** possible African American

cemetery



Many unmarked stones Ledger stones Hand etched markers Active Use





Field ID: BT-44 **GNAHRGIS ID: 248285 Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



Hwy 36 at Towaliga River

**Coordinates:** 33.21668, -84.05009



#### Resource Type Site

**Resource Use** Funerary: Cemetery

**Date of Construction** 1882

Common Names Head

≈ Number of Burials 3

Oldest Burial 1882

**Burial Description** 



#### **Cemetery Description** Surrounded by stacked

stone Department of **Corrections Property** 

Field ID: BT-45 **GNAHRGIS ID:** 248286 **Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



Corner of Lee Maddox Rd and Hwy 36

**Coordinates:** 33.22966, -84.03108





Resource Type Building

Resource Use Commercial: Retail,

Vacant

**Date of Construction** C 1910

**Building Type** Single Pen

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:front

**Exterior Cladding** Wood: Weatherboard

Foundation Pier: concrete

**Porch** Stoop

**Windows** None observed

**Chimney** None observed

**Alterations** Rear addition

Field ID: **BT-46 GNAHRGIS ID: 251313** Butts

**County: Preliminary NR** 

Assessment: May Meet Not Listed



508 Lee Maddox Rd.

**Coordinates:** 33.229578, -84.030209





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1910

**Building Type** Gabled Ell Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable:Cross

**Exterior Cladding** Synthetic: Vinyl siding

**Foundation** Pier with Infill:Brick

**Porch** Stoop

**Windows** Double Hung Sash: 1/1 flat

head, rectangular

**Chimney** None observed

**Alterations** Replaced siding

Addition at rear w/ added

porch.

Added awnings

Field ID: BT-47 **GNAHRGIS ID:** 248287

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet Not Listed



Lee Maddox Rd at corner of Smith Rd (414 Smith)

**Coordinates:** 33.22531, -84.02617





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1920

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill:Brick

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

Jalosie

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Enclosed Verandah

Replacement Mat

Adddition Enclosed

Field ID: BT-48 **GNAHRGIS ID:** 248288 Butts

**County: Preliminary NR** 

Assessment: May Meet Not Listed



130 Lee Maddox Rd

**Coordinates:** 33.22477, -84.00686





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1910

**Building Type** Central Hallway Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

**Chimney** Both gable ends: Brick

**Alterations** Multiple rear hanging

additions

Field ID: BT-49
GNAHRGIS ID: 248289
County: Butts

**County: Preliminary NR** 

**Assessment:** May Meet



3290 High Rd

**Coordinates:** 33.21877, -83.99727





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1910

**Building Type** Georgian cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Synthetics: Aluminum

**Foundation** Unknown

**Porch** Verandah

**Windows** Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Replacement windows

Rear addition

Shed addition right

Field ID: BT-50
GNAHRGIS ID: 248290
County: Butts

**County: Preliminary NR** 

**Assessment:** May Meet



3442 High Falls Rd

**Coordinates:** 33.20903, -83.99866



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1900

**Building Type** New South cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Complex

**Exterior Cladding** Synthetics: aluminum

**Foundation** Pier with Infill:Brick, CMU

Porch Wrap-around

**Windows** Double Hung Sash: 4/4

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Replacement siding

Gabled rear addition

Field ID: BT-51
GNAHRGIS ID: 248291
County: Butts

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet



3482 High Falls Rd.

**Coordinates:** 33.20663, -83.00011





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1910

**Building Type** Gabled ell cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Synthetics: aluminum

**Foundation** Unknown

Porch Verandah

Windows Double Hung Sash: 4/4

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Replacement siding

Rear gabled addition

Field ID: BT-52
GNAHRGIS ID: 248292
County: Butts

**County: Preliminary NR** 

**Assessment:** May Meet



191 Tom Goddard

**Coordinates:** 33.23547, -84.00667





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1900

**Building Type** Gabled ell cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable:cross

**Exterior Cladding** Synthetics: vinyl/

aluminum

Foundation Pier with Infill:Brick, CMU

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Replacement siding

Rear gabled addition

Field ID: BT-53
GNAHRGIS ID: 248293
County: Butte

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet



Weaver Cemetery Lee Maddox Rd .25 mi N of Hwy 36

**Coordinates:** 33.23451, -84.03170



**Resource Type** Site

**Resource Use** Funerary: Cemetery

Date of Construction 1873

Common Names Weaver

≈ Number of Burials 30

Oldest Burial 1873

**Burial Description** 



**Cemetery Description** Small family cemetery

Small family cemetery Chain link fence surround Unmarked stones Ledger stones

Field ID: BT-54
GNAHRGIS ID: 248299
County: Butts


**County: Preliminary NR** 

**Assessment:** May Meet



633 Lee Maddox Rd

**Coordinates:** 33.23698, -84.03254

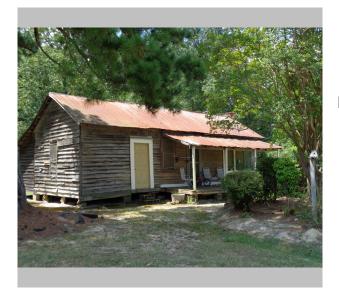



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1890

**Building Type** Double pen

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill:stone,

concrete

Porch Stoop

**Windows** Double Hung Sash: 6/6

**Chimney** Gble-end, exterior:

stuccoed masonry

**Alterations** Rear shed addition

Left entry addition

Field ID: BT-55 **GNAHRGIS ID:** 248296

**County:** Butts **Preliminary NR** 

**Assessment:** Does not Meet



Towaliga Baptist Church Cemetery Corner of Towaliga Church Rd. and Evans Rd.

**Coordinates:** 33.24364, -84.05215



**Resource Type** Site

**Resource Use** Funerary: Cemetery

**Date of Construction** 1840

**Common Names** 

≈ Number of Burials

Oldest Burial 1840

**Burial Description** 



**Cemetery Description** Non-contributing Church Stacked stone markers Edging: granite, brick Ledger stones Many unmarked stones Active use

Field ID: BT-56
GNAHRGIS ID: 248300
County: Butts

**County: Preliminary NR** 

**Assessment:** Does Not Meet



Presbyterian Fellowship Church Cem 442 Kinards Mill Rd

**Coordinates:** 33.24531, -84.06322



Resource Type Site

**Resource Use** Funerary: Cemetery

Date of Construction 1830

**Common Names** McKibber, Harkness,

Foster, Wallace

≈ Number of Burials

Oldest Burial 1830

Burial Description Woodsmen of the World,

Fee Masons



Non-contributing Church Stacked stone wall Ledger stones Edging: granite, brick Family plots Obelisks



Field ID: BT-57
GNAHRGIS ID: 248301
County: Butts

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet



2007 Brownlee Road

**Coordinates:** 33.23608, -83.96581





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1920

**Building Type** Bungalow: Side gable

Structural System Balloon Frame

Style Craftsman

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

Synthetics: masonite

Foundation Pier with Infill: Brick,

concrete block

**Porch** Recessed

Windows Double Hung Sash: 64/1,

6/1

**Chimney** Gable end, off center

ridgeline: Brick, fieldstone

**Alterations** Some replacement

windows and siding

Field ID: BT- 58 **GNAHRGIS ID: 248302 County: Preliminary NR** Butts

**Assessment:** Appears to Meet



Indian Spring Hotel/ Museum 1807 Hwy 42

**Coordinates:** 33.24480, -83.92027





Resource Type Building

**Resource Use** Entertainment: museum/

event space

**Date of Construction** 1920-1929 Known

**Building Type** N/A

Structural System Balloon Frame

**Style** Federal

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

Foundation Pier: stone

Porch Wrap-around

**Windows** Double Hung Sash: 12/12

**Chimney** Both gable ends: Brick

**Alterations** ADA ramp addition rear

Field ID: BT-59 **GNAHRGIS ID:** 248303 **County:** Butts **Preliminary NR** 

**Assessment:** Appears to Meet



**Indian Springs Chapel** Corner of Hwy 42 and Cenie Rd

**Coordinates:** 33.24292, -83.92062





Resource Type Building

Resource Use Religious: Church

**Date of Construction** 1890-1899

**Building Type** N/A

Structural System Balloon Frame

**Style** Folk Victorian

**Roof** Gable:cross

Exterior Cladding Wood: Weatherboard,

vertical board, shingles

**Foundation** Continuous: stone

Porch stoop

**Windows** Double Hung Sash: 2/2, 3/3

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Rear shed addition

Field ID: BT-60
GNAHRGIS ID: 248304
County: Butts


**County: Preliminary NR** 

**Assessment:** May Meet



Indian Springs General Store Corner of Hwy 42 and Cenie Rd

**Coordinates:** 33.24271, -84.92068

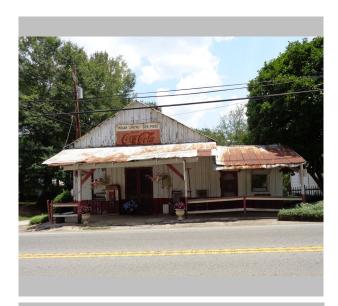



Resource Type Building

**Resource Use** Commercial: General store

**Date of Construction** c 1930

**Building Type** Single pen: rectangle

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: front

**Exterior Cladding** Wood: vertical board

**Foundation** Continuous: stone

**Porch** Stoop

Windows Double Hung Sash: 1/1

**Chimney** Off-center ridge line: Brick

**Alterations** Shed addition on right

More recent faux stone

foundation

Current use: antique store

Field ID: BT-61 **GNAHRGIS ID:** 248308 **County:** Butts **Preliminary NR** 

**Assessment:** Appears to Meet



Corner of hwy 42 and Cenie Rd

**Coordinates:** 33.24261, -83.92135





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1900

**Building Type** Georgian cottage

Structural System Balloon Frame

**Style** Folk Victorian

Roof Hip

**Exterior Cladding** Wood: Weatherboard

Foundation Pier:Brick

Porch Wrap-around

**Windows** Double Hung Sash: 1/1

Fixed: 2-light

**Chimney** Off-center Within Roof

Surface(4): Brick

**Alterations** Rear shed addition

More recent wooden

porch

Field ID: BT-62
GNAHRGIS ID: 248309
County: Butts

**County: Preliminary NR** 

**Assessment:** May Meet



345 Cenie Rd

**Coordinates:** 33.24266, -83.92159





Resource Type Building

Resource Use Commercial: Retail store

Date of Construction 1840-1849

**Building Type** Georgian cottage

Structural System Balloon Frame

**Style** Greek revival

Roof Hip

**Exterior Cladding** Brick: 6 course common

**Foundation** Continuous: brick

**Porch** Stoop

**Windows** Double Hung Sash: 6/6

**Chimney** None observed

**Alterations** Rear addition

Original porches removed Infilled bay on left facade

Field ID: BT-63
GNAHRGIS ID: 248310
County: Butts

County: Preliminary NR

**Assessment:** May Meet



360 Cenie Rd

**Coordinates:** 33.24303, -83.92591





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1910

**Building Type** Gabled ell cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable:cross

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill:Brick,

concrete block

Porch Stoop

Windows Double Hung Sash: 8/1,

8/8, 1/1, 1/6

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Rear shed addition

Field ID: BT-64
GNAHRGIS ID: 248311
County: Butts

County: Preliminary NR

**Assessment:** Does not Meet



339 Mt. Vernon Church Rd

**Coordinates:** 33.23246, -83.94412





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1900

**Building Type** New South cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier: brick, concrete

Porch Stoop

Windows Double Hung Sash: 2/2

**Chimney** No chimney observed

**Alterations** Some replacement

windows

Field ID: BT-65 **GNAHRGIS ID:** 248316 **Butts** 

**County: Preliminary NR** 

**Assessment:** Does not meet



Mt. Vernon Baptist Church Corner of Mt. Vernon Church Rd and Fawn Rd

**Coordinates:** 33.22659, -83.96015



**Resource Type** Site

**Resource Use** Funerary: Cemetery

**Date of Construction** 1890

Common Names Brownlee, Hoard

≈ Number of Burials 200

Oldest Burial 1890

**Burial Description** 



**Cemetery Description** Non contributing church Family plots Edging: concrete, brick, granite Chain link fencing

Field ID: BT-66
GNAHRGIS ID: 248313
County: Butts

**County: Preliminary NR** 

**Assessment:** May Meet



641 Mt. Vernon Church Rd

**Coordinates:** 33.22208, -83.96495





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1890

**Building Type** Central Hallway

**Structural System** Folk Victorian

**Style** No Academic Style

**Roof** Complex

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

Porch Wrap-around

**Windows** Double Hung Sash: 8/12

**Chimney** Off-center Within Roof

Surface, gable end: Brick

**Alterations** Extended wrap-around

porch

Rear gabled addition

Field ID: BT-67
GNAHRGIS ID: 248314
County: Butts

**County: Preliminary NR** 

**Assessment:** May Meet



243 T.W. Leverett Rd

**Coordinates:** 33.21112, -83.96516





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1900

**Building Type** New South cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

Exterior Cladding Synthetics: vinyl,

aluminum siding

**Foundation** Pier: Brick

Porch Wrap-around

Stoop

Windows Double Hung Sash: 1/1

**Chimney** Gable end, within roof

surface: Brick (2)

**Alterations** Replacement windows

Rear shed additions

Field ID: BT-68
GNAHRGIS ID: 248315
County: Butts

**County: Preliminary NR** 

**Assessment:** May Meet



1908 Hwy 42

**Coordinates:** 33.23716, -83.92174





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1920

**Building Type** Bungalow: side gable

Structural System Balloon Frame

Style Craftsman

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

Windows Double Hung Sash: 6/1, 4/1

**Chimney** Gable end exterior:

fieldstone

**Alterations** Enclosed 3-season porch

Wooden ramp addition

Field ID: BT-69 **GNAHRGIS ID: 210184 County:** Butts **Preliminary NR** 

**Assessment:** Appears to Meet



1900 Hwy 42

**Coordinates:** 33.23852, -83.92089



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1890

**Building Type** Georgian house

Structural System Balloon Frame

**Style** Folk Victorian

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Portico

**Windows** Double Hung Sash: 6/6

**Chimney** Off-center Within Roof

Surface: Brick

**Alterations** Possible large addition on

Field ID: BT-70
GNAHRGIS ID: 248316
County: Butts

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet



243 Torbert Road

**Coordinates:** 33.21015, -83.90965



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1900

**Building Type** Georgian cottage

**Structural System** Brick bearing

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Brick: 5-course common

**Foundation** Pier with Infill:Brick

**Porch** Stoop

**Windows** Double Hung Sash: 6/6

**Chimney** None observed

**Alterations** 

Field ID: BT-71
GNAHRGIS ID: 248317
County: Butts

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet



370 Conie Rd

**Coordinates:** 33.23634, -83.93140



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** c 1900

**Building Type** Central Hallway

Structural System Balloon Frame

Style Folk Victorian

**Roof** Gable:Side

Exterior Cladding Wood: Weatherboard,

synthetics: vinyl

Foundation Continuous: stone

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

Single Hung Sash: 3/9

**Chimney** Gable end exterior: Brick

**Alterations** Multiple rear additions

Field ID: BT-72 **GNAHRGIS ID: 248318 County: Preliminary NR Butts** 

**Assessment:** Does Not Meet



152 Mt Pleasant Church Rd

**Coordinates:** 33.21602, -83.86318





**Resource Type** Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1910

**Building Type** Gabled Ell Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Cross Gable: Metal,

**Pressed Sheet** 

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Stoop

Windows Double Hung Sash: 1/1

**Chimney** Gable End Exterior/Center:

Brick

**Alterations** Replacement windows

Left facade shed addition

### Butts County CE+DISHOTIC Resource

Field ID: BT-73
GNAHRGIS ID: 248319
County: Butts


**County:** Butts **Preliminary NR** 


**Assessment:** Does Not Meet



590 Mt Pleasant Church Rd

**Coordinates:** 33.19548, -48.83219

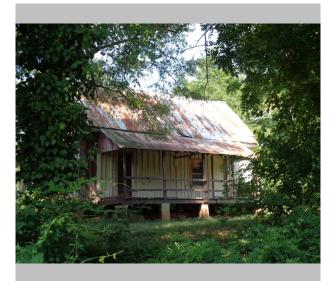

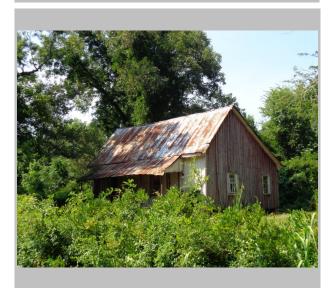

Resource Type Building

**Resource Use** Residential: Single Family

Dwelling/Vacant

**Date of Construction** ca. 1910

Building Type Double Pen

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Cross Gable: Metal,

**Pressed Sheet** 

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier: Concrete Block

**Porch** Stoop

**Windows** Double Hung Sash: 6/6

**Chimney** Gable End Exterior:

Brick/Fieldstone

**Alterations** Rear addition

Field ID: BT-74
GNAHRGIS ID: 248320
County: Butts

**County: Preliminary NR** 

**Assessment:** May Meet



.1 Mi N of 590 Mt Pleasant Church Rd

**Coordinates:** 33.19453, -84.19453





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling/Vacant

**Date of Construction** ca. 1910

**Building Type** Double Pen

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Side Gable: Metal,

Corrugated Sheet

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier: Concrete Block

**Porch** Stoop

Windows Double Hung Sash: 4/4

**Chimney** Gable End Exterior: Brick

**Alterations** Rear ell addition with

porch

Field ID: BT-75
GNAHRGIS ID: 248321
County: Butts

County: Preliminary NR

**Assessment:** May Meet



685 Pleasant Church Rd

**Coordinates:** 33.19414, -83.83042





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1900

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Hip: Metal, Pressed Sheet

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

Porch Wrap-Around

Windows Double Hung Sash: 4/4

**Chimney** Off Center Within Roof

Surface (2): Brick

**Alterations** 

Field ID: BT-76
GNAHRGIS ID: 248322
County: Butts

**County: Preliminary NR** 


**Assessment:** May Meet



Mt. Pleasant Rd .2 Mi S of BT-75

**Coordinates:** 33.19182, -83.83115



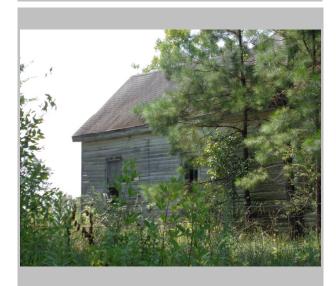

Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1900

**Building Type** Georgian Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Hip: Asphalt Shingle

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier: Brick

**Porch** Stoop

**Windows** Double Hung Sash: 6/6

**Chimney** Off Center Within Roof

Surface: Brick

**Alterations** Gabled rear addition

Field ID: BT-77
GNAHRGIS ID: 248323
County: Butts

**County: Preliminary NR** 

**Assessment:** May Meet



Sandy Creek Rd and County Rd 87

**Coordinates:** 33.23219, -83.87516



**Resource Type** Site

**Resource Use** Funerary: Cemetery

Date of Construction ca. 1870

Common Names Warrick, Coursey, Meeks

≈ Number of Burials 500

Oldest Burial ca. 1870

**Burial Description** Woodsmen of the World,

Freemasons, CSA



**Cemetery Description** Active Use

Granite, brick, concrete demarcated family plots Numerous obelisks Stacked stone family plot

Field ID: BT-78
GNAHRGIS ID: 248324
County: Butts

**County: Preliminary NR** 

**Assessment:** May Meet



266 Vickers Rd

**Coordinates:** 33.21425, -83.84017





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1910

**Building Type** Georgian Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Hip: Metal, Standing Seam

**Exterior Cladding** Board-and-Batten

Foundation Unknown

**Porch** Stoop

**Windows** Double Hung Sash: 6/6

**Chimney** Off Center Within Roof

Surface: Brick/Fieldstone

**Alterations** Screened front porch

Foundation covered with corrugated metal

Field ID: BT-79
GNAHRGIS ID: 248325
County: Butts

County: Preliminary NR

**Assessment:** Appears to Meet



339 Riley Rd

**Coordinates:** 33.26362, -83.89152



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1900

**Building Type** New South House

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Hip: Metal, Pressed Sheet

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

Porch Wrap-Around

Windows Double Hung Sash: 2/2

**Chimney** Off Center Within Roof

Surface: Brick

**Alterations** Newer stone foundation

on porch Rear addition

Field ID: BT-80
GNAHRGIS ID: 248326
County: Butts

**County: Preliminary NR** 

**Assessment:** May meet



438 Higgins Rd

**Coordinates:** 33.28411, -83.89530





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** 1833

**Building Type** Plantation Plain

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Side Gable: Asphalt

Shingle

**Exterior Cladding** Wood: Weatherboard

Foundation Continuous: Brick

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

**Chimney** Both Gable Ends: Brick

**Alterations** Rear shed addition

Replacement windows
New foundation/chimneys

Replacement siding

Field ID: BT-81
GNAHRGIS ID: 248327
County: Butts

County: Preliminary NR

**Assessment:** May Meet



Barnes Farm 184 Hwy 16, Across from Higgins Rd

**Coordinates:** 33.28801, -83.89496





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Hip: Asphalt Shingle

**Exterior Cladding** Wood: Weatherboard

Foundation Pier: Brick/Stone

Porch Wrap-Around

Windows Double Hung Sash: 4/4

**Chimney** Gable End, Exterior (2):

Brick

**Alterations** Rear additions

Former county store on

property

Field ID: BT-82
GNAHRGIS ID: 248328
County: Butts

**County: Preliminary NR** 

**Assessment:** May meet



1984 Hwy 16

**Coordinates:** 33.28567, -83.88530





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1910

**Building Type** Plantation Plain

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Side Gable: Asphalt

Shingle

**Exterior Cladding** Wood: Weatherboard

Drop Siding: Flushboard

Foundation Pier With Infill: Brick

Porch Verandah

**Windows** Double Hung Sash: 9/9

**Chimney** Both Gable Ends: Brick

**Alterations** Rear shed addition

Newer carport

Right facade shed addition

Field ID: BT-83 GNAHRGIS ID: 248333

**County:** Butts **Preliminary NR** 

Assessment: Does not meet

Not Listed



Maddox Cemetery Stark Rd. .1 mi S of Ward Rd

**Coordinates:** 33.31777, -83.85129



**Resource Type** Site

**Resource Use** Funerary: Cemetery

Date of Construction ca. 1870

**Common Names** 

≈ Number of Burials approx. 25

Oldest Burial 1870's

**Burial Description** CSA veterans



**Cemetery Description** Enclosed by chain link

fence Ledger stones Stacked stone

Field ID: BT-84 **GNAHRGIS ID: 248334 County:** Butts **Preliminary NR** 

**Assessment:** Appears to meet Not Listed



1148 Stark Rd.

**Coordinates:** 33.32946, -83.88948





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1850

**Building Type** Plantation plain

Structural System Balloon Frame

**Style** Greek revival

Roof Gable:Side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Portico

**Windows** Double Hung Sash: 9/9

**Chimney** Both gable ends. Brick

**Alterations** Center 2-story portico

Multiple rear shed

additions

Field ID: BT-85 **GNAHRGIS ID:** 248336 **Butts** 

**County: Preliminary NR** 

**Assessment:** May meet Not Listed



108 Barbour Rd.

**Coordinates:** 33.36268, -83.87520





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with CMU infill: brick

**Porch** Stoop

Windows Double Hung Sash: 4/4

**Chimney** Off-center within roof

surface: brick

**Alterations** Replacement window

Enclosed front stoop Door bay added to left

facade



Field ID: BT-86
GNAHRGIS ID: 248337
County: Butts

County: Preliminary NR

**Assessment:** Does not meet

Not Listed Worthville Baptist Church Cemetery Corner of Old South River Rd. and Keys Ferry Rd.

**Coordinates:** 33.39293, -83.92130



**Resource Type** Site

**Resource Use** Funerary: Cemetery

Date of Construction ca. 1880's

**Common Names** 

≈ Number of Burials 500

Oldest Burial 1880's

**Burial Description** Woodmen of the World



Cemetery Description Granite, concrete, brick

lined family plots
Ledger stones

Field ID: BT-87 GNAHRGIS ID: 248351

**County:** Butts **Preliminary NR** 

**Assessment:** May meet Not Listed



387 Keys Ferry Rd.

**Coordinates:** 33.39191, -83.92374



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1900

**Building Type** Gabled Ell Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

Windows Double Hung Sash: 4/4,

**Chimney** 3 chimneys: brick

**Alterations** Large rear shed addition

Field ID: **BT-88 GNAHRGIS ID: 248352 Butts** 

**County: Preliminary NR** 

**Assessment:** May meet Not Listed



342 Keys Ferry Rd.

**Coordinates:** 33.39007, -83.92175





**Resource Type** Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1900

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Brick, pier infill with brick

Porch Wrap-around

Windows Double Hung Sash: 1/1, 4/4

**Chimney** None observed

**Alterations** Right rear addition

Replacement windows Ramp on right up to porch

Field ID: BT-89 **GNAHRGIS ID: 251316** 

**County:** Butts **Preliminary NR** 

**Assessment:** Does not meet



1201 Halls Bridge Rd.

**Coordinates:** 33.34575, -83.91054



**Resource Type** Site

**Resource Use** Funerary: Cemetery

**Date of Construction** Unknown

**Common Names** Grier

≈ Number of Burials 12

Oldest Burial Unknown

**Burial Description** Robert Grier family plot



**Cemetery Description** Ledger stones on newer raised marble bases Surrounded by stacked stone wall w/ stone pillars



Field ID: BT-90
GNAHRGIS ID: 251317
County: Butts

County: Preliminary NR


**Assessment:** Does not meet

**Not Listed** 



Stark United Methodist Church Corner of Halls Bridge Rd. and Wildwood Rd.

**Coordinates:** 33.33752, -83.91166

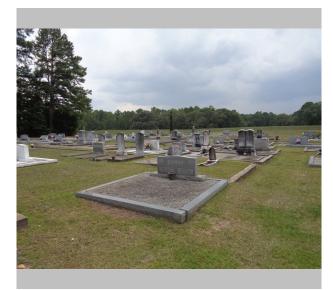

Resource Type Site

**Resource Use** Funerary: Cemetery

Date of Construction ca. 1885

Common Names McMichael, Cook,

Kitchens

≈ Number of Burials 150

Oldest Burial late 1880's

**Burial Description** Church cemetery



Cemetery Description Granite and concrete lined

family plots

Active use

Field ID: BT-91 GNAHRGIS ID: 248353

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet Not Listed



**Barber Cemetery** Hwy 16 .5 mi N of Thomas Ferry Rd.

**Coordinates:** 33.29369, -83.87272



**Resource Type** Site

**Resource Use** Funerary: Cemetery

Date of Construction ca. 1860

Common Names Barber, Lovejoy, Linkous

≈ Number of Burials 25

Oldest Burial 1860's

**Burial Description** 



**Cemetery Description** Ledger stones

Some markers moved, likely due to power-line poles located adjacent to cemetery

Field ID: BT-92 **GNAHRGIS ID: 248354 Butts** 

**County: Preliminary NR** 

**Assessment:** Appears to Meet Not Listed



1854 Stark Rd.

**Coordinates:** 33.30808, -83.84192





Resource Type Building

**Resource Use** Residential: Single Family

**Dwelling** 

Date of Construction ca. 1850

**Building Type** Plantation Plain

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with Infill: Stone

**Porch** Verandah

**Windows** Double Hung Sash: 1/1

**Chimney** Both Gable Ends: Brick

**Alterations** Historic rear addition

Newer stone porch

foundation

Gabled addition at right

Field ID: BT-93
GNAHRGIS ID: 248355
County: Butts

**County:** Butts **Preliminary NR** 

**Assessment:** Does Not Meet

Not Listed



Stark Rd. at Old Monticello Rd.

**Coordinates:** 33.30920, -83.84393



Resource Type Site

**Resource Use** Funerary: Cemetery

**Date of Construction** 1851

**Common Names** Pittman, Norsworthy

≈ Number of Burials 30

Oldest Burial 1851

**Burial Description** 



**Cemetery Description** Stone and CMU lined plots

Active use

Field ID: BT-94 **GNAHRGIS ID: 248356 Butts** 


**County: Preliminary NR** 


**Assessment:** May Meet Not Listed



1316 Hwy 42

**Coordinates:** 33.27207, -83.91550

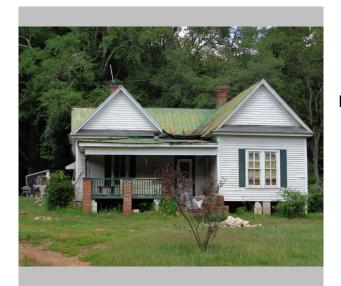

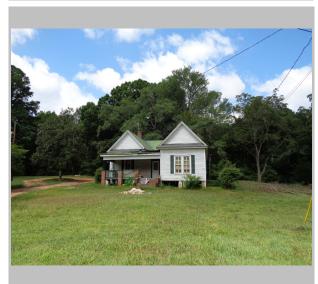

Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier: Brick

**Porch** Verandah

Windows Double Hung Sash: 4/4

**Chimney** Off-center, ridgeline: brick

**Alterations** 

Field ID: BT-95 **GNAHRGIS ID:** 248357 **Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



1351 Hwy 16

**Coordinates:** 33.27207, -83.91550





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1910

**Building Type** No Academic Type

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Wood: Weatherboard

**Foundation** Continuous: brick

**Porch** Stoop

**Windows** Double Hung Sash: 6/6

**Chimney** None observed

**Alterations** Diamond vents in gables

Fence at front and

chain-link fenced rear yard

Field ID: BT-96 **GNAHRGIS ID:** 248358 **Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



1647 Hwy 16

**Coordinates:** 33.28909, -83.91243





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

Porch Wrap-around

Windows Double Hung Sash: 1/1

**Chimney** Off-center within roof

surface: brick

**Alterations** Large gabled rear addition

Field ID: BT-97 **GNAHRGIS ID:** 248359

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet Not Listed



1652 Hwy 16

**Coordinates:** 33.28791, -83.91212





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1930

**Building Type** Bungalow: side gable

Structural System Balloon Frame

Style Craftsman

Roof Gable: side

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Stoop

Windows Double Hung Sash: 3/1

**Chimney** Off-center within roof

surface: brick

**Alterations** 

Field ID: BT-98 **GNAHRGIS ID: 251319** Butts

**County: Preliminary NR** 

Assessment: May Meet Not Listed



1727 Hwy 16

**Coordinates:** 33.28791, -83.91212





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1900

**Building Type** Gabled Ell Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with infill: brick

**Porch** Stoop

Windows Double Hung Sash: 4/4

**Chimney** Off-center, ridgeline: brick

**Alterations** Rear addition

Field ID: BT-99 **GNAHRGIS ID:** 251320 **Butts** 

**County: Preliminary NR** 

Assessment: Does Not Meet

Not Listed



Macedonia Church Rd.

**Coordinates:** 33.33065, -83.90593



**Resource Type** Site

**Resource Use** Funerary: Cemetery

**Date of Construction** ca. 1850's

**Common Names** Andrews, Barnes, Maddox,

Singley

≈ Number of Burials 500+

Oldest Burial 1850's

**Burial Description** CSA vets



Cemetery Description Granite, concrete lined

family plots Multiple obelisks Stacked stone markers Active use and older

sections

Remnants of wood-post

markers

Field ID: BT-100 **GNAHRGIS ID: 251321** Butts

**County: Preliminary NR** 

**Assessment:** Appears to Meet Not Listed



422 Stark Rd.

**Coordinates:** 33.3339, -83.90711





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1900

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** Folk Victorian

**Roof** Gable: cross

**Exterior Cladding** Wood: Weatherboard

**Foundation** Pier with infill: stone

**Porch** Verandah

**Windows** Double Hung Sash: 1/1

**Chimney** Off-center, ridgeline: brick

**Alterations** Newer porch

Diamond vents in gables Gabled rear addition

Field ID: BT-101 **GNAHRGIS ID:** 251318 **Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



923 Stark Rd.

**Coordinates:** 33.33375, -83.90704



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1890

**Building Type** Side Gable Cottage

Structural System Balloon Frame

**Style** Folk Victorian

Roof Gable: side

**Exterior Cladding** Prism synthetics: asbestos

siding

**Foundation** Pier with infill: stone

**Porch** Verandah

Windows Double Hung Sash: 4/4

**Chimney** Both gable ends:

fieldstone

**Alterations** Carport added to right

facade

Multiple rear additions Organic garden in rear

Field ID: BT-102 **GNAHRGIS ID: 251323 Butts** 


**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



917 Stark Rd.

**Coordinates:** 33.33348, -83.90746

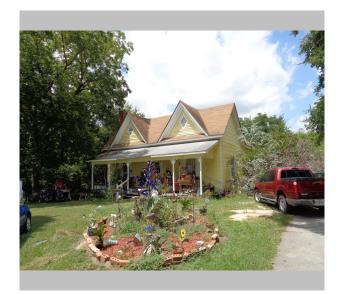



Resource Type Building

**Resource Use** Residential: Single Family

**Dwelling** 

**Date of Construction** ca. 1890

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** Folk Victorian

Roof Gable: side

**Exterior Cladding** Prism synthetics: asbestos

siding

**Foundation** Unknown

Porch Stoop

**Windows** Double Hung Sash: 4/4

**Chimney** Gable end, exterior: brick

and fieldstone

**Alterations** Rear gabled addition

Field ID: BT-103 **GNAHRGIS ID: 251323 Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



149 Hope McClure Rd.

**Coordinates:** 33.33348, -83.90746





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1890

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** No Academic Style

Roof Gable: side

**Exterior Cladding** Prism synthetics: Vinyl

siding

**Foundation** Pier with infill: stone

Porch Stoop

Windows Double Hung Sash: 2/2

**Chimney** Both gable ends: brick and

fieldstone

**Alterations** Rear shed and gable

additions

Newer metal porch posts

and foundation

Field ID: BT-104 **GNAHRGIS ID: 251324** Butts

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



142 Hope McClure Rd.

**Coordinates:** 33.33468, -83.90664





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1890

**Building Type** Georgian Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Wood: weatherboard

**Foundation** Pier with infill: stone

**Porch** Stoop

Windows Double Hung Sash: 1/1

**Chimney** None observed

**Alterations** Replacement windows

and siding

Rear shed addition

Field ID: BT-105 **GNAHRGIS ID: 251325** 

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet Not Listed



264 Morgan Rd.

**Coordinates:** 33.34415, -83.92157



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1920

**Building Type** Bungalow: side gable

Structural System Balloon Frame

Style Craftsman

**Roof** Gable: cross

**Exterior Cladding** Prism synthetics: vinyl

siding

**Foundation** Pier with infill: brick

**Porch** Recessed

**Windows** Double Hung Sash: 6/6

**Chimney** None observed

**Alterations** Multiple rear gable

additions

Field ID: BT-106 **GNAHRGIS ID: 251327** Butts

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



797 Stark Rd.

**Coordinates:** 33.34415, -83.92157





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1900

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Wood: weatherboard

**Foundation** Pier with infill: stone

**Porch** Stoop

**Windows** Double Hung Sash: 4/4, 1/1

**Chimney** Off-center within roof

surface: stuccoed masonry

**Alterations** Replacement windows

Field ID: BT-107 **GNAHRGIS ID: 250661 County:** Butts **Preliminary NR** 

**Assessment:** Appears to Meet



845 Stark Rd

**Coordinates:** 33.33254, -84.91333





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** C 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Hip: Asphalt Shingle

**Exterior Cladding** Prism Synthetics:

**Aluminum Siding** 

**Foundation** Pier With Infill: Concrete

block

**Porch** Verandah

**Windows** Double Hung Sash: 1/1

**Chimney** Off-Center Within Roof

Surface: Brick

**Alterations** Replacement siding

Field ID: BT-108 **GNAHRGIS ID: 250662 County:** Butts **Preliminary NR** 


**Assessment:** Appears to Meet Not Listed



298 Biles Rd.

**Coordinates:** 33.32814, -83.94591



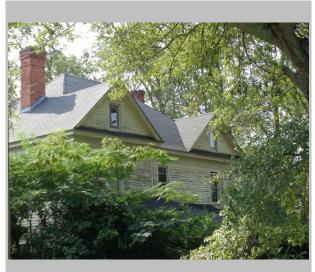

Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1890

**Building Type** New South House

Structural System Balloon Frame

**Style** Folk Victorian

Roof Hip

**Exterior Cladding** Wood: Weatherboard

**Foundation** Unknown

**Porch** Verandah

Windows Double Hung Sash: 1/1

**Chimney** Off-center within roof

surface: brick

**Alterations** 

Field ID: BT-109 **GNAHRGIS ID: 250666 Butts** 

**County: Preliminary NR** 

May Meet Not Listed Assessment:



820 Hwy 36

**Coordinates:** 33.30730, -83.95952



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1910

**Building Type** Gabled Ell Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Prism synthetics: vinyl

siding

**Foundation** Pier with infill: brick

Porch Wrap-around

**Windows** Double Hung Sash: 9/9

**Chimney** Gable-end, exterior: brick

**Alterations** Replacement siding

Rear and left additions



Field ID: BT-110 **GNAHRGIS ID: 250667 Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



McMichale Cemetery Hwy 36 .5 mi. N of Jackson City limits

**Coordinates:** 33.31680, -83.96278



**Resource Type** Site

**Resource Use** Funerary: Cemetery

Date of Construction ca. 1842

**Common Names** McMichale, Williams

≈ Number of Burials 40

Oldest Burial 1842

**Burial Description** CSA vet



Cemetery Description Ledger stones, tabletop markers

Lined by fence w/ stone

posts

Family cemetery

Field ID: BT-111
GNAHRGIS ID: 250668
County: Butts

County: Preliminary NR

**Assessment:** May Meet Not Listed



Corner of Hwy 36 and Jack Maddox Bridge Rd.

**Coordinates:** 33.35344, -83.94530





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Metal: pressed sheet

**Exterior Cladding** Prism synthetics: vinyl

siding

**Foundation** Pier with infill: brick

Porch Wrap-around

Windows Double Hung Sash: 1/1

**Chimney** Off-center Within Roof

Surface: Brick (x2)

**Alterations** Replacement siding

Rear shed addition Lightning rods on roof

Field ID: BT-112 **GNAHRGIS ID: 250669** Butts

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



1741 Hwy 36

**Coordinates:** 33.25511, -83.93694





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1890

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** Folk Victorian

**Roof** Gable: side

**Exterior Cladding** Prism synthetics: vinyl

siding

**Foundation** Pier with infill: stone

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

**Chimney** Both gable ends: brick and

fieldstone

**Alterations** Large rear additions

Field ID: BT-113 **GNAHRGIS ID:** 250670


**County:** Butts **Preliminary NR** 

**Assessment:** May Meet Not Listed



Hwy 36 at Jim McMichael Rd.

**Coordinates:** 33.35504, -83.92951

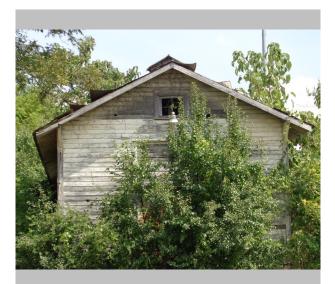



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1920

**Building Type** N/A

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Wood: shiplap

**Foundation** Pier:brick

**Porch** None observed

**Windows** Double Hung Sash: 9/9

**Chimney** None observed

**Alterations** 

Field ID: BT-114 **GNAHRGIS ID: 250672** Butts

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



481 Four Points Rd.

**Coordinates:** 33.33647, -83.93411





Resource Type Building

**Resource Use** Residential: Single Family

**Dwelling** 

Date of Construction ca. 1900

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Prism synthetics: vinyl

siding

**Foundation** Unknown

**Porch** Verandah

Windows Double Hung Sash: 1/1

**Chimney** Off-center within roof

surface

**Alterations** Replacement siding

Awning added to porch Decorative door statues

Field ID: BT-115 **GNAHRGIS ID:** 250673 **Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



143 Valley Hills Rd.

**Coordinates:** 33.28382, -83.93474



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Wood: weatherboard

**Foundation** Pier with infill: brick

**Porch** Verandah

Windows Double Hung Sash: 4/4

**Chimney** Off-center ridgeline: brick

**Alterations** Infilled transom

Rear addition with

chimney Newer porch

Field ID: BT-116
GNAHRGIS ID: 250676
County: Butts

County: Preliminary NR

**Assessment:** Does Not Meet

**Not Listed** 



596 Brownlee Rd.

**Coordinates:** 33.26756, -83.96326





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1870

**Building Type** Plantation plain

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: side

**Exterior Cladding** Wood: shiplap

**Foundation** Unknown

**Porch** Stoop

**Windows** Double Hung Sash: 6/6

**Chimney** Gable ends, exterior: brick

**Alterations** Rear addition

Multiple additions on right

facade

Field ID: BT-117 **GNAHRGIS ID:** 250704 **Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



1687 Brownlee Rd.

Coordinates: 33.25648, -83.96634





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1890

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** Folk Victorian

**Roof** Gable: cross

**Exterior Cladding** Wood: weatherboard

**Foundation** Pier with infill: brick

**Porch** Verandah

**Windows** Double Hung Sash: 6/6

**Chimney** Off-center, ridgeline: brick

**Alterations** Multiple additions at left

and rear

Field ID: BT-118 **GNAHRGIS ID: 250705 Butts** 

**County: Preliminary NR** 

**Assessment:** Appears to Meet Not Listed



1631 Hwy 36

**Coordinates:** 33.27682, -83.97809





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1890

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** Folk Victorian

**Roof** Gable: cross

**Exterior Cladding** Wood: weatherboard

**Foundation** Unknown

Porch Wrap-around

Windows Unknown

**Chimney** Off-center, ridgeline: brick

(x2)

**Alterations** 

Field ID: BT-119 **GNAHRGIS ID:** 250706

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet Not Listed



1038 Hwy 36

**Coordinates:** 33.28412, -83.97063





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: weatherboard

**Foundation** Pier with infill: brick

**Porch** Stoop

Windows Double hung sash: 1/1

**Chimney** None observed

**Alterations** Rear shed addition

CMU steps to stoop

Field ID: BT-120 **GNAHRGIS ID: 250711 Butts** 

**County: Preliminary NR** 

**Assessment:** Appears to Meet Not Listed



180 Buttrill Rd.

**Coordinates:** 33.28722, -83.99358





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1965

**Building Type** Ranch House

Structural System Balloon Frame

**Style** Modern

Roof Flat

**Exterior Cladding** Wood: weatherboard

**Foundation** Unknown

**Porch** None observed

Windows Fixed

**Chimney** Off-center within roof

surface: brick

**Alterations** Manicured yard w/ pines

Field ID: BT-121
GNAHRGIS ID: 250712
County: Butts

**County:** Butts **Preliminary NR** 

**Assessment:** Does not meet

Not Listed Old Bethlehem Church Cemetery Corner of Rising Star Church Rd. and Old Bethel Rd.

**Coordinates:** 33.33188, -83.98536



**Resource Type** Site

**Resource Use** Funerary: Cemetery

Date of Construction ca. 1830's

**Common Names** 

≈ Number of Burials 200

Oldest Burial 1830's

**Burial Description** Revolutionary War vets.

Freemasons



Tabletop markers
Granite lined family plots



Field ID: BT-122 **GNAHRGIS ID: 250713 Butts** 

**County: Preliminary NR** 

**Assessment:** Appears to Meet Not Listed



Indian Springs Holiness Campground 1518 Hwy 42

**Coordinates:** 33.26023, -83.90995





Resource Type Site

Resource Use Religious: Campground

**Date of Construction** 1890

**Building Type** Religious campground

complex

**Structural System** Balloon Frame

**Style** No Academic Style

Roof N/A

**Exterior Cladding** N/A

Foundation N/A

Porch N/A

Windows N/A

Chimney N/A

**Alterations** Newer houses and pre-fab

buildings

CMU community meeting

buildings

Field ID: BT-123 **GNAHRGIS ID: 250714 Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



433 Halls Bridge Rd.

**Coordinates:** 33.30209, -83.91811





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1900

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: weatherboard

**Foundation** Unknown

Porch Wrap-around

**Windows** Double Hung Sash: 9/9

**Chimney** Off-center within roof

surface: brick

**Alterations** Rear addition

Field ID: BT-124 **GNAHRGIS ID: 250715 County:** Butts **Preliminary NR** 

**Assessment:** Does Not Meet

Not Listed



350 Halls Bridge Rd.

**Coordinates:** 33.29956, -83.92490





Resource Type Building

Resource Use Vacant

Date of Construction ca. 1910

**Building Type** Central hallway

**Structural System** Balloon Frame

**Style** No Academic Style

**Roof** Gable: side

**Exterior Cladding** Wood: weatherboard

Foundation Pier: stone

**Porch** None observed

**Windows** Double Hung Sash: 6/6

**Chimney** None observed

**Alterations** Rear addition

Field ID: BT-125 **GNAHRGIS ID: 250849 Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



Four Points Rd. and Sure Power Rd.

**Coordinates:** 33.33419, -83.95688





Resource Type Building

**Resource Use** Church, religious structure

Date of Construction ca. 1955

**Building Type** No academic type

Structural System Balloon Frame

**Style** Craftsman

Roof Gable: side

**Exterior Cladding** Brick, prism synthetics:

vinyl siding

**Foundation** Continuous: concrete

**Porch** Stoop

Windows Double Hung Sash: 4/4

**Chimney** None observed

**Alterations** Rear gable addition

Field ID: BT-126 **GNAHRGIS ID: 250850** Butts

**County: Preliminary NR** 

Assessment: May Meet Not Listed



181 Four Points Rd.

**Coordinates:** 33.33433, -83.95832





Resource Type Building

**Resource Use** Residential: Single Family

**Dwelling** 

**Date of Construction** ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Prism synthetics: vinyl

siding

**Foundation** Pier with infill: brick

Porch Stoop

Windows Double Hung Sash: 4/4, 1/1

**Chimney** None observed

**Alterations** Replacement siding

Newer brick foundation on

porch

Field ID: BT-127 **GNAHRGIS ID: 250852 Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



240 Four Points Rd.

**Coordinates:** 33.33456, -83.97674





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1910

**Building Type** Gabled Ell Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: side

**Exterior Cladding** Prism synthetics: vinyl

siding

**Foundation** Pier with infill: stone

**Porch** Stoop

Windows Double Hung Sash: 4/4

**Chimney** None observed

**Alterations** Rear addition

CMU base on stoop

Field ID: BT-128
GNAHRGIS ID: 250853
County: Butts

County: Preliminary NR

**Assessment:** Does Not Meet

**Not Listed** 



341 Old Bethel Church Rd.

**Coordinates:** 33.33224, -83.98461





Resource Type Building

**Resource Use** Church/Religious structure

Date of Construction ca. 1935

**Building Type** Front-gabled church

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: front

**Exterior Cladding** Prism synthetics: vinyl

siding

**Foundation** Continuous: concrete

**Porch** Stoop

Windows Double Hung Sash: 4/4

**Chimney** None observed

**Alterations** 

Field ID: BT-129 GNAHRGIS ID: 250854 Butts

County: Preliminary NR

Assessment: May Meet Not Listed



3520 Bethel Rd.

**Coordinates:** 33.33240, -83.98555



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1910

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: side

**Exterior Cladding** Wood: weatherboard

**Foundation** Pier with infill: stone

**Porch** Stoop

Windows Double Hung Sash: 4/4

**Chimney** Off-center within roof

surface: brick

**Alterations** Porch off rear addition

Gabled rear addition Porch on CMU foundation

Field ID: BT-130
GNAHRGIS ID: 250855
County: Butts

**County: Preliminary NR** 

**Assessment:** Does Not Meet

**Not Listed** 



435 Buster Brown Rd.

**Coordinates:** 33.35334, -83.97546





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Prism synthetics: asbestos

siding

Foundation Pier with infill: stone

Porch Stoop

Windows Double Hung Sash: 1/1

**Chimney** None observed

**Alterations** Replacement siding,

windows and doors Rear shed addition

Field ID: BT-131 **GNAHRGIS ID: 250871 Butts** 

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



272 Fincherville Rd.

**Coordinates:** 33.35209, -83.96490





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1900

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** Folk Victorian

**Roof** Gable: side

**Exterior Cladding** Wood: weatherboard

**Foundation** Unknown

**Porch** Verandah

**Windows** Double Hung Sash: 1/1, 3/1

**Chimney** Both gable ends: brick

**Alterations** Rear addition

Field ID: BT-132 GNAHRGIS ID: 250872 County: Butts

**County: Preliminary NR** 

**Assessment:** Does not meet

Not Listed



Cedar Rock Cemetery
Old Biles Rd. and Fincherville Rd.

**Coordinates:** 33.34700, -83.96385



Resource Type Site

**Resource Use** Funerary: Cemetery

Date of Construction ca. 1889

Common Names Bond, Maddox, Gaston

≈ Number of Burials 150

Oldest Burial 1889

**Burial Description** CSA



**Cemetery Description** Active Use

Active Use
Obelisks
Granite-lined family plots
Ledger stones
Main center road through

Field ID: BT-133
GNAHRGIS ID: 250873
County: Butts

County: Preliminary NR

**Assessment:** Does Not Meet

Not Listed



193 Singley Rd.

**Coordinates:** 33.32469, -83.91281





Resource Type Building

**Resource Use** Vacant/not in use

**Date of Construction** ca. 1910

**Building Type** Gabled Ell Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Wood: weatherboard

Foundation Unknown

**Porch** Stoop

**Windows** Double Hung Sash: 9/9

**Chimney** Gable-end, exterior: brick

**Alterations** Rear addition

Addition on right facade

Field ID: BT-134 **GNAHRGIS ID: 250874** 

**County:** Butts **Preliminary NR** 

Assessment: May Meet Not Listed



279 Singley Rd.

**Coordinates:** 33.31985, -83.91082





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1900

**Building Type** Central Hallway

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Wood: weatherboard

**Foundation** Unknown

**Porch** Stoop

**Windows** Double Hung Sash: 1/1

**Chimney** Off-center, ridgeline: brick

**Alterations** Gabled ell w/ entry added

Field ID: BT-135 **GNAHRGIS ID:** 250875

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet Not Listed



153 Fincherville Rd.

Coordinates: 33.34402, -83.96535



Resource Type Building

**Resource Use** Vacant/not in use

Date of Construction ca. 1900

**Building Type** Double Pen

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: side

**Exterior Cladding** Wood: weatherboard

**Foundation** Continuous: stone

**Porch** Stoop

**Windows** Double Hung Sash: 9/9

**Chimney** Both gable ends: brick and

fieldstone

**Alterations** Large rear addition

Field ID: BT-136
GNAHRGIS ID: 250876
County: Butts

County: Preliminary NR

**Assessment:** Does not meet

**Not Listed** 



516 Fincherville Rd.

**Coordinates:** 33.36700, -83.96258





Resource Type Building

**Resource Use** Residential: Single Family

**Dwelling** 

Date of Construction ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

**Roof** Gable: cross

**Exterior Cladding** Prism synthetics: vinyl

siding

Foundation Unknown

**Porch** Verandah

**Windows** Double Hung Sash: 2/2

**Chimney** Off-center, ridgeline and

within roof surface: brick

**Alterations** Left shed addition

Replacement siding

**Field ID:** BT-137 **GNAHRGIS ID:** 250877

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet Not Listed



630 Fincherville Rd.

**Coordinates:** 33.37422, -83.96320



**Resource Type** Site

**Resource Use** Funerary: Cemetery

Date of Construction ca. 1890's

**Common Names** 

≈ Number of Burials

**Oldest Burial** 1890's, possibly older

markers that are covered

**Burial Description** Possibly AF, American



**Cemetery Description** Small cemetery in heavily

wooded area

Markers are sporadic and under vegetation

Hand-etched concrete

markers

Many unmarked stones

Field ID: BT-138 **GNAHRGIS ID: 250878 Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



866 Fincherville Rd.

**Coordinates:** 33.39010, -83.96308





Resource Type Building

**Resource Use** Vacant/not in use

Date of Construction ca. 1935

**Building Type** Georgian Cottage

Structural System Balloon Frame

Style Craftsman

Roof Hip

**Exterior Cladding** Prism synthetics: vinyl

siding

**Foundation** Pier with infill: concrete

Porch Stoop

Windows Double Hung Sash: 1/1

**Chimney** None observed

**Alterations** Rear shed addition

Field ID: BT-139 **GNAHRGIS ID:** 250879 **Butts** 

**County: Preliminary NR** 

Assessment: May Meet Not Listed



552 Keys Ferry Rd.

**Coordinates:** 33.40117, -83.93099





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

Date of Construction ca. 1920

**Building Type** Bungalow: Front Gable

Structural System Balloon Frame

Style Craftsman

**Roof** Gable: front

**Exterior Cladding** Wood: weatherboard

**Foundation** Unknown

**Porch** Stoop

Windows Double Hung Sash: 6/1

**Chimney** Center: brick

**Alterations** 

Field ID: BT-140 **GNAHRGIS ID: 250881** Butts

**County: Preliminary NR** 

**Assessment:** May Meet Not Listed



416 Keys Ferry Rd.

**Coordinates:** 33.39403, -83.92382





Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: weatherboard

**Foundation** Unknown

Porch Wrap-around

**Windows** Double Hung Sash: 1/1

**Chimney** None observed

**Alterations** Window infill in gablets

Field ID: BT-141 **GNAHRGIS ID:** 250882

**County:** Butts **Preliminary NR** 

**Assessment:** May Meet Not Listed



249 Winding Way

**Coordinates:** 33.38612, -83.91968



Resource Type Building

**Resource Use** Residential: Single Family

Dwelling

**Date of Construction** ca. 1910

**Building Type** New South Cottage

Structural System Balloon Frame

**Style** No Academic Style

Roof Hip

**Exterior Cladding** Wood: weatherboard

**Foundation** Unknown

**Porch** Stoop

**Windows** Double Hung Sash: 1/1

**Chimney** Gable-end, exterior: brick

**Alterations** 

Field ID: BT-142 **GNAHRGIS ID: 250883 Butts** 

**County: Preliminary NR** 

Assessment: Does not meet

Not Listed



Stodghill Cemetery Winding Way and Keys Ferry Rd.

**Coordinates:** 33.38739, -83.92062





**Resource Type** Site

**Resource Use** Funerary: Cemetery

**Date of Construction** ca. 1856

**Common Names** Stodghill, Lofton

≈ Number of Burials 75

Oldest Burial 1856

**Burial Description** CSA, Freemasons

Stodghill and Lofton families and descendants


**Cemetery Description** Unmarked vertical stones

Active use


## Bibliography

- . "Georgia Historic Resources Survey Manual," Atlanta: Georgia Department of Natural Resources, Historic Preservation Division, 2000.
- S. Georgia's Living Places: Historic Houses in their Landscaped Setting (1991), http://georgiashpo.org/sites/uploads/hpd/pdf/NR15arch 20080521100904 optimized.pdf (accessed August 01, 2014).
- <. "How to Apply the National Register Criteria for Evaluation: National Register Bulletin 15," (Washington, D.C.: U.S. Government Printing Office, Department of the Interior, National Park Service, 1997.) http://www.nps.gov/nr/publications/bulletins/pdfs/nrb15.pdf
- Anderson Cordova, Karen and Burns, Leigh. Preservation Primer: A Resource Guide for Georgia. Atlanta: Georgia Department of Natural Resources, HPD, 2011.
- Ching, Frank. A Visual Dictionary of Architecture, New York: Van Nostrand Reinhold, 1995.
- Clouse, Richard. The Ranch House in Georgia: Guidelines for Evaluation Historic Preservation Division; available at Http://issuu.com/georgiashpo/docs/ranch\_house\_guidelines?mode=window&background Color= %23222222 (Accessed August 12,2015).
- Derry, Anne, Jandal, H. Ward, Shull, Carol D., and Thorman, Jan. "Guidelines for Local Surveys: A Basis for Preservation Planning. National Register Bulletin 24," Washington, D.C: U.S. Government Printing Office, Department of the Interior, National Park Service, 1985.) http://www.nps.gov/nr/publications/bulletins/pdfs/nrb24.pdf
- Lambin, Jeanne. "Preserving Resources from the Recent Past," Washington, D.C.: National Trust for Historic Preservation, 2007
- Lenz, Richard J. "Sandersville. Museum of Washington County, The Brown House," The Civil War in Georgia: An Illustrated Travelers Guide, http://www.sherpaguides.com/georgia/civil\_war/mid\_ga\_east/sandersville\_area.html) accessed January 12, 2015).
- McAlaster, Virginia and Lee. A Field Guide to American Houses, New York: Alfred A, Knopf, Inc, 2003.


## Residential Building Types in Georgia




Single story: One room deep by two wide with central hallway




Multi-story: One room deep by two wide with central hallway

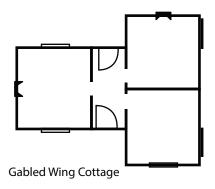

Single story: Asymmetrical massing with central hallway

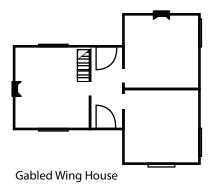


Multi-story: Asymmetrical massing with central hallway

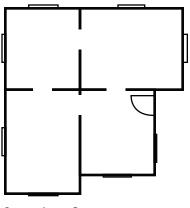


Queen Anne Cottage

Single story: Asymmetrical massing with no central hallway

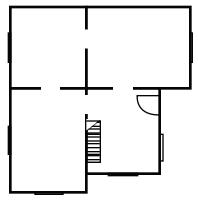


Queen Anne House

Multi-story: Asymmetrical massing with no central hallway

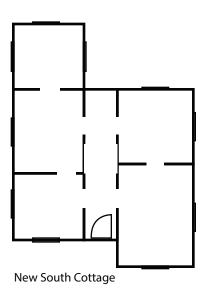


 ${\color{red} \textbf{Single story :} \textbf{Asymmetrical massing with central hallway}}$ 

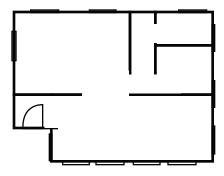


Single story: Irregular floor plans; one of four subtypes identified by a front gable roof shape

Bungalow (Front Gabled)

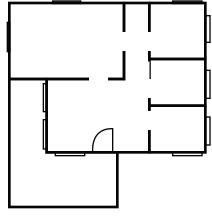


Single story: Irregular floor plans; one of four subtypes identified by a cross gable roof shape

Bungalow (Cross Gabled)

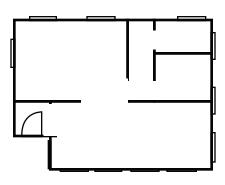


Single story: Irregular floor plans; one of four subtypes identified by a hipped roof shape

Bungalow (Hipped)

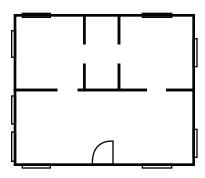


Single story: Irregular floor plans; one of four subtypes identified by a side gable roof shape


Bungalow (Side Gabled)

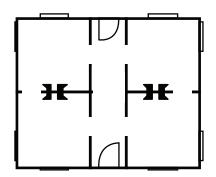

Georgian Cottage

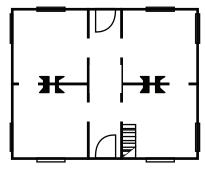

Georgian House

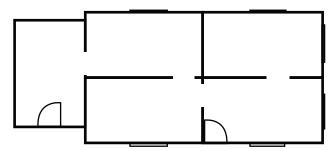


Side-Gabled Cottage

Single story: Two rooms deep by two rooms wide with central hallway


Multi-story: Two rooms deep by two rooms wide with central hallway

Single story: Tightly massed rooms with side projecting gables

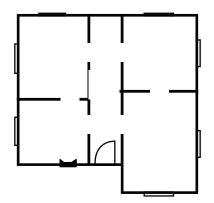


Single story: Irregular room placement with pronounced gable entry and chimney

English Cottage

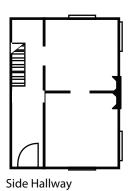

Multi-story: Two rooms deep by one wide with side hallway

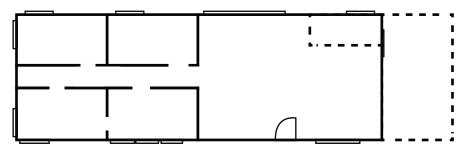

Single story: Multiple rooms wide by two rooms deep; few hallways with interior zoning

Ranch House

# Architectural Styles in Georgia: An Overview

The architecture of a house, its overall form and ornamentation, is classified as a style. Style is the decoration or ornamentation that has been put on a house in a systematic pattern or arrangement. Style has long been an important tool for describing, analyzing, and evaluating historic buildings; a style often reflects the needs and tastes of a particular time and a place in which it appears. Styles used during a particular time and in a particular location may contribute to an understanding of the culture of that period.

































#### Folk Victorian 1870-1920

Folk Victorian houses were built across Georgia in very large numbers. They were simple house forms, or house types, with Victorian-era decorative detailing such as jigsaw woodworks including brackets, spindlework and gingerbread trim. This detailing generally was taken from the elaborate styles, such as Queen Anne or Italianate, that were popular during the mid to late 19th century. Features were borrowed and added onto such places as porches and roof gables. This provided some hint of stylistic detailing on what was otherwise an unadorned traditional house form. This style is actually more a way of decorating a house than a precise stylistic category; however, the Folk Victorian house is so widespread that it demands a name.





#### Colonial Revival 1890-1955

Most Colonial Revival houses are symmetrical. A central entranceway is elaborated with a pediment supported by pilasters or columns. The use of broken pediments, fanlights and sidelights is common. Classical cornices with dentils or modillions are usually present. These features tend to be larger than original colonial details. The roof may be hipped or side-gabled with dormers. Windows have double-hung sashes, usually with six-over-six or nine-over-nine panes and may be paired. Walls are of masonry, masonry-veneer or wood.





#### English Vernacular Revival 1900-1940

Characteristics of English Vernacular Revival houses are a steeply pitched gabled roof with dominant front-facing gable and decorative half-timbering in the gables. Almost all have masonry walls. Most are masonry-veneered, a recently developed technique for applying a thin layer of masonry to a wall. Some houses have patterned brickwork, while others may be completely stuccoed. Often a variety of materials are used, such as brick walls with stone trim, wood half-timbering, and stuccoed gables. Massive masonry chimneys with decorative tops are common. Windows are generally tall and narrow, grouped together, multi-paned, and casements rather than double-hung. Some openings, particularly the entrance, may be emphasized by a round arch. Houses of this style are generally asymmetrical.





#### Craftsman 1910-1930

The Craftsman house uses a wide variety of materials both for its structure and decorative detailing. It has a low-pitched roof that is usually gabled but may also be hipped, giving a generally horizontal effect. The widely overhanging eaves are open with exposed rafters. Large gables have decorative brackets or braces at the eaves and may be covered with half-timbering. Roof dormers are sometimes found. Walls are most often wood but may also be covered with shingles or a masonry veneer of stone or brick. Porches have short square columns set on heavy masonry piers extending to the ground. Windows may have a multi-paned sash over a large one-pane sash. Craftsman houses are most often asymmetrical with a generally open and functional plan.





#### Gothic Revival 1850-1890

Gothic Revival houses typically have steeply pitched gabled roofs with both front-and side-facing gables. Decoratively sawn bargeboards are commonly found along the eaves. Window and door openings often have either pointed arched tops or heavily molded or pointed hoods. Porches are usually supported by slender posts with sawn woodwork forming

flattened arches or brackets. Some houses have vertical board-and-batten siding. This style emphasized picturesqueness, verticality, and varied use of materials.





#### Greek Revival 1825-1860

The Greek Revival style is characterized by details such as prominent columns, pilasters, and wide plain entablatures that encircle a house. Proportions are large and heavy. A symmetrical, rectangular block has a symmetrical front facade with a central entrance. An elaborate door surround contains a rectangular transom, sidelights and pilasters. A typical expression of the Greek Revival in Georgia is a low-pitched, hipped roof supported by columns to form a full-width porch. Porticoes with triangular pediments are also found. Vernacular interpretations with simplified details, such as square rather than round columns, are common. Double-hung windows generally have six-over-six panes.









#### Neoclassical Revival 1895-1940

The most common feature of the Neoclassical Revival style is a dominant full-height front portico with classical columns. The portico may be at the entry or may cover the full facade; it may have a triangular pediment or be part of the overall roof. A full-height entry portico is often coupled with a one-story full-facade porch. The facade is more or less symmetrical, and the central entrance, surrounded with pilasters and columns, is elaborated with fanlights, sidelights, and transoms. There is almost always a classical cornice with dentils or modillions. The roof is usually low-pitched and hipped and may have a balustrade. A porte-cochere and side porches supported by columns are common.





#### Italianate 1840-1885

Italianate houses are generally asymmetrical with an L-shaped or other irregularly shaped plan and gabled roof. Distinguishing features are the widely overhanging eaves with decorative brackets that emphasize the cornice. Typically tall narrow windows with large two-over-two or one-over-one panes are often paired, arched, and topped with elaborate hoods. Bay windows are also common. Italianate style residential architecture faded out during the 1880s; however, many Italianate style commercial blocks were constructed until the 1890s. The flat topped blocks with brackets and decorative window

moldings were two or more stories tall and featured large storefront windows. Brackets beneath eaves are the most distinguishing characteristic of the Italianate commercial block.



#### Mediterranean Revival 1890-1910

A Mediterranean Revival house has smooth stuccoed or masonry walls and is usually asymmetrical. The roof is covered with clay tile, is low-pitched, and may be either hipped or gabled. Houses following the Spanish tradition will have little or no eave overhang, while those following the Italian influence will have widely overhanging eaves with exposed rafters. Recessed and arcaded loggias, or open porches, are common. Windows are generally arched and may be grouped together. Sometimes columns and pilasters are used to elaborate openings.





#### Queen Anne 1880-1915

A Queen Anne style house is asymmetrical with complex roof and wall shapes. It displays a variety of textures, materials, and detailing. The asymmetrical shape results from a floor plan that is open and flowing. The roof is often steeply pitched and hipped with both front-and side-facing, or cross, gables. Wall surfaces avoid a smooth appearance through the use of projecting bays and materials such as patterned shingles that provide texture. The porch is usually asymmetrical and often wraps around two sides of the house. It is supported with slender turned posts and often decorated with sawn brackets and spindlework friezes. Roof gables may also be decorated with sawn ornamentation or spindlework and covered with patterned shingles. There are often prominent and elaborate brick chimneys with patterned and corbeled brickwork. A round or multi-sided tower may be found at a comer.





#### Spanish Colonial Revival 1900-1940

A Spanish Colonial Revival house has a clay tile roof that is usually gabled with little eave overhang. Walls are of smooth stucco. Arched openings and arcaded loggias, or open porches, are common. Windows are generally casement and grouped together. The roof may be elaborated with curvilinear gables or parapets from the mission tradition. Exposed roof beams may protrude from the walls to emphasize construction methods.







The University of Georgia College of Environment and Design Center for Community Design & Preservation Historic Resources Survey Report Butts County, Georgia 2015