Historic Resources Survey Report Pierce County, Georgia

July 2016





The University of Georgia College of Environment and Design Center for Community Design & Preservation Historic Resources Survey Report Pierce County, Georgia 2016

Credits

Report Submitted to:

Georgia Transmission Corporation 2100 East Exchange Place Tucker, Georgia, 30084-5342

Report Prepared by:

Center for Community Design and Preservation at the University of Georgia http://www.ced.uga.edu/pso 225 W Broad St Athens, Georgia, 30062

Pratt Cassity – Principal Investigator Laura Kviklys – Project Coordinator

Audrey Thomas– MHP Candidate. Field Survey, Report Creation Emma Keethler- MHP Candidate. Filed Survey, Report Creation Eleonora Machado, CCDP Graphics Coordinator, Report design

Table of Contents

Page 5 Introduction Page 7 Project Description Page 8 Methodology Page 9 Criteria for Evaluation Page 11 Survey Results Page 20 Integrity Page 22 Conclusion Page 24 Resource Templates Page 135 Bibliography Page 136 House Types in Georgia	Page 4	List of Figures
Page 7 Project Description Page 8 Methodology Page 9 Criteria for Evaluation Page 11 Survey Results Page 20 Integrity Page 22 Conclusion Page 24 Resource Templates Page 135 Bibliography Page 136 House Types in Georgia	Page 4	List of Tables
Page 8 Methodology Page 9 Criteria for Evaluation Page 11 Survey Results Page 20 Integrity Page 22 Conclusion Page 24 Resource Templates Page 135 Bibliography Page 136 House Types in Georgia	Page 5	Introduction
Page 9 Criteria for Evaluation Page 11 Survey Results Page 20 Integrity Page 22 Conclusion Page 24 Resource Templates Page 135 Bibliography Page 136 House Types in Georgia	Page 7	Project Description
Page 11 Survey Results Page 20 Integrity Page 22 Conclusion Page 24 Resource Templates Page 135 Bibliography Page 136 House Types in Georgia	Page 8	Methodology
Page 20 Conclusion Page 24 Resource Templates Page 135 Bibliography Page 136 House Types in Georgia	Page 9	Criteria for Evaluation
Page 22 Conclusion Page 24 Resource Templates Bibliography Page 136 House Types in Georgia	Page 11	Survey Results
Page 24 Resource Templates Bibliography Page 136 House Types in Georgia	Page 20	Integrity
Page 135 Bibliography Page 136 House Types in Georgia	Page 22	Conclusion
Page 136 House Types in Georgia	Page 24	Resource Templates
Page 141	Page 135	Bibliography
Page 141 Architectural Styles in Georgia	Page 136	House Types in Georgia
	Page 141	Architectural Styles in Georgia

List of Figures






Figure 1.	Project Survey Area of Pierce County	Page 6
Figure 2.	Identified Historic Resources in Pierce County	Page 10



House Type	Count	Percent
Bungalow: cross gable	5	4.5%
Bungalow: front gable	19	17.1%
Bungalow: Hip	1	0.9%
Bungalow: Side gable	2	1.8%
Central Hallway	12	10.8%
Double Pen	1	0.9%
Extended Hall-parlor	2	1.8%

Current Use	Count	Percent
Burial - multiple		
(cemetery)	19	9 17.1%
Commerce and Trade		
(commercial) » Store -		
specialty store/shop		1 0.9%
Religious Facility	4	4 3.6%
Secondary structure		



List of Tables

Table 1.	All Identified Resources	Page 12
Table 2.	Resource Type	Page 17
Table 3.	Current Use	Page 17
Table 4.	Date of Construction	Page 17
Table 5.	Residential Building Type	Page 18
Table 6.	Architectural Style	Page 18

Introduction

What is a cultural resource survey?



The Georgia Historic Resources Survey statewide survey of buildongoing, sites, structures, and objects ings, historical, architectural, and cultural significance. The Georgia Survey is one of the programs administered by the Historic Preservation Division of the Department of Natural Resources (HPD).


Completed surveys can be used to identify individual buildings and districts for possible listing in the Georgia Register of Historic Places; assist the preservation efforts of Georgia's Certified Local Governments; support local designations of buildings and districts; expedite environmental review by governmental agencies;

aid preservation and land-use planning; and promote research of the state's history and architecture. Through the public's participation, encouraged by the HPD, surveys can increase awareness of a community's historic resources.

A goal of historic resource survey is to collect a minimum level of information needed statewide for preservation activities. This basic, standard survey does not gather all the kinds of information needed in local preservation planning, environmental review, National Register nominations, or historical research, but serves as a foundation for these preservation activities.

^{1&}lt;>>. "Georgia Historic Resources Survey Manual," Atlanta: Georgia Department of Natural Resources, Historic Preservation Division, 2000.

Figure 1. Project Survey Area of Pierce County

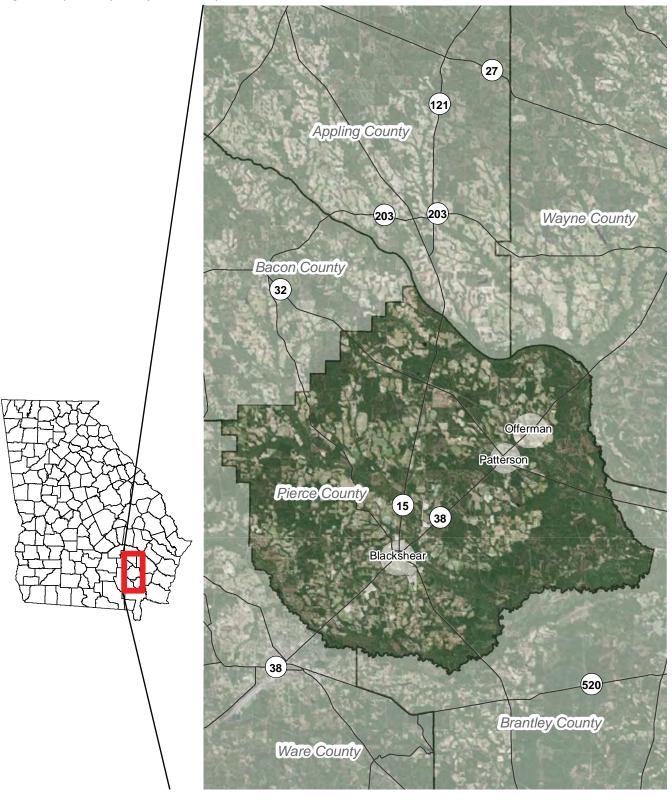

Project Description

The Findit! Program housed at the Center for Community Design and Preservation (CCDP) within the University of Georgia's College of Environment and Design (CED) conducted a Phase I Historic Resource Survey of Pierce County, Georgia in July 2016. Findit! Is a state-wide cultural resource survey program sponsored by the Georgia Transmission Corporation (GTC) in partnership with the Georgia Department of Natural Resources, Historic Preservation Division (GA SHPO). The project area covered the 316 square mile county, identifying resources only in unincorporated portions. Pierce County is located in southeast Georgia and is bordered by Bacon, Appling, and Wayne counties to the north and east, and Brantley and Ware counties to the south and west.

The resource survey was performed by historic graduate students in the Historic Preservation program (MHP) at the CED. The survey consisted of historical and developmental research of the project area, identifying previous surveys and listed districts within the county, windshield and pedestrian field work, and data collection and analysis.

The information collected by the field survey was entered into Georgia's Natural, Archaeological, and Historic Resources Geographical Information System, (GNARHGIS), a web-based geographical information system designed to store and display information about Georgia's cultural resources. GNARHGIS is the repository for all of the current statewide historic resources survey data. The survey information was entered under survey ID 2336, "Findit Pierce County," and can be accessed at: https://www.gnahrgis.org/gnahrgis/index.do.

Karen Anderson-Cordova and Leigh Burns. Preservation Primer: A Resource Guide for Georgia, Atlanta: Georgia Department of Natural Resources, Historic Preservation Division, 2011, 5.

Methodology

The survey was conducted according to the procedures outlined in The Georgia Historic Resources Survey Manual. The surveyors used a combination of USGS base maps and GIS data to identify potentially historic parcels and structures.

The survey was conducted according to the procedures outlined in The Georgia Historic Resources Survey Manual. The surveyors used a combination of USGS base maps and GIS data to identify potentially historic parcels and structures. The area was surveyed over the course of several days with systematic coverage of the project area.

Each assigned resource (within the assigned boundaries) was assessed for historic significance, and architectural integrity. A Georgia Historic Resources survey form was completed for buildings having a minimum level of architectural integrity. A structure with architectural integrity is one that generally retains its original location, design, setting, materials, workmanship, feeling and association. Properties with a significant loss of physical integrity, or those lacking historic significance were not surveyed. The physical condition of structures was not a consideration for identification for resources which retained architectural integrity.

All identified resources were approximately 50 years old or older, with the exception of Ranch Houses which were documented with a construction date prior to 1975. All properties surveyed were assigned an identification number then documented with the completion of a Georgia Historic Resource Survey Form, as well as photo documentation and corresponding georeferencing data. The survey form includes information about the use, style, floor plan, materials, context, physical description and an accurate determination of the date of construction and additions. Sources utilized for age determination and architectural style and type description included Lee and Virginia McAlester's A Field Guide to American Houses, the Georgia Historic Resources Survey Manual, Georgia's Living Places and A Visual Guide to Architecture by Francis D. K. Ching. All dates of construction are presented in nine year increments unless explicitly identified by markers or other documentation.

¹ Georgia's Living Places: Historic Houses in their Landscaped Settings (1991), http://georgiashpo.org/sites/uploads/hpd/pdf/NR15arch_20080521100904_ optimized.pdf, (accessed August 01, 2012).

Criteria for Evaluation

National Register for Historic Places

Each resource was evaluated for potential listing in the National Register of Historic Places (NRHP), those resources already listed in the Register have been noted. The criteria for listing are outlined in the National Register Bulletin How to Apply the National Register Criteria for Evaluation published by the U.S Department of Interior, National Park Service. Cultural resources can be defined as eligible for the NRHP if they:

- A. Are associated with events that have had a significant contribution to a broad pattern of history; or
- Are associated with the lives of persons significant in the past;
- C. Embody distinctive characteristics of a type, period, or method of construction, or represent the work of a master, possess high artistic values, or represent a significant and distinguished entity whose components may lack distinction; or
- D. Have yielded or may be likely to yield, information important to history or prehistory.¹

Ordinarily cemeteries, birthplaces, or graves of historical figures, properties owned by religious institutions or used for religious purposes, structures that have been moved from their original locations, reconstructed historic buildings, properties primarily commemorative in nature, and properties that have achieved significance within the last 50 years are not considered for the National Register. However, properties will qualify if they are integral parts of districts that do meet the criteria or they fall within the following categories:

- A religious property deriving primary significance from architectural or artistic distinction or historical importance; or
- A building or structure removed from its original location but which is significant primarily for architectural value, or which is the surviving structure most importantly associated with a historic person or event; or
- A birthplace or grave of a historical figure of outstanding importance if there is no appropriate site or building directly associated with his or her productive life; or
- d. A cemetery which derives its primary significance from graves or persons of transcendent importance, from age, from distinctive design features, or from association with historic events; or
- e. A reconstructed building when accurately executed in a suitable environment and presented in a dignified manner as part of a restoration master plan, and when no other building or structure with the same association has survived; or
- f. A property achieving significance within the last 50 years if it is of exceptional importance.


For a property to qualify for the National Register it must meet one of the National Register Criteria for Evaluation by:

- Being associated with an important historical context and
- Retaining historic integrity of those features to convey its significance.

To determine whether a property or site retains integrity, it needs to be evaluated for the aspects of its location, design, setting, workmanship, materials, feeling, and association to convey its historic significance.²

¹The Criteria for Evaluation are found in the Code of Federal Regulations, Title 36, Part 60, reprinted in U.S. Department of Interior, National Park Service, National Register Bulletin: How to Apply the National Register Criteria for Evaluation, Washington, D.C., 1997, p. 2-3.

Figure 2. Identified Historic Resources in Pierce County

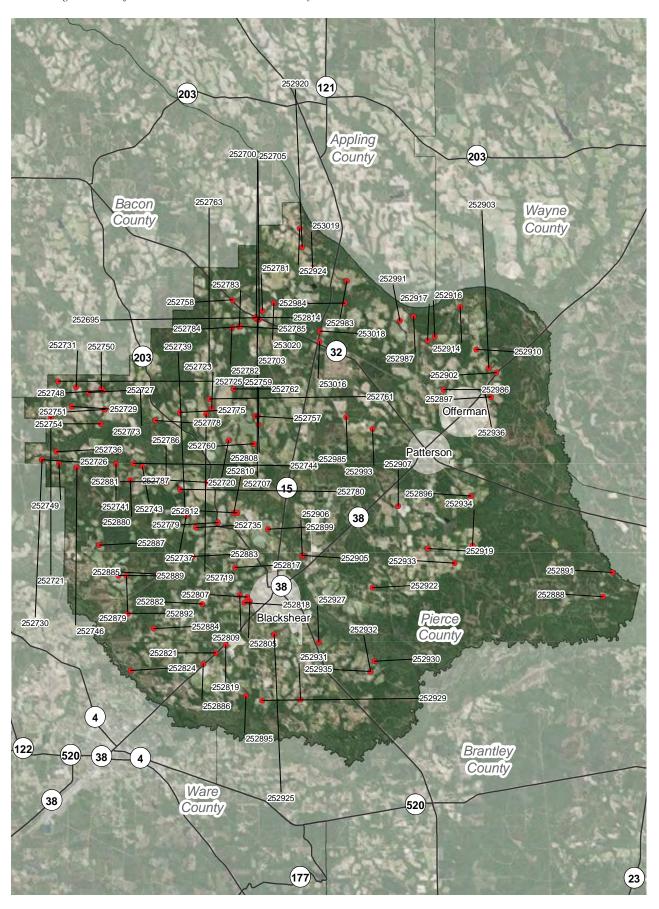

Survey Results

A total of 111 historic resources that meet and maintain a minimum level of age, architectural integrity, and historic significance were identified in unincorporated Pierce County. These resources are primarily buildings, with 90 resources remaining county wide. Pierce County has a wide array of extant building types; the Front Gable Bungalow is the most common with 19 identified, followed by the Ranch House of which 13 still exist. The remaining house types had a large variation in type and number and include: Cross Gable Bungalow (5), Hipped Bungalow (1), Side Gable Bungalow (2) Central Hallway Cottage (12), Double Pen (1), Extended Hall-parlor (2), Gabled ell Cottage (3), Georgian Cottage (4), Hall-parlor (3), I-house (2), Plantation Plain (1), Single Pen (2), and unknown (7).

The survey identified architectural styles that were popular in the late 19th and early 20th centuries. Elements of the Craftsman style were noted on 11 extant resources (9.9%), which is indicative of 1920s construction and taste. Elements of the Folk Victorian stylewas evident on 1 resources, which was fashionable at the turn of the 20th century.

A total of 79 (71.2%) documented structures exhibited no architectural style. A building with no architectural style may be historic, but does not have any characteristics or elements of high style, or classical architecture. Buildings in unincorporated areas usually do not embody high styles, and this figure is representative of vernacular architecture across the state. The variance in building type and architectural styles exhibited in unincorporated Pierce County is typical for historically agrarian Georgia communities.

Table 1: All Identified Resources

Name	Resource ID	Latitude	Longitude	National register eligibility	Description
1	252695	31.46360849	-82.25712927	May meet	Mershon Schoo
2	252700	31.46434115	-82.25724656	May meet	Single retail commercial
3	252703	31.46383436	-82.25578636	May meet	Multiple Commercial
4	252705	31.46292946	-82.25512927	Does not meet	Front gable church
5	252707	31.46242679	-82.25629198	May meet	Bungalow: front gable
6	252719	31.4075482	-82.2917616	Does not meet	Georgian Cottage
7	252720	31.39222526	-82.2763383	Appears to meet	School building
8	252723	31.41088	-82.28811137	Does not meet	Ramah Baptist Church Cemetery
9	252721	31.40564326	-82.39944531	Does not meet	Bungalow: cross gable
10	252725	31.42660346	-82.39437548	Does not meet	hall-parlor
11	252727	31.42002649	-82.37340574	Does not meet	Ranch house
12	252729	31.41184686	-82.38513449	May meet	Ranch house
13	252731	31.42319933	-82.38202812	May meet	Bungalow: cross gable
14	252736	31.38554427	-82.39547566	Appears to meet	Georgian Cottage
15	252918	31.29864068	-82.04170475	May meet	Church of Christ
16	252726	31.38085328	-82.40553178	May meet	I-house
17	252730	31.37646632			Active use cemetery
18	252735	31.34149112	-82.29869522	Does not meet	Ranch house
19	252737	31.34848661	-82.30556239	Does not meet	Ranch house
20	252739	31.35176	-82.30646	Does not meet	Bungalow: front gable
21	252743	31.37693887	-82.33605735	Does not meet	Central hallway
22	252748	31.42119978	-82.3633886	Does not meet	Ranch house
23	252750	31.42241104	-82.36456907	Does not meet	Bungalow: cross gable
24	252751	31.41020964	-82.36207449	Does not meet	Central hallway
25	252754	31.4018508	-82.36499315	May meet	Unknown building type

26	252741	31.37842496	-82.35417507	May meet	Central hallway
27	252744	31,37888122	-82.34217239	Does not meet	Bungalow: front gable
28	252746	31.37626395	-82.38130592	Does not meet	Bungalow: front gable
29	252749	31.37879068	-82.39373167	Does not meet	Bungalow: front gable
30	252758	31.474197	-82.273649	Does not meet	Gabled Ell cottage
31	252781	31,467881	-82.252941	May meet	Unknown building type
32	252782	31.45764	-82.27402	May meet	Single pen
33	252783	31.4585217	-82.26843111	Appears to meet	Bungalow: Hip
34	252784	31.45890099	-82.26885615	May meet	Single Pen
35	252785	31.45899184	-82.26820781	May meet	Commercial structure
36	252757	31,40652617	-82.25761875	Does not meet	Bungalow: front gable
37	252759	31.40162517	-82.25546484	May meet	Central hallway
38	252760	31.39043036	-82.2586298	Does not meet	Unknown building type
39	252761	31.41645061	-82.2893502	May meet	Extended hall- parlor
40	252762	31.422275	-82.272925	May meet	Central hallway
41	252763	31.43598598	-82.2898893	Does not meet	Ranch house
42	252773	31.421888	-82.337474	May meet	Gabled Ell cottage
43	252775	31.40847844	-82.31010006	Appears to meet	Unknown building type
44	252778	31.40394687	-82.32713901	May meet	Henderson Cemetery
45	252786	31.367942	-82.319521	Does not meet	Ranch house
46	252787	31.3680178	-82.29089778	May meet	Sweat Cemetery
47	252808	31.406563	-82.256869	May meet	Bungalow: front gable
48	252788	31.35001109	-82.27425516	Does not meet	Unknown building type
49	252779	31.34448234	-82.2837398	May meet	Georgian Cottage
50	252789	31.35001584	-82.27030315	Does not meet	Bungalow: cross gable
51	252780	31.36326883	-82.30957032	May meet	Unknown building type

52	252814	31.463766	-82.258135	May meet	Ranch house
53	252817	31.318254	-82.271667	May meet	Central hallway
54	252818	31.29827207	-82.26518694	Appears to meet	Bungalow: front gable
55	252805	31.29857607	-82.26146146	May meet	Hebron Temple of Blackshear
56	252807	31.30122522	-82.263193	Appears to meet	Ranch house
57	252809	31.30200492	-82.268534	Appears to meet	Bungalow: front gable
58	252819	31.27273008	-82.27778741	Does not meet	Ranch house
59	252821	31.26861	-82.28512	May meet	Single retail commercial
60	252824	31.25842713	-82.3442309	Does not meet	Ranch house
61	252880	31.36953979	-82.34381137	May meet	Central hallway
62	252881	31.36850032	-82.32511799	Appears to meet	Unknown building type
63	252883	31.32471896	-82.3010777	Appears to meet	Bungalow: front gable
64	252885	31.31441875	-82.32485073	Does not meet	Extended hall- parlor
65	252879	31.31459325	-82.34699484	Appears to meet	Bungalow: front gable
66	252882	31.29657108	-82.29435448	May meet	Bungalow: front gable
67	252884	31.28277588	-82.32811971		Ranch house
68	252886	31.26209939	-82.29368609	Does not meet	Commercial: gas station
69	252887	31.331034	-82.365598	Appears to meet	Central hallway
70	252889	31.31353752	-82.35233668	May meet	Bungalow: front gable
71	252892	31.29151956	-82.34602714	May meet	Bungalow: front gable
72	252895	31.24322896	-82.26423674	May meet	Central hallway
73	252899	31.340557	-82.248893	Does not meet	Bungalow: side gable
74	252905	31.325336	-82.224743	Does not meet	Shiloh Cemetery
75	252906	31.32512263	-82.22541476	May meet	Shiloh Church
76	252907	31.35457727	-82.15826032	Does not meet	Strickland Cemetery
77	252919	31.32438465	-82.13812761	May meet	Bungalow: front gable

78	252922	31.30688417	-82.17663166	May meet	Smith Cemetery
79	252924	31.51557793	-82.22716621	Does not meet	Martha Memorial Cemetery
80	252925	31.279412	-82.244587	May meet	Ivy Cemetery
81	252929	31.24087752	-82.25243913	Appears to meet	I-house
82	252931	31.24146671	-82.22638913	May meet	Enon Church
83	252932	31.25783448	-82.17780353	May meet	bungalow: side gable
84	252935	31.25630222	-82.20510225	May meet	Front gable church
85	252927	31.27503941	-82.21362883	May meet	Brown's Cemetery
86	252930	31.26374982	-82.17522872	Does not meet	Winn Thomas Cemetery
87	252933	31.32092671	-82.11966526	May meet	hall-parlor
88	252934	31.33112434	-82.10719181	Does not meet	Bungalow: front gable
89	252888	31.30129292	-82.0169205	Does not meet	Gabled Ell cottage
90	252891	31.31525915	-82.01039309	Does not meet	New Prospect Cemetery
91	252896	31.3600209	-82.10839318	May meet	Central hallway
92	252897	31.41767447	-82.09425591	May meet	Bungalow: cross gable
93	252902	31.43181449	-82.09074825	May meet	Ranch house
94	252903	31.43444398	-82.09599265		Unknown building type
95	252910	31.44529151	-82.10463994	May meet	Central hallway
96	252914	31.4702348	-82.11565041	Does not meet	Clay Hill Cemetery
97	252916	31.45264017	-82.13329636	Does not meet	World Wide Deliverance Church
98	252917	31.45055646	-82.13833391	Does not meet	Mill Creek Church Cemetery
99	252936	31.42143436	-82.09882251	Does not meet	Bungalow: front gable
100	252920	31.50501768	-82.22537845	May meet	Double Pen
101	252986	31.42198056	-82.12737759	May meet	hall-parlor
102	252987	31.46462841	-82.14798797	Does not meet	Aspinwall Cemetery

Table 1 Continued: All Identified Resources

103	252991	31.46200355	-82.15755204	May meet	Old Tyre Cemetery
104	252993	31.39878174	-82.17652936	May meet	Bungalow: front gable
105	252985	31.40603164	-82.19491561	May meet	Bungalow: front gable
106	252984	31.47224093	-82.19579475	Does not meet	Bird Cemetery
107	252983	31.48505023	-82.19426417	May meet	Georgian Cottage
108	253016	31.4496544	-82.21334931	May meet	Single retail commercial
109	253018	31.45593407	-82.21440965	May meet	Plantation Plain
110	253019	31.49266323	-82.21800636	May meet	Central hallway
111	253020	31.47257707	-82.24461813	Does not meet	Active use cemetery



Resource Type	Count	Percent
Building	90	81.1%
Site	20	18.0%

Table 3. Current Resource Use

Current Use	Count	Percent
Burial - multiple		
(cemetery)	19	17.1%
Commerce and Trade		
(commercial) » Store -		
specialty store/shop	1	0.9%
Religious Facility	4	3.6%
Secondary structure		
(domestic-related		
outbuilding)	4	3.6%
Single dwelling (single		
living unit)	43	38.7%
Store - department		
(general) store	1	0.9%
Store - specialty		
store/shop	1	0.9%
Unknown (Insufficient		
information)	8	7.2%
Vacant/not in use	30	27.0%

Table 4. Date of Construction


Date of Construction	Count	Percent
1820-1829	2	1.8%
1840-1849	1	0.9%
1850-1859	1	0.9%
1860-1869	3	2.7%
1870-1879	2	1.8%
1880-1889	3	2.7%
1890-1899	7	6.3%
1900-1909	19	17.1%
1910-1919	16	14.4%
1920-1929	15	13.5%
1930-1939	20	18.0%
1940-1949	6	5.4%
1950-1959	3	2.7%
1960-1969	8	7.2%
1970-1975	3	2.7%
post-1975	1	0.9%
Unknown	1	0.9%

Table 5. Identified Building Types

House Type	Count	Percent
Bungalow: cross gable	5	4.5%
Bungalow: front gable	19	17.1%
Bungalow: Hip	1	0.9%
Bungalow: Side gable	2	1.8%
Central Hallway	12	10.8%
Double Pen	1	0.9%
Extended Hall-parlor	2	1.8%
Gabled Ell Cottage	3	2.7%
Georgian Cottage	4	3.6%
Hall-parlor	3	2.7%
I-House	2	1.8%
Plantation Plain	1	0.9%
Ranch House	13	11.7%
Single Pen	2	1.8%
Unknown Building		
Type	7	6.3%

Table 6. Identified Architectural Styles

Style	Count	Percent
Craftsman	11	9.9%
Folk Victorian	1	0.9%
No Academic Style	79	71.2%

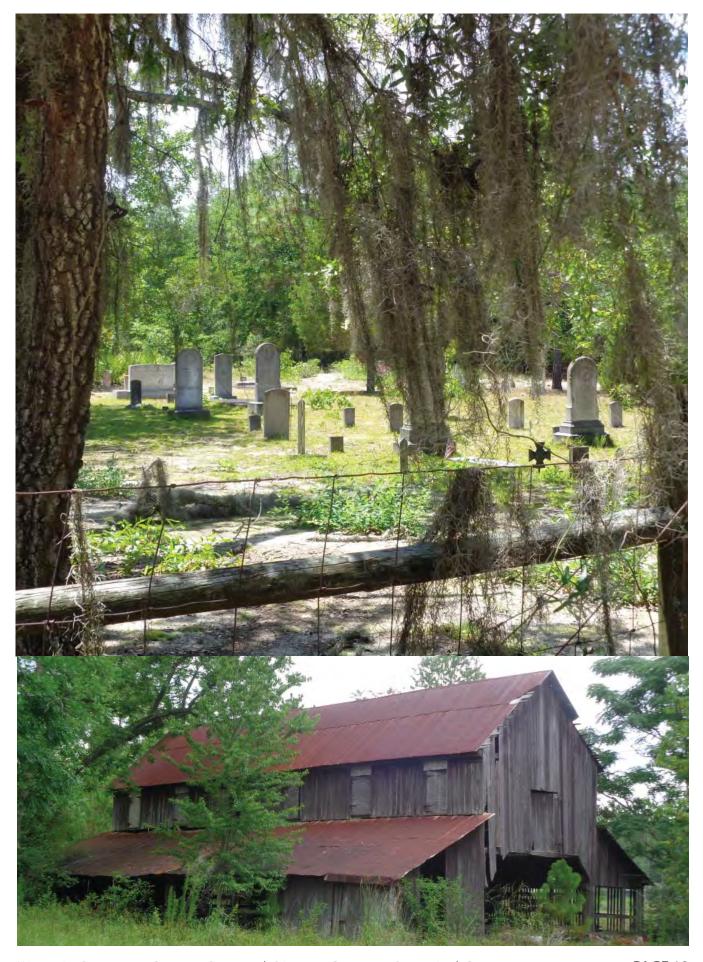

Historic Resource Survey Report | Pierce County, Georgia | Summer 2016

Integrity



The integriy of documented resources in unincorporated Pierce County was mainly fair to good. The integrity of those not documented, was often affected by non-historic alterations, which compromise the resource's design, materials, and/or historic workmanship. These changes include additions to the building and material replacement including but not limited to: exterior cladding, porch alterations, window or door replacement, etc.

30 of the 111 (27%) identified resources are currently vacant. Many resources documented as 'vacant' maintain excellent integrity; these resources have few, if any alterations to their historic fabric. Vacant properties are considered highly endangered because they are more susceptible to fire and vandalism. Additionally, repairs and weatherproofing are not carried out in a timely manner, thus leaving the structures to decay. The condition of many of these resources is poor, but with minimal intervention, many of them can be restored.

Of the resources with minimal alterations, 12 appear to

meet the criteria for eligibility for the National Register of Historic Places.

57 resource 'may meet' the National Register criteria; these resources have good to excellent architectural integrity, but warrant further research as to their accurate age and historic significance.

42 documented resources do not appear to meet the National Register standards. These resources may maintain historic significance, but do not meet the age criteria (as is the case with many cemeteries), or have undergone extensive alterations which hinder the resource's architectural integrity. These alterations often affect the design, materials, or workmanship of the particular resource, which invariably destroy the historic feeling and significance.



Conclusion



Pierce County has a wide array of extant house types for a formerly agrarian area. 2016 was the first time unincorporated Pierce County was documented; the existing building stock serves as a good sampling of what may have historically been in this area.

A number of mid-century residential and religious structures were documented which may gain historic significance in their own right in the near future. Many mid-century residential resources maintain good integrity with few alterations; religious structures from the same period however, have undergone extensive alterations such as large additions or material replacements. Not documented in this study, but anecdotally noted, were a number of structures dating to the late 1970s and 1980s. If the architecturally integrity of these potential resources remain intact, they may warrant a historic inventory in the coming decades.

The disparate location of historic resources does not lend to a contagious district in the unincorporated portions of the county; however, a multiple property listing or a cultural landscape inventory within an agricultural context may provide protection for these resources on a county level.



Field ID: PR-1
GNAHRGIS ID: 252695
County: Pierce

County: Preliminary NR

Assessment: May Meet



Mershon School Intersection of HWY 32 & Mershon Rd

Coordinates: 31.46361, -82.25712





Resource Type Building

Resource Use Educational: School

Date of Construction ca. 1951

Building Type Unknown

Structural System Brick Bearing

Style No Academic Style

Roof Hip

Exterior Cladding Brick

Foundation Unknown

Porch N/A

Windows Double Hung Sash: 1/1

Chimney No Chimney Observed

Additional Notes Front entry with archway Stepped pattern on entry

Large addition
Windows missing

Field ID: PR-110 GNAHRGIS ID: 253019 County: Pierce

County: Preliminary NR

Assessment: May Meet



Winn Road, 180 yards East of Winn Drive

Coordinates: 31.45593, -82.214409





Resource Type Building

Resource Use Domestic: Single Family

Dwelling

Date of Construction 1900

Building Type Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Side

Exterior Cladding Wood: Clapboard

Foundation Unknown

Porch Verandah

Windows Double Hung Sash: 2/2.

Rectangular.

Chimney Gable-End Exterior: Brick

Additional Notes Fish scale shingle roof

Obscured by vegetation Chimney on the left No visible additions

Field ID: PR-2 GNAHRGIS ID: 252700 County: Pierce

County: Preliminary NR

Assessment: May Meet



Intersection HWY 32 & Mershon Rd

Coordinates: 31.46434, -82.25724





Resource Type Building

Resource Use Vacant

Date of Construction ca. 1935

Building Type Unknown

Structural System Brick Bearing

Style No academic style

Roof Gable: Front

Exterior Cladding Brick, Wood:

Weatherboard

Foundation Unknown

Porch N/A

Windows Fixed: Single Pane

Chimney No Chimney Observed

Additional Notes Sign and weatherboard in

front gable

Awning across front Polychromatic brick

Field ID: PR-3
GNAHRGIS ID: 252703
County: Pierce

County: Preliminary NR

Assessment: May Meet



North on HWY 32 in Mershon

Coordinates: 31.46434, -82.25724





Resource Type Building

Resource Use Commercial: Multiple

Date of Construction ca. 1925

Building Type Unknown

Structural System Brick Bearing

Style Elements: Craftsman

Roof Unknown

Exterior Cladding Brick

Foundation Unknown

Porch N/A

Windows Double Hung Sash: 3/1

Chimney No Chimney Observed

Additional Notes 2 commercial storefronts
Stepped roof pattern

Mid-century aluminum

awning

Field ID: PR-4 **GNAHRGIS ID: 252705**

County: Preliminary NR Pierce

Assessment: Does not meet



Intersection HWY 32 & Jonson Byps

Coordinates: 31.46293, -82.25513





Resource Type Building

Resource Use Religious: Church

Date of Construction ca. 1945

Building Type Church: Central Tower

Structural System Brick Bearing

Style No Academic Style

Roof Gable: Cross

Exterior Cladding Brick, Wood:

Weatherboard

Foundation Unknown

Porch Recessed

Windows Fixed

Chimney No Chimney Observed

Additional Notes Recessed arch entry

Large rear addition Rounded arch vents Stained glass windows

Field ID: PR-5 GNAHRGIS ID: 252707 County: Pierce

County: Preliminary NR

Assessment: May Meet



Corner of Johnson Bypass

Coordinates: 31.46242, -82.25629





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1915

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Weatherboard

Foundation Pier: Brick

Porch Verandah

Windows Double Hung Sash

Chimney No Chimney Observed

Additional Notes Battered columns

Possible rear addition No front windows visible

No balustrade

Field ID: PR-6 GNAHRGIS ID: 252719

County: Pierce **Preliminary NR**

Assessment: Does not meet



2955 W. Horseshoe Road

Coordinates: 31.40755, -82.29176





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1920

Building Type Georgian Cottage

Structural System Balloon Frame

Style Craftsman

Roof Hip

Exterior Cladding Wood: Weatherboard

Foundation Continuous: Concrete

Porch Verandah

Windows Double Hung Sash: 1/1

Chimney Off-Center Within Roof

Surface: Brick

Additional Notes Paired windows on facade

Tuscan columns Exposed rafter tails

Rear and carport additions

Field ID: PR-7 **GNAHRGIS ID: 252720 County: Preliminary NR** Pierce

Assessment: Appears to Meet



NE Corner of W. Horseshoe Rd & Walkerville Rd

Coordinates: 31.39223, -82.27634





Resource Type Building

Resource Use Vacant

Date of Construction ca. 1910

Building Type School House: One Room

Structural System Balloon Frame

Style No Academic Style

Roof Hip

Exterior Cladding Wood: Weatherboard

Foundation Pier: Concrete

Porch N/A

Windows Unknown

Chimney No Chimney Observed

Additional Notes Pentagonal vent in gable

Windows boarded May have been moved Rear wall compromised

Field ID: PR-8 GNAHRGIS ID: 252723

County: Preliminary NR

Assessment: Does not meet

Pierce



Ramah Baptist Church Cemetery intersection of Herman Road Ramah &Ramah Church

Coordinates: 31.41088, -82.28811



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1890

Common Names None Observed

≈ Number of Burials 100-200

Oldest Burial 1890

Burial Description None observed



Cemetery Description Active Use

Active Use
Older graves in NW
Granite and concrete
ledger stones
Granite outlined family
plots
Few granite footstones

Field ID: PR-9
GNAHRGIS ID: 252721
County: Pierce

County: Preliminary NR

Assessment: Does not meet



2948 Sweat Road

Coordinates: 31.40564, -82.39945





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1900

Building Type Unknown

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Board-and-Batten:

Vertical Board

Foundation Continuous: Brick

Porch Portico, Stoop

Windows Double Hung Sash: 6/6

Chimney Center: Brick

Additional Notes Not an academic type

Unpainted exterior Two significant

outbuildings on the parcel

Field ID: PR-10 GNAHRGIS ID: 252725 County: Pierce

County: Preliminary NR

Assessment: Does not meet



2486 Beylah Church Road

Coordinates: 31.42660, -82.39437



Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1910

Building Type Hall-Parlor

Structural System Concrete Block

Style No Academic Style

Roof Gable: Side

Exterior Cladding Board-and-Batten:

Vertical Board, Concrete

Foundation Unknown

Porch Recessed

Windows Double Hung Sash: 1/1

Chimney No Chimney Observed

Additional Notes Porch enclosed

Multiple alterations; building shell is difficult to

discern

Field ID: PR-11
GNAHRGIS ID: 252727
County: Pierce

County: Preliminary NR

Assessment: Does not meet



Corner of Daniel Rd & Smart Rd

Coordinates: 31.41988, -82.37391





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1955

Building Type Ranch

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Prism Synthetics: Vinyl

Siding

Foundation Unknown

Porch Portico

Windows Fixed: 1/2

Chimney No Chimney Observed

Additional Notes Circular vent in front gable

Four slender porch

supports

Long horizontal windows

Field ID: PR-12 GNAHRGIS ID: 252729 County: Pierce


County: Preliminary NR

Assessment: May Meet



Bowman's Path

Coordinates: 31.41185, -82.38513

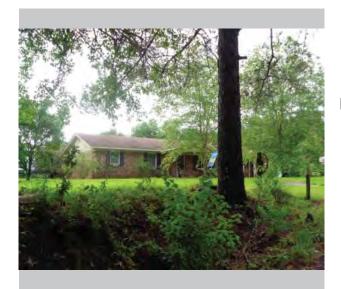

Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1964

Building Type Ranch

Structural System Brick Bearing

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Brick, Wood:

Weatherboard

Foundation Unknown

Porch Portico

Windows Double Hung Sash: 1/1

Chimney No Chimney Observed

Additional Notes Polychromatic red brick

Replacement windows
Vertical wood siding on

gables and side

Field ID: PR-13 GNAHRGIS ID: 252731 County: Pierce

County: Preliminary NR

Assessment: May Meet



734 Peacock Road

Coordinates: 31.42319, -82.38203





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1935

Building Type Bungalow: Cross Gable

Structural System Balloon Frame

Style Elements: Craftsman

Roof Gable: Multi

Exterior Cladding Prism Synthetics:

Asbestos Siding

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 2/2

Chimney No Chimney Observed

Additional Notes Paired double hung sash

windows

Craftsman three light door

Exposed rafter tails

Pierce County CE+DISTORIC Resource

Field ID: PR-14 GNAHRGIS ID: 252736 County: Pierce

County: Preliminary NR

Assessment: Appears to Meet



Intersection of Sunset Rd & Buelah Church Rd

Coordinates: 31.38554, -82.39548



Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1907

Building Type Georgian Cottage

Structural System Balloon Frame

Style No Academic Style

Roof Complex

Exterior Cladding Wood: Clapboard

Foundation Unknown

Porch Wrap-Around

Windows Double Hung Sash: 2/2

Chimney Off-Ctr in Roof Surf, Interior Gable End: Brick

Additional Notes Porch partially enclosed as

early addition

Obscured by vegetation 'Old Home Site' marker

Field ID: PR-15 GNAHRGIS ID: 252918 County: Pierce

County: Preliminary NR

Assessment: May Meet



Church of Christ / Raulerson Church Trudie Road between Oliver Rd & Lynn Rd

Coordinates: -82.041517, 31.298549





Resource Type Building

Resource Use Religious: Church

Date of Construction 1945

Building Type Front Gable Church

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Brick

Foundation Pier: Brick

Porch Portico

Windows Fixed: Pointed arch, 2/2/2

Chimney No Chimney Observed

Additional Notes "T" shape, possible back addition. Exposed rafters, arched windows. Stepped brick detail on sides/rear.

Pierce County CE+DHISTORIC Resource

Field ID: PR-16
GNAHRGIS ID: 252726
County: Pierce

County: Preliminary NR

Assessment: May Meet



3637 Davis Road

Coordinates: 31.38085, -82.40553





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1900

Building Type I-House: Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Prism Synthetics: Vinyl

Siding

Foundation Continuous: Brick

Porch Verandah

Windows Double Hung Sash: 6/6

Chimney Exterior Gable End: Brick

Additional Notes Large rear addition

Turned post porch

supports

Vinyl affects integrity

Field ID: PR-17 **GNAHRGIS ID: 252730** Pierce

County: Preliminary NR

Assessment: May Meet



Old Alma Rd between Lee Drive & Jacks Rd

Coordinates: 31.38085, -82.40553



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1861

Common Names None observed

≈ Number of Burials 70

Oldest Burial 1861

Burial Description CSA, Masons, USMC



Cemetery Description Iron fencing outlined family plot Few raised brick ledger stones Mostly random plots Some broken headstones Fair condition Active use

Field ID: PR-18
GNAHRGIS ID: 252735
County: Pierce

County: Preliminary NR

Assessment: Does not meet



Southeast on Old Alma Rd

Coordinates: 31.34149, -82.29869





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1960

Building Type Ranch

Structural System Brick Bearing

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Brick

Foundation Unknown

Porch Recessed

Windows Double Hung Sash: 6/6

Chimney No Chimney Observed

Additional Notes Linear ranch, left cluster

Open carport
Paired windows
Triangular vent

Field ID: PR-19 **GNAHRGIS ID: 252737 County: Preliminary NR** Pierce

Assessment: Does not meet



Old Alma Road, approx 3 m from Blackshear

Coordinates: 31.34849, -82.30556





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1940

Building Type Side Gable Cottage

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Prism Synthetics: Vinyl

Siding

Foundation Unknown

Porch Portico

Windows Double Hung Sash: 1/1

Chimney Gable End, Exterior: Brick

Additional Notes Paired windows

Multiple material replacements and side

additions

Field ID: **PR-20 GNAHRGIS ID: 252739** Pierce

County: Preliminary NR

Assessment: Does not meet



4677 Old Alma Road

Coordinates: 31.35176, -82.30646





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1930

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Wood: Weatherboard

Foundation Brick

Porch Portico

Windows Unknown

Chimney No Chimney Observed

Additional Notes Appears to have a

mid-century addition with a large horizontal facade

Rectangular vents

Field ID: PR-21 GNAHRGIS ID: 252743 County: Pierce

County: Preliminary NR

Assessment: Does not meet



End of Lee Drive off Radio Station Road

Coordinates: 31.37694, -82.33606





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1900

Building Type Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Side

Exterior Cladding Wood: Weatherboard,

Board-and Batten: Vertical

Foundation Pier with Infill: Brick

Porch Verandah

Windows Double Hung Sash: 2/2

Chimney No Chimney Observed

Additional Notes Enclosed portion of right verandah, 2 additions

Replacement windows

and siding

Field ID: PR-22 GNAHRGIS ID: 252748 County: Pierce

County: Preliminary NR

Assessment: Does not meet



2663 Radio Station Road

Coordinates: 31.42119, -82.36339





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1968

Building Type Ranch

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Side

Exterior Cladding Brick

Foundation Unknown

Porch Stoop

Windows Double Hung Sash: 2/2,

Fixed: Single Pane

Chimney No Chimney Observed

Additional Notes Door with inset fanlight

Chicago window Paired 2/2 double hung

sash windows

Field ID: **PR-23 GNAHRGIS ID: 252750 County: Preliminary NR** Pierce

Assessment: Does not meet



Radio Station Road next to 2559

Coordinates: 31.42241, -82.36457





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1945

Building Type Bungalow: Cross Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Prism Synthetics:

Masonite Siding

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 6/6

Chimney Center: Brick

Additional Notes Multiple rear additions

Porch is walled and

screened

Questionable condition

Field ID: PR-24 GNAHRGIS ID: 252751 County: Pierce

County: Preliminary NR

Assessment: Does not meet



On Davis Farm at Millbranch Road

Coordinates: 31.41021, -82.36207





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1900

Building Type Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Side

Exterior Cladding Board-and-Batten:

Vertical Board

Foundation Pier: Unknown

Porch Verandah

Windows Unknown

Chimney Gable End, Exterior:

Stuccoed Masonry

Additional Notes Windows boarded

Appears to have back

porch

Field ID: PR-25 GNAHRGIS ID: 252754 County: Pierce

County: Preliminary NR

Assessment: May Meet



End of Willis Road

Coordinates: 31.40185, -82.36499





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1930

Building Type Unknown

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Side

Exterior Cladding Wood: Weatherboard

Foundation Unknown

Porch Verandah

Windows Unknown

Chimney No Chimney Observed

Additional Notes Set far off public right of way; difficult to survey Appears to have multiple

material replacements

Field ID: PR-26
GNAHRGIS ID: 252741
County: Pierce

County: Preliminary NR

Assessment: May Meet



Apprx Mile from corner of Sunset Rd & Guest Rd

Coordinates: 31.37843, -82.35417





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1900

Building Type Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Side

Exterior Cladding Board-and-Batten:

Vertical Board

Foundation Pier: Brick

Porch Verandah

Windows Unknown

Chimney Gable End, Exterior: Brick

Additional Notes 2 chimneys originally

Historic rear additions Verandah walled on right side while left is open

Field ID: PR-27 GNAHRGIS ID: 252744 County: Pierce

County: Preliminary NR

Assessment: Does not meet



3641 Riley Road

Coordinates: 31.37888, -82.34217





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1930

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Prism Synthetics: Vinyl

Siding

Foundation Unknown

Porch Verandah

Windows Double Hung Sash: 1/1

Chimney Gable End Exterior,

Lateral Exterior: Brick

Additional Notes Large light to entry door

Large addition in rear Multiple material replacements

Field ID: PR-28 GNAHRGIS ID: 252746 County: Pierce

County: Preliminary NR

Assessment: Does not meet



Corner of Big House Rd & Little Hurricane Creek Rd

Coordinates: 31.37626, -82.38131





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1930

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style Elements: Craftsman

Roof Gable: Front

Exterior Cladding Prism Synthetics:

Asbestos Siding

Foundation Continuous: Concrete

Porch Recessed, Verandah

Windows Double Hung Sash: 3/1

Chimney Off-ctr in Roof Surf: Brick

Additional Notes Screened porch addition

Paired double hung sash Craftsman windows Rectangular vent

Field ID: PR-29 GNAHRGIS ID: 252749 County: Pierce

County: Preliminary NR

Assessment: Does not meet



3549 Little Hurrican Creek Road

Coordinates: 31.37879, -82.39373





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1930

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Weatherboard

Foundation Pier: Brick

Porch Verandah

Windows Double Hung Sash: 1/1

Chimney No Chimney Observed

Additional Notes Paired double hung sash

windows

Replacement materials
Obscured by vegetation

Field ID: PR-30 GNAHRGIS ID: 252758 County: Pierce

County: Preliminary NR

Assessment: Does not meet



1601 Evans Road

Coordinates: 31.47419, -82.27365



Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1900

Building Type Gabled Ell Cottage

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Cross

Exterior Cladding Wood: Weatherboard,

Drop Siding: Shingles

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 2/2

Chimney No Chimney Observed

Additional Notes Sawtooth shingles in gable

Decorative porch supports Exposed rafter tails Multiple rear additions

Field ID: PR-31
GNAHRGIS ID: 252781
County: Pierce

County: Preliminary NR

Assessment: May Meet



1605 Mershon Road

Coordinates: 31.46788, -82.25294



Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1900

Building Type Unknown

Structural System Balloon Frame

Style No Academic Style

Roof Complex

Exterior Cladding Wood: Weatherboard,

Drop Siding: Shingles

Foundation Pier: Concrete

Porch Wrap-Around

Windows Double Hung Sash: 12/12

Chimney No Chimney Observed

Additional Notes Sawtooth shingles in gable

Bay window on side Corbelled chimney Unusual type for Georgia


Field ID: PR-32 **GNAHRGIS ID:** 252782 **County:** Pierce **Preliminary NR**

Assessment: May Meet



N Horseshoe Rd between Dogwood Rd & Boyette Rd

Coordinates: 31.45764, -82.27402

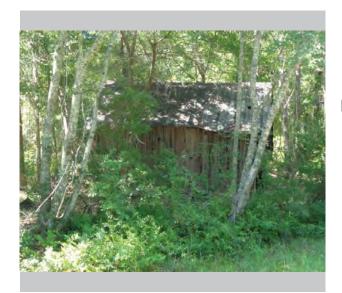



Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920-1929

Building Type Single Pen: Rectangle

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Vertical Board

Foundation Unknown

Porch Verandah

Windows Unknown

Chimney Gable-End: Exterior

Additional Notes One room building which

was home to African American farm workers. Back of house facing road.


Field ID: **PR-33 GNAHRGIS ID: 252783** County: Preliminary NR Pierce

Assessment: Appears to Meet



Dogwood Road, center of North Horseshoe Road

Coordinates: 31.45854, -82.26893

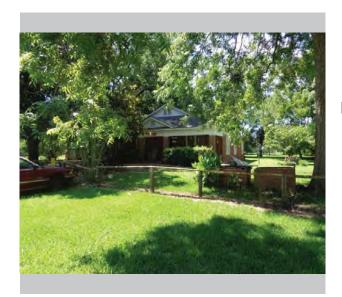



Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1925

Building Type Bungalow: Hip

Structural System Balloon Frame

Style Craftsman

Roof Gable: Front

Exterior Cladding Brick: Veneer

Foundation Unknown

Porch Recessed

Windows Double Hung Sash: 3/1

Rectangular

Chimney Off-center Within Roof:

Ridgeline

Additional Notes Craftsman style windows

(paired).

Two front doors.

Field ID: PR-34
GNAHRGIS ID: 252784
County: Pierce

County: Preliminary NR

Assessment: May Meet



Corner of Dogwood Rd and W. Horseshoe Rd

Coordinates: 31.45848, -82.26906





Resource Type Building

Resource Use Vacant

Date of Construction 1900

Building Type Single Pen: Rectangle

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Vertical Board

Foundation Unknown

Porch Verandah

Windows Unknown

Chimney No Chimney Observed

Additional Notes Property used to be home of African American tenant farmers. Double

front door, vertical board.

Field ID: PR-35 GNAHRGIS ID: 252785 County: Pierce

County: Preliminary NR

Assessment: May Meet



Corner of Dogwood Rd & W. Horseshoe Rd

Coordinates: 31.45858, -82.26824





Resource Type Site

Resource Use Vacant

Date of Construction 1910-1920

Building Type Unknown

Structural System Balloon Frame

Style No Academic Style

Roof Unknown

Exterior Cladding Wood: Weatherboard

Foundation Unknown

Porch None

Windows Unknown

Chimney Unknown

Additional Notes General store associated with African American

with African American tenant farmers. Includes two barns and one shed.

Field ID: PR-36 GNAHRGIS ID: 252757 County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Walkermill Road

Coordinates: 31.40605, -82.25749





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1935

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Synthetic: Vinyl Siding

Foundation Unknown

Porch Verandah

Windows Double Hung Sash: 1/1 &

6/6, Square

Chimney No Chimney

Additional Notes On same property with

PR-47 (ID: 252808). Paired windows on facades.

Field ID: PR-37 GNAHRGIS ID: 252759 County: Pierce

County: Preliminary NR

Assessment: May Meet



3007 Taylor Farm Road

Coordinates: 31.40179, -82.25532





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1910

Building Type Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Pier: Concrete Block

Porch Verandah

Windows Double Hung Sash: 4/4,

6/6, 6/4, 9/6, Rectangular

Chimney No Chimney Observed

Additional Notes Appears to have addition

in back. Historic L shape (1920-1930). Outbuildings

raised or moved.

Field ID: PR-38
GNAHRGIS ID: 252760
County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Davis House North end of Country Lane

Coordinates: 31.38989, -82.25878





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920-1929

Building Type Unknown

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Wood: Weatherboard

Foundation Pier with Infill:Brick

Porch Verandah

Windows Double Hung Sash: 6/6,

Rectangular

Chimney No Chimney Observed

Additional Notes Moved 19 years ago from

"downtown". Addition added vinyl, porch rebuilt. Sidelights on front door.

Field ID: PR-39
GNAHRGIS ID: 252761
County: Pierce

County: Preliminary NR

Assessment: May Meet



Ramah Rd, 3 miles from Ramah Church & Bennet Rd

Coordinates:





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920

Building Type Extended Hall Parlor

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Vertical Board

Foundation Pier with Infill:Brick

Porch Verandah

Windows Double Hung Sash: 4/4,

Square & Rectangular

Chimney No Chimney Observed

Additional Notes Porch "screened in" and

appears to be later addition. Rear gable

addition.

Field ID: PR-40 GNAHRGIS ID: 252762 County: Pierce

County: Preliminary NR

Assessment: May Meet



Bennet Drive off of Dogwood Drive

Coordinates: 31.42221, -82.27309





Resource Type Building

Resource Use Vacant

Date of Construction ca. 1900

Building Type Central Hallway

Structural System Clankwall Framing

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Vertical Board

Foundation Pier with Infill:Brick

Porch Verandah

Windows Unknown

Chimney No Chimney Observed

Additional Notes One doorway without

door. Windows covered/missing glass. Historic rearshed addition.

Field ID: PR-41 **GNAHRGIS ID: 252763** County: Preliminary NR Pierce

Assessment: Does Not Meet



2617 E. Lawton Road

Coordinates: 31.43616, -82.29011





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction ca. 1965

Building Type Ranch

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Brick: Veneer

Foundation Pier with Infill:Brick

Porch Verandah

Windows Fixed: 1/1, Rect. Unknown:

1/1, Rect.

Chimney Gable-End, Interior

Additional Notes Carport with three walled

sides. Fanlight on door. Large side gable addition. Window replacements.

Field ID: PR-42 GNAHRGIS ID: 252773 County: Pierce


County: Preliminary NR

Assessment: May Meet



1633 Caney Creek Road

Coordinates: 31.42191, -82.33645

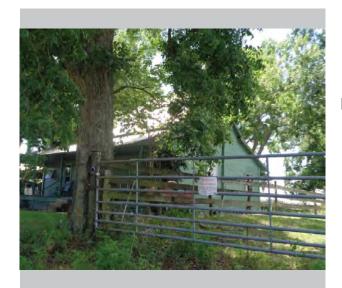



Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1910

Building Type Gabled Ell Cottage

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Synthetic: Masonite

Foundation Continuous: Concrete

Porch Verandah

Windows Double Hung Sash: 6/6,

4/4, Rect. 1 pane, Jalousie.

Chimney Off-center: Ridgeline

Additional Notes Front door has 2 windows

on either side, jalouise on far end. Small protruding gable on left front porch.

Field ID: **PR-43 GNAHRGIS ID: 252775** County: Preliminary NR Pierce

Assessment: Appears to Meet



Intersection of Waters Rd and Thrift Rd

Coordinates:





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1915

Building Type N/A - See Notes

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Complex

Exterior Cladding Wood: Weatherboard

Foundation Pier with Infill:Brick

Porch Verandah

Windows Double Hung Sash: 2/2,

Rect.

Chimney No Chimney Observed

Additional Notes Seems to be local variant.

Hip on gable. Sawtooth shingles in gable. Spindlework columns.

Field ID: PR-44
GNAHRGIS ID: 252778
County: Pierce

County: Preliminary NR

Assessment: May Meet



Henderson Cemetery Off HWY 203, 1/4 mile on unnamed road.

Coordinates: 31.40394, -82.32708



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1822

Common Names Henderson Cemetery

≈ Number of Burials 50

Oldest Burial 1822

Burial Description CSA, Free Masons



Cemetery Description Gated Cemetery.

Gated Cemetery.

1822; includes CSA and
Free Masons.

Around 50 total graves,
many of which are
unmarked or marked only
with wood markers.

Section of newer graves in
back.

Seashells and other relics.

Field ID: PR-45 **GNAHRGIS ID: 252786 County: Preliminary NR** Pierce

Assessment: Does Not Meet



4208 Old Alma Road

Coordinates: 31.367942, -82.319521



Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1970

Building Type Ranch

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Brick: Veneer

Foundation Unknown

Porch Recessed

Windows Double Hung Sash: 4/4,

6/6, 8/8, Rect.

Chimney Off-center: Ridgeline

Additional Notes "Y" shaped ranch. Wood on gable ends with curved detail over windows. Multiple additions.

Field ID: PR-46 **GNAHRGIS ID:** 252787 Pierce

County: Preliminary NR

Assessment: May Meet



Sweat Cemetery MeadowWood Loop, between Alicia Rd & HWY 203

Coordinates: 31.36783, -82.29082



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1860

Common Names Sweat

≈ Number of Burials 25-30

Oldest Burial 1860

Burial Description N/A



Cemetery Description Earliest observed: 1860's. Mostly late 1800's and early 1900's. Random plots, no pattern or grid. Fenced with wood posts and wire. Lots of stones without names, around 25-30 graves. Sweat family.

Field ID: PR-47 GNAHRGIS ID: 252808 County: Pierce


County: Preliminary NR

Assessment: May Meet



Walkermill Road (Beside PR-36/ID: 252757)

Coordinates: 31.406563, -82.256869

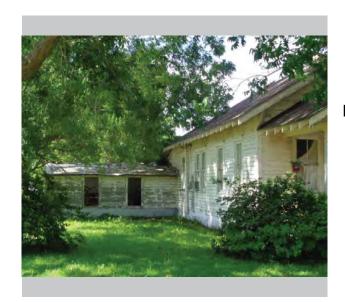



Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Weatherboard

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 2/2,

Rectangular

Chimney No Chimney Observed

Additional Notes Built in 1800's, burnt down and rebuilt in 1920's. Off

center front door, large

roof overhang.

Field ID: **PR-48 GNAHRGIS ID:** 252810 **County: Preliminary NR** Pierce

Assessment: Does Not Meet



Near intersection of Jeff Dixon Rd & Alvin Walker Rd

Coordinates: 31.350025, -82.27246





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920

Building Type Unknown

Structural System Balloon Frame

Style No Academic Style

Roof Unknown

Exterior Cladding Synthetic: Vinyl

Foundation Pier: Concrete Block

Porch Verandah

Windows Double Hung Sash: 6/6,

Square

Chimney Lateral Exterior

Additional Notes Midcentury replacement

windows. Original house

type unknown.

Field ID: PR-49 GNAHRGIS ID: 252779 County: Pierce


County: Preliminary NR

Assessment: May Meet



The Dixon House Intersection between HWY 203 & Old Alma Rd

Coordinates:

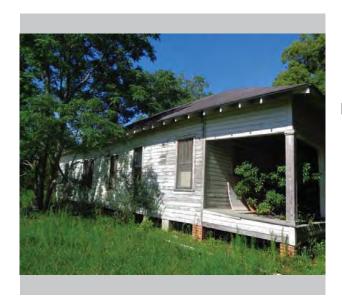



Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920

Building Type Georgian Cottage

Structural System Balloon Frame

Style Craftsman

Roof Hip

Exterior Cladding Wood: Weatherboard

Foundation Pier with Infill: Brick &

Concrete

Porch Verandah

Windows Double Hung Sash: 1/6,

4/1, 2/2, 1/2.

Chimney Off-center within roofline

surf. Lateral Exterior.

Additional Notes Some condition issues at

peak. Two chimneys. Overhanging eaves, screened porch on rear.

Field ID: PR-50 GNAHRGIS ID: 252812 County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Walkerville Rd near Intersection with Taylor Farm Rd

Coordinates: 31.350007, -82.270299



Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1930

Building Type Cross Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Cross

Exterior Cladding Wood: Weatherboard

Foundation Pier with Infill:Brick

Porch Verandah

Windows Double Hung Sash: 2/2,

Rect.

Chimney No Chimney Observed

Additional Notes Not an academic type.

Cross gabled house w/ integrated storage &

carport.

Field ID: PR-51 **GNAHRGIS ID:** 252780 Pierce

County: Preliminary NR

Assessment: May Meet



Airport Rd off Old Alma Rd

Coordinates: 31.36377, -82.30978





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1930

Building Type No Type

Structural System Balloon Frame

Style Craftsman

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Pier:Brick & Concrete

Porch Verandah

Windows Double Hung Sash: 2/2,

6/6. Rectangle.

Chimney Lateral Exterior: Brick

Additional Notes Originally multi-housing, possibly triplex or more. Both chimneys on one side. Craftsman elements.

Field ID: PR-52 **GNAHRGIS ID:** 252814 Pierce

County: Preliminary NR

Assessment: May Meet



1755 Mershon Road

Coordinates: 31.463766, -82.258135



Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1930

Building Type Ranch

Structural System Balloon Frame

Style No Academic style

Roof Gable:Side

Exterior Cladding Brick: Veneer

Foundation Continuous: Brick

Porch Recessed

Windows Double Hung Sash: 6/6,

Rect. Fixed: 1 pane, Rect.

Chimney Center: Brick

Additional Notes Fixed windows appear on garage as small portholes in grid pattern. Historic outbuilding on property.

Field ID: PR-53
GNAHRGIS ID: 252817
County: Pierce


County: Preliminary NR

Assessment: May Meet



4941 Tuten Lane

Coordinates: 31.318254, -82.271667

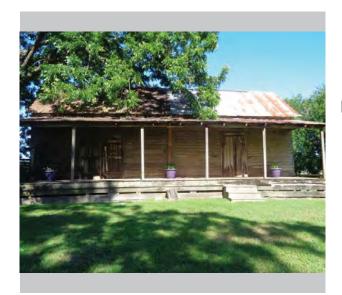



Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1900

Building Type Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Synthetic: Vinyl

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 4/4,

Rectangular.

Chimney Lateral Exterior: Brick

Additional Notes Outbuildings appear to

have been housing & barns, all historic. Side lights on front door.

Field ID: PR-54 GNAHRGIS ID: 252818 **County:** Pierce **Preliminary NR**


Assessment: Appears to Meet



Cherry Street Across from 3113

Coordinates: 31.29793, -82.26514



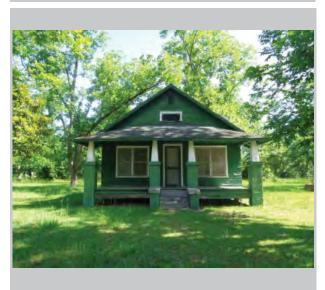

Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1925

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style Craftsman

Roof Gable: Front

Exterior Cladding Wood: Weatherboard

Foundation Pier:Brick & Concrete

Porch Verandah

Windows Double Hung Sash: 2/2,

1/1, Rect. Fixed: 1 pane.

Chimney Lateral Exterior: Brick

Additional Notes Short, squat battered piers

on porch. Fixed single pane window in front gable. Concrete steps.

Field ID: PR-55 GNAHRGIS ID: 252805 County: Pierce

County: Preliminary NR

Assessment: May Meet



Hebron Temple of Blackshear 5107 Willows Lane

Coordinates: 31.29834, -82.26144





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1950

Building Type Front Gable Church

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Synthetic: Aluminum

Foundation Pier with Infill: Concrete

Porch Stoop

Windows Double Hung Sash: 6/6,

Rectangle.

Chimney No Chimney Observed

Additional Notes Wood cross decoration on side with concrete steps to

front door. 2 front gables.

Field ID: PR-56 GNAHRGIS ID: 252807 County: Pierce

County: Preliminary NR

Assessment: Appears to Meet



On Piney Grove Road off Ware Street

Coordinates: 31.30109, -82.26348





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1965

Building Type Ranch

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Brick: Veneer

Foundation Continuous: Brick

Porch Verandah

Windows Double Hung Sash: 6/6,

Rectangular.

Chimney Lateral Exterior: Brick

Additional Notes Hip on gable roof.

Polychromatic brick. Large square chimney which tapers out at top.

Field ID: PR-57 **GNAHRGIS ID: 252809 County: Preliminary NR** Pierce

Assessment: Appears to Meet



2835 Piney Grove Road

Coordinates: 31.301982, -82.268534





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style Craftsman

Roof Gable: Front

Exterior Cladding Wood: Weatherboard

Foundation Pier: Brick & Concrete

Porch Verandah

Windows Double Hung Sash: 4/1,

Rect.

Chimney Off Center Within

Roof-Surf: Brick

Additional Notes Porch foundation is

continuous concrete, main

house is brick pier. Exposed rafter tails.

Field ID: PR-58
GNAHRGIS ID: 252819
County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



6058 Homestead Road

Coordinates: 31.27309, -82.27812





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1970

Building Type Ranch

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Brick: Veneer

Foundation Continuous: Brick

Porch Recessed

Windows Double Hung Sash: 1/1,

Rectangular

Chimney No chimney observed

Additional Notes Tripartite windows. Long

linear ranch. Vinyl on gables. Metalwork detail on porch, railing & carport.

Field ID: PR-59
GNAHRGIS ID: 252821
County: Pierce

County: Preliminary NR

Assessment: May Meet



2270 HWY 84

Coordinates: 31.26861, -82.28512





Resource Type Building

Resource Use Commercial: single retail

Date of Construction 1930

Building Type No Known Type

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Concrete: Concrete Block

Foundation Continuous: Concrete

Block

Porch None

Windows Fixed: 1 pane, Square

Chimney No Chimney Observed

Additional Notes Parapet pattern on front

gable (obscuring gable). Garage doors on rear. False front, new windows.

Field ID: PR-60 GNAHRGIS ID: 252824 County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



6381 Riverwood Drive

Coordinates: 31.25834, -82.34396





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1985

Building Type Ranch

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Wood: Weatherboard &

Vertical Board

Foundation Unknown

Porch Portico in front. Wrap

Around in back.

Windows Double Hung Sash: 1/1,

Rectangular.

Chimney No Chimney Observed

Additional Notes Rusticated ranch made to

look historic.

Field ID: PR-61
GNAHRGIS ID: 252880
County: Pierce

County: Preliminary NR

Assessment: May Meet



1484 Peacock Dairy Road

Coordinates: 31.36921, -82.34438





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1890

Building Type Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Clapboard

Foundation Pier:Brick

Porch Verandah

Windows Flat: 2/2. Rectangle.

Chimney Both Gable Ends: Brick

Additional Notes Fish scale shingles. 5 bays across. Central bay = front door. Decorative wood

supports on front porch.

Field ID: PR-62 GNAHRGIS ID: 252881 County: Pierce

County: Preliminary NR

Assessment: Appears to Meet



NE Corner of Jacks Road and Peacock Dairy Road

Coordinates: 31.36834, -82.32581





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1910

Building Type Unknown

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Pier:Brick

Porch Verandah

Windows Double Hung Sash: ?/3.

Rectangle.

Chimney Center: Brick

Additional Notes Side gabled I structure;

protruding center pavillion with 5 windows - 9/9. 4

front doors.

Field ID: **PR-63 GNAHRGIS ID: 252883 County: Preliminary NR** Pierce


Assessment: Appears to Meet



SE corner of Meadow Wood Rd & Big House Rd

Coordinates: 31.32468, -82.30113



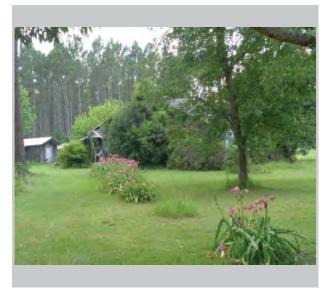

Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Drop Siding: Shingles

Foundation Unknown

Porch Portico

Windows Double Hung Sash: 2/2,

6/6. Rectangle.

Chimney Gable End Exterior & Off

CTR With Roof Surf: Brick

Additional Notes 2 front doors with front

gables on front. Exposed rafters. Front is covered by vegetation. Side 2 bays.

Field ID: PR-64
GNAHRGIS ID: 252885
County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



2105 Carson Road

Coordinates: 31.31435, -82.32484





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1915

Building Type Extended Hall Parlor

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Unknown

Porch Verandah

Windows Double Hung Sash: 2/2.

Rectangle.

Chimney Gable End Exterior: Brick

Additional Notes L shaped, 5 bays across

with furthest right bay being door. Right side possible addition.

Field ID: **PR-65 GNAHRGIS ID: 252879 County: Preliminary NR** Pierce

Assessment: Appears to Meet



North of Rosebud Drive & Carson Road

Coordinates: 31.31342, -82.34685





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 193

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Weatherboard

Foundation Unknown

Porch Portico

Windows Double Hung Sash: 6/6.

Rectangle.

Chimney Lateral Exterior: Brick x2

Off CTR With Rood Surf

Additional Notes Clipped gable on front.

Brick porch steps. Front door at center flanked by pair of DHS 6/6 both sides.

Pierce County CE+DISTORIC Resource

Field ID: PR-66
GNAHRGIS ID: 252882
County: Pierce

County: Preliminary NR

Assessment: May Meet



Ware St EXT. 200 yards west of Bowen Rd Int.

Coordinates: 31.297018, -82.294502





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1930

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Weatherboard

Foundation Unknown

Porch Verandah

Windows Double Hung Sash: 6/6.

Rectangle.

Chimney No Chimney Observed

Additional Notes Front gable bungalow with

porch addition/extension on left. New windows, 6/6. New wood porch supports.

Field ID: PR-67 **GNAHRGIS ID:** 252884 Pierce

County: Preliminary NR

Assessment: May Meet



1816 Donald James Road

Coordinates: 31.28262, -82.32794





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1960

Building Type Ranch

Structural System Balloon Frame

Style No Academic Styl

Roof Gable:Side

Exterior Cladding Brick: Veneer

Foundation Pier:Brick

Porch Verandah

Windows Double Hung Sash: 3/1.

Rectangle.

Chimney No Chimney Observed

Additional Notes Linear ranch, 3 bays across. Left bay 3/1 window. Central portico porch, metal supports.

Field ID: PR-68
GNAHRGIS ID: 252886
County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Stop-N-Save NW Corner of SR 38 and Hacklebarney Rd

Coordinates: 31.262099, -82.293686





Resource Type Building

Resource Use Commercial: Gas

Date of Construction 1965

Building Type Unknown

Structural System Balloon Frame

Style No Academic Style

Roof Flat

Exterior Cladding Synthetic: Stucco

Foundation Unknown

Porch Recessed

Windows Fixed: Single, Square

Chimney No Chimney Observed

Additional Notes Commercial gas station,

wood supports for roof overhang. Multiple material alterations.

Field ID: PR-69 **GNAHRGIS ID: 252887** County: Preliminary NR Pierce

Assessment: Appears to Meet



South of Int. Clifford Loop & Guest Rd.

Coordinates: 31.331248, -82.365590





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1910

Building Type Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Pier:Brick

Porch Verandah

Windows Double Hung Sash: 2/2,

6/6. Rectangle.

Chimney Gable Ends: Both sides

and rear. 3 chimneys.

Additional Notes Sidelights on front door.

Rectangular vent in gable. 3 chimneys, 3 bay facade. Detail on porch supports.

Field ID: PR-70 GNAHRGIS ID: 252889 County: Pierce

County: Preliminary NR

Assessment: May Meet



1525 Carson Road

Coordinates: 31.31353, -82.35233





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1930

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 2/2,

6/6. Rectangle.

Chimney Lateral Exterior: Brick, x2

Additional Notes Porch enclosed. Rafters

exposed. Two chimneys on right side. Possible addition to rear.

Field ID: PR-71 GNAHRGIS ID: 252892 County: Pierce

County: Preliminary NR

Assessment: May Meet



5609 Maxine Drive

Coordinates: 31.29151, -82.34602





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1910

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style Craftsman

Roof Hip

Exterior Cladding Wood: Weatherboard

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 1/1.

Rectangle.

Chimney No Chimney Observed

Additional Notes Asymmetrical Bungalow. 3

bays: both end bays with paired windows. Addition

in rear.

Field ID: PR-72 GNAHRGIS ID: 252895 County: Pierce

County: Preliminary NR

Assessment: May Meet



6780 Willie Bowen Road

Coordinates: 31.243417, -82.264167





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1890

Building Type I-House: Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Pier:Brick & Concrete

Porch Verandah

Windows Double Hung Sash: 2/2.

Rectangle.

Chimney Gable End Exterior: Brick

Additional Notes Sidelights on front door.

Replacement windows.
Multiple additions to back.
Different materials used.

Field ID: **PR-73 GNAHRGIS ID: 252899** County: Preliminary NR Pierce

Assessment: Does Not Meet



Grady Street between Twin Lake Rd & Pond View Ln

Coordinates: 31.340557, -82.248893





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920

Building Type Unknown

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Synthetic: Asbestos Siding

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 2/2.

Rectangle.

Chimney Both Gable Ends: Brick

Additional Notes Possibly multi-family

housing originally. 3 pane window on door. Addition on right side gable.

Field ID: PR-74
GNAHRGIS ID: 252905
County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Shiloh Cemetery End of Shiloh Rd

Coordinates: 31.325336, -82.224743





Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1849

Common Names Dixon, Youman, Davis,

Carter, Strickland

≈ Number of Burials 300

Oldest Burial 1849

Burial Description CSA, WWII, Masons, WWI,

Korea, Rev War, Vietnam,

"Elder".

Cemetery Description Predominantly older

graves (1849-1940's), but there are newer graves along the edges. Active use. Not facing same way.

Field ID: PR-75 GNAHRGIS ID: 252906 County: Pierce

County: Preliminary NR

Assessment: May Meet



Shiloh Church End of Shiloh Road

Coordinates: 31.324921, -82.225168





Resource Type Building

Resource Use Church

Date of Construction 1940

Building Type Single Pen: Church

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Vertical Board

Foundation Pier: Wood & Wood Log

Porch Stoop

Windows Unknown: Shuttered

Chimney No Chimney Observed

Additional Notes Restroom outbuilding.

Exposed rafters. Rear door with ramp. Log pier and plank foundation.

Field ID: PR-76 **GNAHRGIS ID:** 252907 Pierce

County: Preliminary NR

Assessment: Does Not Meet



Strickland Cemetery On Aaron's Way, east of Jenkins Lane

Coordinates: 31.35411, -82.15855



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1861

Common Names Strickland, Lee, Dixon

≈ Number of Burials 75

Oldest Burial 1861

Burial Description CSA, WWII, WWI



Cemetery Description Active Use. Largely random plots, but all facing the same direction. Mixed old and new, predominantly old. 1861 earliest observed date, majority below 1930. Surrounded by fencing and timber rows.

Field ID: PR-77 **GNAHRGIS ID: 252919** Pierce

County: Preliminary NR

Assessment: May Meet



Owens Rd, 130 yards east of Howard Rd

Coordinates: 31.32938, -82.13812





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style Craftsman

Roof Gable: Front

Exterior Cladding Synthetic: Asbestos Siding

Foundation Pier:Brick

Porch Verandah

Windows Double Hung Sash: 2/2.

Rectangle.

Chimney Lateral Exterior: Brick

Additional Notes Rear addition (vinyl). Rect. vent in front gable. Ceiling fans on porch. 3 pecan, 1 magnolia, 3 cypress yard.

Field ID: PR-78 GNAHRGIS ID: 252922 Pierce

County: Preliminary NR

Assessment: May Meet



Smith Cemetery Brown Branch Rd, 250 yards from int. w/ Trudie Road

Coordinates: 31.30649, -82.17646



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1895

Common Names Smith, Sweat, Dixon

≈ Number of Burials 25

Oldest Burial 1895

Burial Description Family



Cemetery Description All family graves. Some footstones and headstones. Some rows/uniformity. On residential property next to house, well maintained. Not active use.

Field ID: PR-79
GNAHRGIS ID: 252924
County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Martha Memorial Cemetery Martha Memorial Loop, 80 yards from Harry Rd

Coordinates: 31.515577, -82.227166



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1895

Common Names Boatright, Dixon, Cosby

≈ Number of Burials 50

Oldest Burial 1898

Burial Description Family



Cemetery Description Active use. Outlined

family plots. Boatright, Dixon, Cosby names associated with it. 5 mid-sized obelisks. Non-contributing church.

Field ID: PR-80 GNAHRGIS ID: 252925 Pierce

County: Preliminary NR

Assessment: May Meet



Ivy Cemetery Murray Hill Rd, across from Chapel Drive

Coordinates: 31.279412, -82.244587



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction Unknown

Common Names Unknown (Nun)

≈ Number of Burials Unknown

Oldest Burial Unknown

Burial Description Slave Cemetery



Cemetery Description Slave cemetery owned by the Nun family (separate cemetery) at one point. Headstones were removed and destroyed by timber company, now only mounds remain.

Field ID: PR-81
GNAHRGIS ID: 252929
County: Pierce

County: Preliminary NR

Assessment: Appears to Meet



Willie Brown Rd, east of Youmans Chapel Rd

Coordinates: 31.24085, -82.25282





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1910

Building Type I House

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Unknown

Porch Verandah

Windows Unknown

Chimney Gable End Exterior: Brick

Additional Notes 5 bays on facade, central doorway framed by 2 windows on each side.

Historic rear addition.

Field ID: PR-82
GNAHRGIS ID: 252931
County: Pierce

County: Pierce **Preliminary NR**

Assessment: May Meet



Enon Church: Old Schlatterville Road, between St. Johns Church Road and Avant Road

Coordinates: 31.24147, -82.22639





Resource Type Site

Resource Use Religious: Structure,

Funerary: Cemetery

Date of Construction ca. 1940

Building Type Single Pen: Rectangle

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Board-and-Batten:

Vertical Board

Foundation Pier with Infill: Wood

Porch Stoop

Windows Unknown

Chimney No Chimney Observed

Additional Notes Plank shutters with "Z"

Central doorway Exposed rafters Active use cemetery

Field ID: PR-83 GNAHRGIS ID: 252932 County: Pierce

County: Preliminary NR

Assessment: May Meet



5114 Riggins Road

Coordinates: 31.25783, -82.17780





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1940

Building Type Bungalow: Side Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Weatherboard

Foundation Continuous: Wood

Porch Verandah

Windows Double Hung Sash: 8/4,

Rectangle

Chimney No Chimney Observed

Additional Notes Window replacements

Rear addition
Decorative fencing
Metalwork gate

Field ID: PR-84
GNAHRGIS ID: 252935
County: Pierce

County: Preliminary NR

Assessment: May Meet



Clarke Road, 160 yards North of Intersection with Highway 15

Coordinates: 31.25783, -82.17780





Resource Type Building

Resource Use Religious: Church

Date of Construction ca. 1910

Building Type Single Pen: Rectangle

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Weatherboard

Foundation Pier: Concrete

Porch Verandah

Windows Unknown

Chimney No Chimney Observed

Additional Notes Replacement materials, multiple additions

Decorative porch supports

Exposed rafters

Field ID: PR-85 GNAHRGIS ID: 252927 County: Pierce

County: Preliminary NR

Assessment: May Meet



Brown's Cemetery on Danny Road, 50 yards from Molly Branch Road

Coordinates: 31.27504, -82.21363



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction ca. 1884

Common Names Brown, Baxter, Dixon

≈ Number of Burials 15-20

Oldest Burial 1884

Burial Description N/A



Cemetery Description Not in use

Upright stones, footstones Some decorative markers Poor condition, some markers fallen and broken Some rows

Taped off

Pierce County CE+D SHISTORIC Resource

Field ID: PR-86 GNAHRGIS ID: 252930 County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Winn, Thomas Cemetery dead end of Thomas Cemetery Road

Coordinates: 31.26375, -82.17523



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction ca. 1859

Common Names Dixon

≈ Number of Burials Unknown

Oldest Burial 1859

Burial Description WW1



Cemetery Description Active use

Active use Level field su

Level field surrounded by

forest

Chain link fence Maintained Two shade trees

Mostly upright, granite

stones

2 brick outlined plots

Field ID: PR-87 GNAHRGIS ID: 252933 County: Pierce

County: Preliminary NR

Assessment: May Meet



on Laura Chapel Road, .5 mile North of Trudie Road intersection

Coordinates: 31.32093, -82.11967





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1900

Building Type Hall-Parlor

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Side

Exterior Cladding Weatherboard, Vertical

Board

Foundation Continuous: Concrete

Porch Verandah

Windows Double Hung Sash: 2/2,

6/6, Rectangle

Chimney Gable-End Exterior:

Brick

Additional Notes Rear addition

Some windows boarded

Exposed rafters

Vertical board on front

Field ID: PR-88
GNAHRGIS ID: 252934
County: Pierce


County: Preliminary NR

Assessment: Does Not Meet



6386 Cross Swamp Road

Coordinates: 31.33112, -82.10719

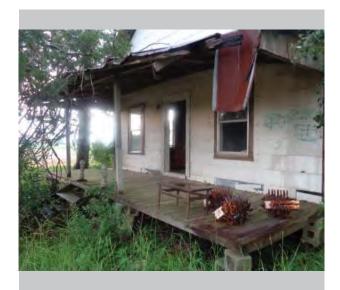



Resource Type Building

Resource Use Vacant

Date of Construction ca. 1930

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Prism Synthetics:

Masonite Siding

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 1/1,

Rectangle

Chimney Lateral Exterior: Brick

Additional Notes Exposed rafters

Rear addition

Replacement windows

Poor condition

Field ID: PR-89 **GNAHRGIS ID: 25288 County: Preliminary NR** Pierce

Assessment: Does Not Meet



815 Trudie Road

Coordinates: 31.30129, -82.01693



Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1910

Building Type Gabled Ell Cottage

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Wood: Weatherboard

Foundation Pier: Wood

Porch Veranadah

Windows Double Hung Sash: 6/6,

Rectangle

Chimney 3 Gable-End Exterior: Brick

Additional Notes Multiple additions and

material replacements Corbelled chimney Sidelights at main entry

Field ID: **PR-90 GNAHRGIS ID:** 252891 Pierce

County: Preliminary NR

Assessment: Does Not Meet



New Prospect Cemetery on Raulerson Rd, .5 mile North from Cross Swamp Rd

Coordinates: 31.31526, -82.01039



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction ca. 1828

Common Names Raulerson, Roberson,

Manning, Pearson

≈ Number of Burials 150

Oldest Burial 1828

Burial Description CSA, Confederate POW,

Pioneer Settler



Cemetery Description Active Use

Some replaced markers Upright, flat, foot stones Chain link fence surrounds Newly constructed brick

shelter

1 large shade tree, several

shrubs

Enclosed family plots

1 mausoleum

Field ID: PR-91 GNAHRGIS ID: 252896 County: Pierce


County: Preliminary NR

Assessment: May Meet



6231 Ralston Road

Coordinates: 31.36002, -82.10839

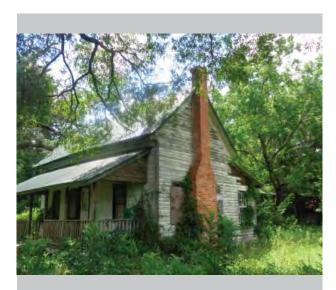



Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1910

Building Type Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Cross

Exterior Cladding Wood: Weatherboard

Foundation Pier with Infill: Brick

Porch Verandah

Windows Double Hung Sash: 4/4,

Rectangle

Chimney Both Gable Ends: Brick

Additional Notes Large rear addition

Some windows boarded,

replaced

Wood porch supports

Field ID: PR-92 GNAHRGIS ID: 252897 County: Pierce

County: Preliminary NR

Assessment: May Meet



6513 Claude Road

Coordinates: 31.417647, -82.094272





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1945

Building Type Bungalow: Cross Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Multi

Exterior Cladding Wood: Weatherboard

Foundation Pier: Concrete

Porch Verandah

Windows Flat: 2/2. Rectangle.

Chimney Gable End Exterior: Brick

Additional Notes Addition in rear.

Replacement windows. Replacement materials on exterior. 3 pane door.

Field ID: PR-93 GNAHRGIS ID: 252902 Pierce

County: Preliminary NR

Assessment: May Meet



7326 Scenic Drive

Coordinates: 31.431814, -82.090748





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1975

Building Type Ranch

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Brick: Veneer

Foundation Continuous: Brick

Porch Recessed

Windows Double Hung Sash & Flat:

2/2, 6/6. Rectangle & SQ

Chimney No Chimney Observed

Additional Notes Polychromatic brick.

Decorative shutters. Linear ranch. Walled in carport, landscaped.

Field ID: PR-94 **GNAHRGIS ID:** 252903 **County:** Pierce **Preliminary NR**

Assessment: May Meet



Scenid Drive between Stage Coach Dr & HWY 82

Coordinates: 31.434443, -82.095992





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920

Building Type Unknown

Structural System Balloon Frame

Style Craftsman

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 2/2.

Rectangle.

Chimney No Chimney Observed

Additional Notes Brick piers with wood

decoration. Mid century awning on porch. Shallow

rood, rear addition.

Field ID: PR-95 GNAHRGIS ID: 252910 County: Pierce

County: Preliminary NR

Assessment: May Meet



Intersection of Chris Tyre Rd & Shellie Trail (West)

Coordinates: 31.445291, -82.104639





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1900

Building Type Central Hallway

Structural System Balloon Frame

Style No Academic Style

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Pier: Concrete

Porch Verandah

Windows Double Hung Sash: 6/6.

Rectangle.

Chimney No Chimney Observed

Additional Notes Sidelights, 3 panes each.

Fallen chimney on left and right side. 3bay central door w/ windows on side.

Field ID: PR-96
GNAHRGIS ID: 252914
County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Clay Hill Cemetery End of Foster Cemetery Rd to the left

Coordinates: 31.470234, -82.115650



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction ca. 1878

Common Names Thornton, Chancy, Tyre

≈ Number of Burials 100

Oldest Burial 1878

Burial Description CSA, WWI, Woodsmen of

the World, Family plots.



Cemetery Description Active Use. On hill

Active Use. On hill surrounded by natural forest. Maintained, somewhat. Some trees, shrubs. Some upright headstones, some flat, and mostly facing same direction in rows. Newer graves at upper left of field. 1 unmarked slab.

Field ID: PR-97 **GNAHRGIS ID: 252916 County: Preliminary NR** Pierce

Assessment: Does Not Meet



World Wide Deliverance Church Mill Creek Road, 200 yards South of Chancey Road

Coordinates: 31.45264, -82.13329





Resource Type Building

Resource Use Religious: Church

Date of Construction ca. 1930

Building Type Front Gable Church

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Prism Synthetics: Vinyl

Siding

Foundation Continuous: Brick

Porch Portico, Recessed

Windows Double Hung Sash: 2/2,

Rectangle

Chimney Off-Center Ridgeline:

Brick (2)

Additional Notes Pentagonal praying hands

decoration in porch gable Brackets, exposed rafters

Altered ca. 1960

Field ID: PR-98
GNAHRGIS ID: 252917
County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Mill Creek Church Cemetery SW of Lynch Road and Mill Creek Road Intersection

Coordinates: 31.45056, -82.13833



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction ca. 1899

Common Names Davis, Aspinwall, Dixon

≈ Number of Burials Unknown

Oldest Burial 1899

Burial Description CSA



Cemetery Description Active use

Active use
Non-contributing church
Planned rows
Field surrounded by forest
Maintained
Outlined family plots
Upright and flat markers
Granite, brick, metal
Some replaced, broken

Field ID: **PR-99 GNAHRGIS ID: 252936 County: Preliminary NR** Pierce

Assessment: Does Not Meet



7683 Highway 82

Coordinates: 31.42143, -82.09882





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1930

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Prism Synthetics: Vinyl

Siding

Foundation Pier: Brick

Porch Verandah

Windows Double Hung Sash: 2/2,

Rectangle

Chimney No Chimney Observed

Additional Notes Exposed rafters

Brick porch piers Sidelights around door

Replacement materials

Field ID: PR-100 GNAHRGIS ID: 252920 County: Pierce

County: Preliminary NR

Assessment: May Meet



on Russell Road, 200 yards South of Crump Road

Coordinates: 31.50502, -82.22538





Resource Type Building

Resource Use Domestic: Single Dwelling

Date of Construction ca. 1900

Building Type Double Pen

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Side

Exterior Cladding Wood: Clapboard

Foundation Unknown

Porch Verandah

Windows Double Hung Sash: 1/1,

Rectangle

Chimney Gable End Exterior: Brick

Additional Notes Obscured by vegetation

Facade altered Windows replaced,

missing

Field ID: PR-101 **GNAHRGIS ID:** 252986 Pierce

County: Preliminary NR

Assessment: May Meet



Gill Rd, 250 yds N of Creech Rd

Coordinates: 31.421980, -82.127377





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1900

Building Type Hall-parlor

Structural System Balloon Frame

Style Double Pen

Roof Gable:Side

Exterior Cladding Wood: Weatherboard

Foundation Pier: Wood & Concrete

Porch Verandah

Windows Double Hung Sash: 2/2,

4/4. Rectangle.

Chimney Lateral Exterior: Brick

Additional Notes 2 bay on front facade. 2 main entry doors. "Eagle's Nest" Restarant across street in outbuilding.

Field ID: PR-102 GNAHRGIS ID: 252987 County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Aspinwall Cemetery End of unnamed rd, 550 yds from Tyre Cemetery Rd

Coordinates: 31.464284, -82.147987



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1880

Common Names Aspinwall

≈ Number of Burials 30

Oldest Burial 1880

Burial Description Woodsmen of America



Cemetery Description Not active use.

Not active use.
Family cemetery.
Maintained.
Shrubs, shade trees.
Chain link fence
surrounding.
Some flat stones among
headstones.
Remnants of possible
arch/entryway.

Field ID: PR-103 **GNAHRGIS ID: 252991 County:** Pierce **Preliminary NR**

Assessment: May Meet



Old Tyre Cemetery End of Tyre Cemetery Road

Coordinates: 31.462003, -82.157552



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1878

Common Names Tyre

≈ Number of Burials 7

Oldest Burial 1878

Burial Description N/A



Cemetery Description Family cemetery, only 7 graves with only 2 labeled headstones. Headstones were given at a later date, i.e. newer stones, and the other five graves are unmarked concrete slabs. Somewhat maintained.

Field ID: PR-104
GNAHRGIS ID: 252993
County: Pierce

County: Preliminary NR

Assessment: May Meet



Corner of Hopewell Rd & Walkerville Rd Coordinates: 31.398781, -82.176529





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1920

Building Type Bungalow: Front Gable

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Front

Exterior Cladding Wood: Weatherboard

Foundation Pier:Brick

Porch Verandah

Windows Double Hung Sash: 6/1,

4/4. Rectangle.

Chimney No Chimney Observed

Additional Notes Corrugated sheet over

windows. Veg. obscures foundation. Rear door.

 ${\sf Exposed\ rafters}.$

Field ID: PR-105 GNAHRGIS ID: 252985 County: Pierce

County: Preliminary NR

Assessment: May Meet



Walkerville Rd, 550 yds E of Charlie Crump Rd

Coordinates: 31.406031, -82.194915





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1930

Building Type Bungalow: Hip

Structural System Balloon Frame

Style Craftsman

Roof Hip

Exterior Cladding Wood: Weatherboard

Foundation Pier: Concrete

Porch Portico

Windows Double Hung Sash: 2/2.

Rectangle.

Chimney Center: Brick

Additional Notes Some windows boarded.

Brick piers with battered wood columns. Central

doorway, 5 bays.

Field ID: PR-106 GNAHRGIS ID: 252984 Pierce

County: Preliminary NR

Assessment: Does Not Meet



Bird Cemetery Unmarked rd N of Honeysuckle Ln, .6 mi from 121.

Coordinates: 31.472240, -82.195794



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1881

Common Names Byrd, Moody

≈ Number of Burials 50

Oldest Burial 1881

Burial Description CSA, WW1



Cemetery Description Active use. Surrounded by chain link fence, located down unmarked grass road. 70%-75% "old" graves. Trinkets, shells, statues, ect left at graves. Brick piles/markers with no writing. Some outlined plots. Some broken headstones.

Field ID: PR-107 GNAHRGIS ID: 252983 County: Pierce

County: Preliminary NR

Assessment: May Meet



Tuten Drive, .5 miles East of Highway 121

Coordinates: 31.48505, -82.19426





Resource Type Building

Resource Use Residential: Single Family

Dwelling

Date of Construction 1910

Building Type Georgian Cottage

Structural System Balloon Frame

Style No Academic Style

Roof Gable-On-Hip

Exterior Cladding Wood: Weatherboard

Foundation Pier: Brick, Concrete Block

Porch Verandah

Windows Double Hung Sash: 6/6.

Rectangle.

Chimney Gable-End Interior: Brick

Additional Notes Replacement siding

Sawtooth shingles Corbelled chimney Collapsed rear porch

Field ID: PR-108
GNAHRGIS ID: 253016
County: Pierce

County: Preliminary NR


Assessment: May Meet



Sikes Cabinet Company NW corner of N Lightsey Ave and Stewart Drive

Coordinates: 31.48505, -82.19426



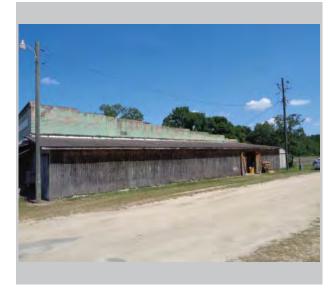

Resource Type Building

Resource Use Commercial: Retail

store/shop

Date of Construction 1940

Building Type Commercial: Single Retail

Structural System Brick Bearing

Style No Academic Style

Roof Unknown

Exterior Cladding Brick: Common Bond

Foundation Unknown

Porch No Porch

Windows Unknown

Chimney No Chimney Observed

Additional Notes Wooden additions on

front and right side
Original structure mostly

intact

Field ID: PR-109
GNAHRGIS ID: 253018
County: Pierce

County: Preliminary NR

Assessment: May Meet



Highway 15, 180 yards North of Old Boatright Rd

Coordinates: 31.45593, -82.214409





Resource Type Building

Resource Use Domestic: Single Family

Dwelling

Date of Construction 1900

Building Type Plantation Plain

Structural System Balloon Frame

Style No Academic Style

Roof Gable: Cross

Exterior Cladding Wood: Clapboard

Foundation Pier: Brick

Porch Verandah

Windows Double Hung Sash: 2/2.

Rectangular.

Chimney No Chimney Observed

Additional Notes Mostly original materials

Steeply pitched roof

Sidelights

Window in front gablet

Field ID: PR-111
GNAHRGIS ID: 253020
County: Pierce

County: Preliminary NR

Assessment: Does Not Meet



Pine Road, 360 yards East of Mershon Road

Coordinates: 31.47258, -82.24462



Resource Type Site

Resource Use Funerary: Cemetery

Date of Construction 1956

Common Names Kysler, Fuller

≈ Number of Burials 50

Oldest Burial 1956

Burial Description N/A




Cemetery Description Active use

Active use Spread out graves Not well maintained Granite ledger stones Outlined family plots Mostly new


Bibliography

- "Georgia Historic Resources Survey Manual," Atlanta: Georgia Department of Natural Resources, Historic Preservation Division, 2000.
- Georgia's Living Places: Historic Houses in their Landscaped Setting (1991), http://georgiashpo.org/sites/ uploads/hpd/pdf/NR15arch 20080521100904 optimized.pdf (accessed August 01, 2014).
- "How to Apply the National Register Criteria for Evaluation: National Register Bulletin 15," (Washington, D.C.: U.S. Government Printing Office, Department of the Interior, National Park Service, 1997.) http://www.nps.gov/nr/publications/bulletins/pdfs/nrb15.pdf
- Anderson Cordova, Karen and Burns, Leigh. Preservation Primer: A Resource Guide for Georgia. Atlanta: Georgia Department of Natural Resources, HPD, 2011.
- Ching, Frank. A Visual Dictionary of Architecture, New York: Van Nostrand Reinhold, 1995.
- Clouse, Richard. The Ranch House in Georgia: Guidelines for Evaluation Historic Preservation available at Http://issuu.com/georgiashpo/docs/ranch house guidelines?mode=window&background Color= %23222222 (Accessed August 12,2016).
- Derry, Anne, Jandal, H. Ward, Shull, Carol D., and Thorman, Jan. "Guidelines for Local Surveys: A Basis for Preservation Planning. National Register Bulletin 24," Washington, D.C: U.S. Government Printing Office, Department of the Interior, National Park Service, 1985.) http://www.nps.gov/nr/publications/bulletins/pdfs/nrb24.pdf
- Lambin, Jeanne. "Preserving Resources from the Recent Past," Washington, D.C.: National Trust for Historic Preservation, 2007
- Lenz, Richard J. "Sandersville. Museum of Washington County, The Brown House," The Civil War in Georgia: An Illustrated Travelers Guide, http://www.sherpaguides.com/georgia/civil war/mid ga east/sandersville area.html) accessed January 12, 2016).
- McAlaster, Virginia and Lee. A Field Guide to American Houses, New York: Alfred A, Knopf, Inc, 2003.


Residential Building Types in Georgia




Single story: One room deep by two wide with central hallway




Multi-story: One room deep by two wide with central hallway

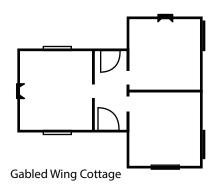


Single story: Asymmetrical massing with central hallway

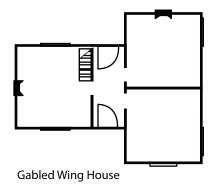


Multi-story: Asymmetrical massing with central hallway

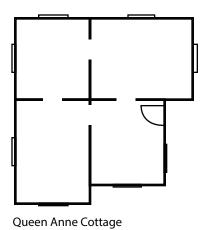


Single story: Asymmetrical massing with no central hallway

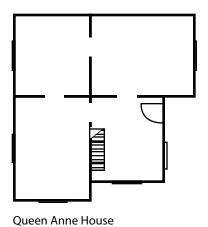

Multi-story: Asymmetrical massing with no central hallway

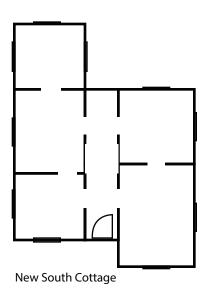


Single story: Asymmetrical massing with central hallway

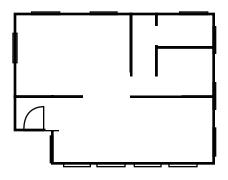


Single story: Irregular floor plans; one of four subtypes identified by a front gable roof shape

Bungalow (Front Gabled)

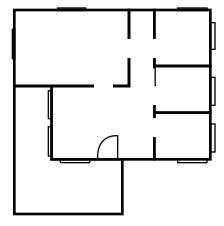

Single story: Irregular floor plans; one of four subtypes identified by a cross gable roof shape

Bungalow (Cross Gabled)

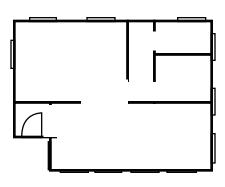


Single story: Irregular floor plans; one of four subtypes identified by a hipped roof shape


Bungalow (Hipped)




Single story: Irregular floor plans; one of four subtypes identified by a side gable roof shape

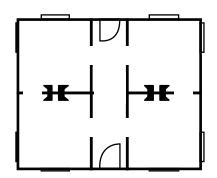


Georgian Cottage



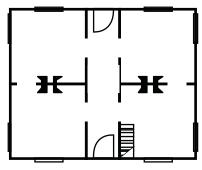


Georgian House

Multi-story: Two rooms deep by two rooms wide with central hallway

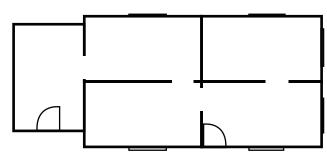


Side-Gabled Cottage

Single story: Tightly massed rooms with side projecting gables

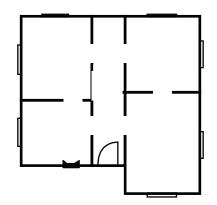


Single story: Irregular room placement with pronounced gable entry and chimney

English Cottage

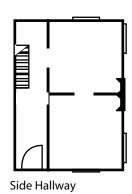

Multi-story: Two rooms deep by one wide with side hallway

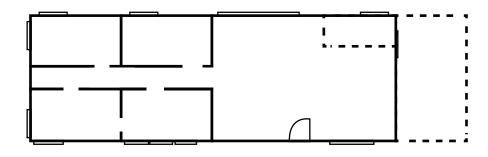

Single story: Multiple rooms wide by two rooms deep; few hallways with interior zoning

Ranch House

Architectural Styles in Georgia: An Overview

The architecture of a house, its overall form and ornamentation, is classified as a style. Style is the decoration or ornamentation that has been put on a house in a systematic pattern or arrangement. Style has long been an important tool for describing, analyzing, and evaluating historic buildings; a style often reflects the needs and tastes of a particular time and a place in which it appears. Styles used during a particular time and in a particular location may contribute to an understanding of the culture of that period.

































Adapted from *Georgia's Living Places: Historic Houses in the Landscaped Settings,* hpd/pdf/NR15arch 20080521100904 optimized.pdf.

(1991), http://georgiashpo.org/sites/uploads/

Folk Victorian 1870-1920

Folk Victorian houses were built across Georgia in very large numbers. They were simple house forms, or house types, with Victorian-era decorative detailing such as jigsaw woodworks including brackets, spindlework and gingerbread trim. This detailing generally was taken from the elaborate styles, such as Queen Anne or Italianate, that were popular during the mid to late 19th century. Features were borrowed and added onto such places as porches and roof gables. This provided some hint of stylistic detailing on what was otherwise an unadorned traditional house form. This style is actually more a way of decorating a house than a precise stylistic category; however, the Folk Victorian house is so widespread that it demands a name.





Colonial Revival 1890-1955

Most Colonial Revival houses are symmetrical. A central entranceway is elaborated with a pediment supported by pilasters or columns. The use of broken pediments, fanlights and sidelights is common. Classical cornices with dentils or modillions are usually present. These features tend to be larger than original colonial details. The roof may be hipped or side-gabled with dormers. Windows have double-hung sashes, usually with six-over-six or nine-over-nine panes and may be paired. Walls are of masonry, masonry-veneer or wood.





English Vernacular Revival 1900-1940

Characteristics of English Vernacular Revival houses are a steeply pitched gabled roof with dominant front-facing gable and decorative half-timbering in the gables. Almost all have masonry walls. Most are masonry-veneered, a recently developed technique for applying a thin layer of masonry to a wall. Some houses have patterned brickwork, while others may be completely stuccoed. Often a variety of materials are used, such as brick walls with stone trim, wood half-timbering, and stuccoed gables. Massive masonry chimneys with decorative tops are common. Windows are generally tall and narrow, grouped together, multi-paned, and casements rather than double-hung. Some openings, particularly the entrance, may be emphasized by a round arch. Houses of this style are generally asymmetrical.





Craftsman 1910-1930

The Craftsman house uses a wide variety of materials both for its structure and decorative detailing. It has a low-pitched roof that is usually gabled but may also be hipped, giving a generally horizontal effect. The widely overhanging eaves are open with exposed rafters. Large gables have decorative brackets or braces at the eaves and may be covered with half-timbering. Roof dormers are sometimes found. Walls are most often wood but may also be covered with shingles or a masonry veneer of stone or brick. Porches have short square columns set on heavy masonry piers extending to the ground. Windows may have a multi-paned sash over a large one-pane sash. Craftsman houses are most often asymmetrical with a generally open and functional plan.





Gothic Revival 1850-1890

Gothic Revival houses typically have steeply pitched gabled roofs with both front-and side-facing gables. Decoratively sawn bargeboards are commonly found along the eaves. Window and door openings often have either pointed arched tops or heavily molded or pointed hoods. Porches are usually supported by slender posts with sawn woodwork forming

flattened arches or brackets. Some houses have vertical board-and-batten siding. This style emphasized picturesqueness, verticality, and varied use of materials.





Greek Revival 1825-1860

The Greek Revival style is characterized by details such as prominent columns, pilasters, and wide plain entablatures that encircle a house. Proportions are large and heavy. A symmetrical, rectangular block has a symmetrical front facade with a central entrance. An elaborate door surround contains a rectangular transom, sidelights and pilasters. A typical expression of the Greek Revival in Georgia is a low-pitched, hipped roof supported by columns to form a full-width porch. Porticoes with triangular pediments are also found. Vernacular interpretations with simplified details, such as square rather than round columns, are common. Double-hung windows generally have six-over-six panes.









Neoclassical Revival 1895-1940

The most common feature of the Neoclassical Revival style is a dominant full-height front portico with classical columns. The portico may be at the entry or may cover the full facade; it may have a triangular pediment or be part of the overall roof. A full-height entry portico is often coupled with a one-story full-facade porch. The facade is more or less symmetrical, and the central entrance, surrounded with pilasters and columns, is elaborated with fanlights, sidelights, and transoms. There is almost always a classical cornice with dentils or modillions. The roof is usually low-pitched and hipped and may have a balustrade. A porte-cochere and side porches supported by columns are common.





Italianate 1840-1885

Italianate houses are generally asymmetrical with an L-shaped or other irregularly shaped plan and gabled roof. Distinguishing features are the widely overhanging eaves with decorative brackets that emphasize the cornice. Typically tall narrow windows with large two-over-two or one-over-one panes are often paired, arched, and topped with elaborate hoods. Bay windows are also common. Italianate style residential architecture faded out during the 1880s; however, many Italianate style commercial blocks were constructed until the 1890s. The flat topped blocks with brackets and decorative window

moldings were two or more stories tall and featured large storefront windows. Brackets beneath eaves are the most distinguishing characteristic of the Italianate commercial block.



Mediterranean Revival 1890-1910

A Mediterranean Revival house has smooth stuccoed or masonry walls and is usually asymmetrical. The roof is covered with clay tile, is low-pitched, and may be either hipped or gabled. Houses following the Spanish tradition will have little or no eave overhang, while those following the Italian influence will have widely overhanging eaves with exposed rafters. Recessed and arcaded loggias, or open porches, are common. Windows are generally arched and may be grouped together. Sometimes columns and pilasters are used to elaborate openings.





Oueen Anne 1880-1915

A Queen Anne style house is asymmetrical with complex roof and wall shapes. It displays a variety of textures, materials, and detailing. The asymmetrical shape results from a floor plan that is open and flowing. The roof is often steeply pitched and hipped with both front-and side-facing, or cross, gables. Wall surfaces avoid a smooth appearance through the use of projecting bays and materials such as patterned shingles that provide texture. The porch is usually asymmetrical and often wraps around two sides of the house. It is supported with slender turned posts and often decorated with sawn brackets and spindlework friezes. Roof gables may also be decorated with sawn ornamentation or spindlework and covered with patterned shingles. There are often prominent and elaborate brick chimneys with patterned and corbeled brickwork. A round or multi-sided tower may be found at a comer.





Spanish Colonial Revival 1900-1940

A Spanish Colonial Revival house has a clay tile roof that is usually gabled with little eave overhang. Walls are of smooth stucco. Arched openings and arcaded loggias, or open porches, are common. Windows are generally casement and grouped together. The roof may be elaborated with curvilinear gables or parapets from the mission tradition. Exposed roof beams may protrude from the walls to emphasize construction methods.







The University of Georgia College of Environment and Design Center for Community Design & Preservation Historic Resources Survey Report Pierce County, Georgia 2016